



TOYOTA

 Code 

**0-9**

11B ..... 1574

12HT ..... 1588

12T ..... 1532

12T-J ..... 1532

13B ..... 1580

13T ..... 1540

14B ..... 1586

1AD-FTV ..... 1544

1AZ-FE ..... 1544

1AZ-FSE ..... 1546

1C ..... 1538

1CD-FTV ..... 1546-1548

1C-L ..... 1538

1C-TL ..... 1540

1E ..... 1522

1E-L ..... 1522

1FZ-FE ..... 1590

1G-EU ..... 1548

1GR-FE ..... 1586

1HD-FT ..... 1588

1HD-FTE ..... 1588

1HD-T ..... 1588

1H-Z ..... 1588

1KD-FTV ..... 1568

1KR-FE ..... 1522

1KZ-T ..... 1570

1KZ-TE ..... 1570

1MZ-FE ..... 1570-1574

1N ..... 1528

1ND-TV ..... 1526

1NR-FE ..... 1522

1NZ-FE ..... 1528

1NZ-FXE ..... 1528

1PZ ..... 1584



1RZ ..... 1548

1RZ-E ..... 1548

1S-L ..... 1540

1SZ-FE ..... 1522

1TR-FE ..... 1548

 Code 

1WZ ..... 1544

1ZR-FAE ..... 1532

1ZR-FE ..... 1532

1ZZ-FE ..... 1540

22R ..... 1564

22RE ..... 1564

22REC ..... 1564

2A ..... 1524

2AD-FHV ..... 1558

2AD-FTV ..... 1558

2AZ-FE ..... 1560

2AZ-FSE ..... 1560

2AZ-FXE ..... 1560

2C ..... 1548-1550

2C-E ..... 1550

2C-L ..... 1548

2C-T ..... 1550

2C-TE ..... 1550

2E ..... 1524

2E-E ..... 1524

2F ..... 1588

2GR-FE ..... 1584

2GR-FSE ..... 1584

2GR-FXE ..... 1586

2H ..... 1588

2JZ-GE ..... 1574

2JZ-GTE ..... 1576

2KD-FTV ..... 1564

2L ..... 1560

2L-T ..... 1562

2L-TE ..... 1562

2NZ-FE ..... 1524

2RZ-E ..... 1562

2RZ-FE ..... 1562

2S-E ..... 1552



2S-EL ..... 1552

2S-ELC ..... 1552

2SZ-FE ..... 1524

2T ..... 1532

2TR-FE ..... 1566

 Code 

2TR-FZE ..... 1566

2TZ-FE ..... 1564

2VZ-FE ..... 1564

2WZ-TV ..... 1526

2Y ..... 1540

2Y-C ..... 1540

2ZR-FAE ..... 1540

2ZR-FE ..... 1542

2ZR-FXE ..... 1542

2ZZ-GE ..... 1542

3A ..... 1528

3B ..... 1580

3C-TE ..... 1558

3E ..... 1530

3F ..... 1588

3GR-FE ..... 1576

3GR-FSE ..... 1576

3L ..... 1568

3MZ-FE ..... 1580

3RZ-FE ..... 1568

3S-FE ..... 1552-1554

3S-GE ..... 1554

3S-GEL ..... 1554

3S-GELC ..... 1554

3S-GELU ..... 1554

3S-GTE ..... 1556

3SZ-VE ..... 1530

3T ..... 1540

3T-C ..... 1540

3T-E ..... 1540

3VZ-E ..... 1578

3VZ-FE ..... 1578

3Y ..... 1556

3ZR-FAE ..... 1556

3ZZ-FE ..... 1532



4A-C ..... 1532

4A-F ..... 1532

4A-FE ..... 1532-1536

4A-FE Lean Burn ..... 1536

4A-GE ..... 1536

 Code 

4A-GE (20V) ..... 1536

4A-GEC ..... 1536

4A-GEL ..... 1536

4A-GELC ..... 1536

4A-GEU ..... 1536

4A-GZE ..... 1538

4A-LC ..... 1538

4E-FE ..... 1524-1528

4GR-FSE ..... 1566

4K ..... 1526

4K-C ..... 1526

4Y ..... 1558

4Y-EC ..... 1558

4ZZ-FE ..... 1528

5A-FE ..... 1530

5E-FE ..... 1530

5GR-FE ..... 1566

5K ..... 1530

5L ..... 1578

5M-GE ..... 1568

5S-FE ..... 1558-1560

5S-FNE ..... 1558

5VZ-FE ..... 1582

7A-FE ..... 1542

7M-GEU ..... 1578

7M-GTE ..... 1578

**B**

B ..... 1568

**E**

EJ-VE ..... 1522

**K**


K3-VE ..... 1522

**L**

L ..... 1556

TOYOTA

 Code 

 Code 

 Code 

 Code 

TOYOTA						
Ltr.						
1,0 EJ-VE	43 kW (58 PS) DUET	09/98-04/04	<b>S40048-00</b> 04111-97206 <b>D40048-00</b> 04112-97206	⑫ ⑬ <b>H40048-00</b> 11115-97201 73,8 Ø MLS 		
1,0 1E 1E-L	40 kW (54 PS) STARLET	10/84-12/92	<b>S80865-00</b> 04111-10035  <b>D80865-00</b> 04112-10022	⑫ ⑬ <b>H80865-00</b> 11115-10010 72 Ø 		<b>T40319-00</b> 90105-09002 (10x) 
1,0 1KR-FE	50-51 kW (68-69 PS) AYGO YARIS VWT-i	07/05→	<b>S36775-00</b> 04111-00016 <b>D36775-00</b> 04112-00014	⑫ ⑬ <b>H80621-00</b> 11115-40060 MLS 		<b>T80621-00</b> 
1,0 1SZ-FE	48-50 kW (65-68 PS) YARIS	04/99-09/05	<b>S40034-00</b> 04111-23040 <b>D40034-00</b> 04112-23040	⑫ ⑬ <b>H40034-00</b> 11115-23090 70 Ø MLS 		<b>T40342-00</b> 90910-02143 (10x) 
1,3 K3-VE <b>[NEW]</b>	63-68 kW (86-92 PS) AVANZA	12/03→	<b>S38691-00</b> 04111-BZ102 <b>D38692-00</b> 04112-BZ102	⑫ ⑬ ⑰ <b>H40690-00</b> 11115-B1030 0,35 mm MLS 		<b>T40342-00</b> 90910-02143 (10x) 
1,3 1NR-FE	70-74 kW (95-101 PS) AURIS VVTi COROLLA URBAN CRUISER URBAN CRUISER VWT-i YARIS YARIS VWT-i	01/07→	<b>S40559-00</b> 04111-47073 <b>D40559-00</b> 04112-47033	⑫ ⑭ <b>H40559-00</b> 11115-47050 0,5 mm MLS 		<b>T40559-00</b> 90910-02174 (10x) 




















⑭ sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала  
 ⑰ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>X83291-01</b> 11213-97202 	<b>N93033-01</b> 	<b>X89739-01</b> 17177-97202 	<b>X82262-01</b> 17173-87229 	<b>70-31414-10</b> 	
<b>V37957-00</b> 	<b>N93058-00</b> 90913-02089 (8x) +90913-02081 (4x)	<b>X89645-01</b> 17177-10020 	<b>X82171-01</b> 17173-10021 	2x <b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77511-01 K →</b> 90311-75009 75x100x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>X83080-01</b> 11213-00010 NBR 	<b>N92658-00</b> 90080-31065 (6x) +90080-31064 (6x)	<b>X89098-01</b> 17177-00010 	<b>X81894-01</b> 17173-00010 	<b>70-31414-10</b> 	<b>P77413-01 K ←</b> 90311-28091 38x50x6 A SL RD NBR <b>P77436-01 K →</b> 90311-73002 74x89x8,5 A SL LD MVQ
<b>V37975-00</b> 11213-23020 	<b>N93033-00</b> 90913-02120 (16x)	<b>X89724-01</b> 17177-23020 	<b>X82244-01</b> 17173-23010 	<b>70-31414-10</b> 	<b>P77488-01 K ←</b> 36x49x7 A SL RD MVQ <b>P76338-11 K →</b> 80x100x10 A SL LD FPM <b>P77610-01 N</b> 40x55x9 A SL RD MVQ
<b>V37975-00</b> 11213-23020 	<b>N93033-00</b> 90913-02120 (16x)	<b>X59880-01</b> 17177-B1020 	<b>X82244-01</b> 17173-23010 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77436-01 K →</b> 90311-73002 74x89x8,5 A SL LD MVQ
<b>X59432-01</b> 11213-47020 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> ES 8x 90080-31084 <b>P76880-00</b> AS 8x 90080-31085	<b>X59433-01</b> 17173-47010 	<b>X59434-01</b> 17173-47020 	<b>70-31414-10</b> 	<b>P77484-01 K ←</b> 90311-25020 25,5x37,5x6 A SL RD NBR <b>P77759-01 K →</b> 90311-78003 77,5x171,5x8,7 A SL LD FPM <b>P77760-01 K → (A)</b> 90311-99012 157,5x171,5x8 A SL FPM <b>P77761-01 K → (A)</b> 90311-99011 138x153x10 AB SL LD FPM































AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
 ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA				
Ltr. 				
1,3 2A	48 kW (65 PS) TERCEL	03/79-01/88	<b>D80869-00</b> ⑫ 04112-14070 ① 08/84-04/86	<b>H80869-00</b> 11115-14031 77,3 Ø 
1,3 2E	53-60 kW (72-82 PS) COROLLA STARLET	08/83-04/97	<b>S80866-00</b> ⑫ ⑬ 04111-11020  <b>D80866-00</b> ⑫ 04112-11020	<b>H80866-10</b> 11115-11060 74,5 Ø  <b>T40319-00</b> 90105-09002 (10x) 
1,3 2E-E	55 kW (75 PS) COROLLA STARLET	08/87-03/96	<b>S80987-00</b> ⑫ ⑬ 04111-11035  <b>D80987-00</b> ⑫ 04112-11022	<b>H80987-00</b> 11115-11010 74,5 Ø  <b>T40319-00</b> 90105-09002 (10x) 
1,3 2NZ-FE	62-63 kW (84-86 PS) YARIS YARIS VWT-i	11/99→	<b>S40032-00</b> ⑫ ⑬ 04111-21040 <b>D40032-00</b> ⑫ 04112-21040	<b>H40032-00</b> 11115-21050 75,5 Ø MLS  <b>T40339-00</b> 90910-02126 (10x) 
1,3 2SZ-FE	64 kW (87 PS) YARIS YARIS VWT-i	04/02→	<b>S40047-00</b> ⑫ ⑬ <b>D40047-00</b> ⑫	<b>H40047-00</b> 11115-23042 73,5 Ø MLS  <b>T40335-00</b> 90910-02100 (5x) +90910-02101 (5x) 
1,3 4E-FE	55 kW (75 PS) COROLLA STARLET	09/95-03/99	<b>S80988-00</b> ⑫ ⑬ 04111-11141  <b>D80988-00</b> ⑫ 04112-11121	<b>H80988-00</b> 11115-11071 75,5 Ø  <b>T40335-00</b> 90910-02100 (5x) +90910-02101 (5x) 

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



					
<b>X83187-01</b> 11213-15020 ① 05/82-07/84 	<b>N93020-00</b> 90913-02038 (8x) 	<b>X89815-01</b> ⑦ 17172-15010 			
<b>X83233-01</b> 11213-15040 ① 08/84-04/86 	<b>V37957-00</b> 	<b>N93009-00</b> 90913-02071 (12x) <b>P76825-00</b> 90913-02071	<b>X89645-01</b> 17177-10020 	<b>X82171-01</b> 2x 17173-10021 	<b>70-31414-10</b> 
					<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77511-01 K →</b> 90311-75009 75x100x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37957-00</b> 	<b>N93058-00</b> 90913-02089 (8x) +90913-02081 (4x)	<b>X89679-01</b> 17177-10020 	<b>X82171-01</b> 2x 17173-10021 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77511-01 K →</b> 90311-75009 75x100x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37972-00</b> 11213-21011 	<b>N93031-00</b> 90913-02092 (8x) +90913-02093 (8x)	<b>X89719-01</b> 17177-21020 	<b>X82241-01</b> 17173-21020 	<b>70-31414-10</b> 	<b>P77484-01 K ←</b> 90311-25020 25,5x37,5x6 A SL RD NBR <b>P77414-01 K →</b> 90311-75016 75x107x8 A SL LD MVQ
<b>V37975-00</b> 11213-23020 	<b>N93033-00</b> 90913-02120 (16x)	<b>X89724-01</b> 17177-23020 	<b>X82244-01</b> 17173-23010 	<b>70-31414-10</b> 	
<b>V37958-00</b> 11213-11041 (1X) +11193-15010 (4X) +90210-06013 (5X) 	<b>N93004-00</b> 90913-02086 (8x) +90913-02088 (8x)	<b>X59526-01</b> 17177-11070 	<b>X82207-01</b> 17173-11040 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77511-01 K →</b> 90311-75009 75x100x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ



TOYOTA						
Ltr.						
1,3	4E-FE	65 kW (88 PS) COROLLA TERCEL	07/92-09/99	<b>S80988-00</b> 04111-11141  <b>D80988-00</b> 04112-11121	<b>H80988-00</b> 11115-11071 75,5 Ø 	<b>T40335-00</b> 90910-02100 (5x) +90910-02101 (5x) 
1,3	4K 4K-C	41-48 kW (56-65 PS) COROLLA LITEACE STARLET	02/78-08/87	<b>S80862-00</b> 04111-13031 <b>D80862-00</b> 04112-13014	<b>H80862-10</b> 11115-13031 77,5 Ø 	
1,4	1ND-TV	55-66 kW (75-90 PS) COROLLA D YARIS D-4D	12/01→	<b>S36926-00</b> 04111-33022  <b>D36926-00</b> 04112-33021 	<b>H31827-30</b> 11115-33022-C0 3 MLS <b>H41827-40</b> 11115-33022-D0 4 MLS <b>H51827-50</b> 11115-33022-E0 5 MLS 	
1,4	2WZ-TV	40 kW (54 PS) AYGO	07/05-08/10	<b>D36724-00</b>  <b>B36724-00</b>	<b>H08129-00</b> SU001-00493 1,2 mm 2 MLS <b>H08129-10</b> SU001-00494 1,3 mm 3 MLS <b>H08129-20</b> SU001-00495 1,35 mm 1 MLS <b>H18129-30</b> SU001-00496 1,4 mm 4 MLS <b>H18129-40</b> SU001-00497 74,7 Ø 1,45 mm 5 MLS 	<b>T08130-00</b> SU001-00795 (10x) 

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



<b>V37958-00</b> 11213-11041 (1X) +11193-15010 (4X) +90210-06013 (5X) 	<b>N93004-00</b> 90913-02086 (8x) +90913-02088 (8x)	<b>X89694-01</b> 17177-11021 ① →03/95  <b>X59526-01</b> 17177-11070 ① 04/95→ 	<b>X82207-01</b> 17173-11040 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77511-01 K →</b> 90311-75009 75x100x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>X83177-01</b> 11213-22010 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89814-01</b> ⑦ 2x 17172-13021 	<b>X54859-01</b> 12151-13010 	<b>P77590-01 K ←</b> 90311-38013 38,5x58x11 A SL RD MVQ <b>P77507-01 K →</b> 90311-70003 70x92x12 A SL LD MVQ	
<b>X83095-01</b> 11213-33021 	<b>N92102-00</b> 90913-02121 (8x)	<b>X81911-01</b> 17173-33010 	<b>70-31414-10</b> 	<b>P77413-01 K ←</b> 90311-28091 38x50x6 A SL RD NBR <b>P77414-01 K →</b> 90311-75016 75x107x8 A SL LD MVQ	
<b>V38516-00</b> SU001-00822 +SU001-00825 (4x) +SU001-00796 (2x)  <b>X83035-01</b> SU001-00822 NBR 	<b>N92983-00</b> SU001-00553 (8x) <b>P76779-00</b> 8x	<b>W88317-01</b> 4x SU001-00825 	<b>X81696-01</b> SU001-00826 	<b>70-31414-10</b> 	<b>P77361-01 K ←</b> SU001-00818 40x55x6,4 A SL RD PTFE ACM <b>P77362-01 K →</b> SU001-00817 85x105x8,8 A SL LD PTFE ACM <b>P77668-01 N</b> SU001-00820 27x47x7 A SL RD PTFE ACM



TOYOTA						
Ltr.						
1,4 4E-FE	63 kW (86 PS) COROLLA	04/97-02/00	<b>S80988-00</b> 04111-11141  <b>D80988-00</b> 04112-11121	<b>H80988-00</b> 11115-11071 75,5 Ø 	<b>T40335-00</b> 90910-02100 (5x) +90910-02101 (5x) 	
1,4 4ZZ-FE	71 kW (97 PS) COROLLA COROLLA VVT-i	02/00-07/07	<b>S40033-00</b> 04111-22060 <b>D40033-00</b> 04112-22060	<b>H40033-00</b> 11115-22040 80 Ø MLS 	<b>T40341-00</b> 90910-02152 (10x) 	
1,5 1N	40 kW (54 PS) STARLET D	12/86-03/96	<b>S83266-00</b> 04111-55030  <b>D83266-00</b> 04112-55030 	<b>H01046-00</b> 11115-5503-01 75 Ø 1,45 mm 1 <b>H11046-10</b> 11115-5503-02 75 Ø 1,55 mm 2 <b>H21046-20</b> 11115-5503-03 75 Ø 1,65 mm 3	<b>T40338-00</b> 90910-02105 (10x) 	
1,5 1NZ-FE	77-80 kW (105-109 PS) YARIS YARIS TS YARIS VVT-i	03/00→	<b>S40032-00</b> 04111-21040 <b>D40032-00</b> 04112-21040	<b>H40032-00</b> 11115-21050 75,5 Ø MLS 	<b>T40339-00</b> 90910-02126 (10x) 	
1,5 1NZ-FXE	53-57 kW (72-78 PS) PRIUS	05/00-03/09		<b>H40032-00</b> 11115-21050 75,5 Ø MLS 	<b>T40339-00</b> 90910-02126 (10x) 	
1,5 3A	52 kW (70-71 PS) TERCEL	08/82-01/88	<b>S80872-00</b> 04111-15060  <b>D80872-00</b> 04112-15050	<b>H80872-00</b> 11115-15060 79 Ø 		

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



<b>V37958-00</b> 11213-11041 (1X) +11193-15010 (4X) +90210-06013 (5X) 	<b>N93004-00</b> 90913-02086 (8x) +90913-02088 (8x)	<b>X59526-01</b> 17177-11070 	<b>X82207-01</b> 17173-11040 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77511-01 K →</b> 90311-75009 75x100x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37974-00</b> 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x)	<b>X89723-01</b> 17171-22030 	<b>X82243-01</b> 17173-22010 	<b>70-31414-10</b> 	<b>P77587-01 K ←</b> 90311-38017 38x50x8 A SL RD NBR <b>P77515-01 K →</b> 90311-76001 76x94x8,5 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83266-01</b> 11273-55010 	<b>N93006-00</b> 91913-02089 (4x) +90913-02090 (4x)	<b>X89702-01</b> 17177-55012 	<b>X82226-01</b> 17173-55010 <b>X82323-01</b> 	<b>70-31414-10</b> 	<b>P77491-01 K ←</b> 90311-38025 38x50x7 A SL RD NBR <b>P76338-11 K →</b> 80x100x10 A SL LD FPM <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37972-00</b> 11213-21011 	<b>N93031-00</b> 90913-02092 (8x) +90913-02093 (8x)	<b>X89719-01</b> 17177-21020 	<b>X82241-01</b> 17173-21020 	<b>70-31414-10</b> 	<b>P77484-01 K ←</b> 90311-25020 25,5x37,5x6 A SL RD NBR <b>P77414-01 K →</b> 90311-75016 75x107x8 A SL LD MVQ
<b>V37972-00</b> 11213-21011 	<b>N93031-00</b> 90913-02092 (8x) +90913-02093 (8x)	<b>X89773-01</b> 17177-21010 (10x) 	<b>X82241-01</b> 17173-21020 	<b>70-31414-10</b> 	
<b>X83233-01</b> 11213-15040 	<b>N93020-00</b> 90913-02038 (8x)		<b>X89815-01</b> ⑦ 17172-15010 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77507-01 K →</b> 90311-70003 70x92x12 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ



TOYOTA						
Ltr.						
1,5 3E	52 kW (71 PS)	TERCEL	10/82-01/88	<b>S80866-01</b> 04111-11051  <b>D80866-01</b> 04112-11040	<b>H80866-10</b> 11115-11060 74,5 Ø 	<b>T40319-00</b> 90105-09002 (10x) 
1,5 3SZ-VE <b>[NEW]</b>	75-80 kW (102-109 PS)	AVANZA RUSH	03/06→	<b>S38691-00</b> 04111-BZ102 <b>D38692-00</b> 04112-BZ102	<b>H40690-00</b> 11115-B1030 0,35 mm MLS 	<b>T40342-00</b> 90910-02143 (10x) 
1,5 5A-FE	63-78 kW (86-106 PS)			<b>S40606-00</b> <b>D40606-00</b>	<b>H40606-00</b> 11115-15090 1,4 mm 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 
1,5 5E-FE	66-85 kW (90-116 PS)	PASEO	08/95-07/99	<b>S80988-01</b> 04111-11150  <b>D80988-01</b> 04112-11130	<b>H80988-00</b> 11115-11071 75,5 Ø 	<b>T40335-00</b> 90910-02100 (5x) +90910-02101 (5x) 
1,5 5E-FE	70-74 kW (95-101 PS)	PASEO TERCEL	04/91-09/99	<b>S80988-01</b> 04111-11150  <b>D80988-01</b> 04112-11130	<b>H80988-00</b> 11115-11071 75,5 Ø 	<b>T40335-00</b> 90910-02100 (5x) +90910-02101 (5x) 
1,5 5K	51-52 kW (69-71 PS)	LITEACE	10/85-01/95	<b>S80954-00</b> 04111-13042 <b>D80954-00</b> 04112-13020	<b>H80954-00</b> 11115-13040 82 Ø 	

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



<b>V37957-00</b> 	<b>N92012-02</b> 90913-02062 (12x) 	<b>X89645-01</b> 17177-10020 	<b>X82172-01</b> 17173-11020 	2x <b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77516-01 K →</b> 90311-80007 80x100x8,5 A SL LD FPM <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37975-00</b> 11213-23020 	<b>N93033-00</b> 90913-02120 (16x) 	<b>X59880-01</b> 17177-B1020 	<b>X82244-01</b> 17173-23010 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77436-01 K →</b> 90311-73002 74x89x8,5 A SL LD MVQ
<b>V83415-00</b> 11213-15071 (1x) +0210-06010 (4x) +11193-15010 (4x) 	<b>N93006-02</b> 90913-02085 (8x) +90913-02090 (8x) 	<b>X89683-01</b> 17171-15030 	<b>X82210-01</b> 17173-15040 	<b>70-31414-10</b> 	<b>P77580-01 K ←</b> 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37958-00</b> 11213-11041 (1x) +11193-15010 (4x) +90210-06013 (5x) 	<b>N93033-00</b> 90913-02120 (16x) 	<b>X59526-01</b> 17177-11070 	<b>X82219-01</b> 17173-11050  <b>X82403-01</b> 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77516-01 K →</b> 90311-80007 80x100x8,5 A SL LD FPM <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37958-00</b> 11213-11041 (1x) +11193-15010 (4x) +90210-06013 (5x) 	<b>N93033-00</b> 90913-02120 (16x) 	<b>X89694-01</b> 17177-11021 ① →03/95  <b>X59526-01</b> 17177-11070 ① 04/95→ 	<b>X82219-01</b> 17173-11050  <b>X82403-01</b> 	<b>70-31414-10</b> 	<b>P77586-01 K ←</b> 90311-35040 35x49x6 A SL RD MVQ <b>P77516-01 K →</b> 90311-80007 80x100x8,5 A SL LD FPM <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>X83177-01</b> 11213-22010 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x) 		<b>X89814-01</b> ⑦ 2x 17172-13021 	<b>X54892-01</b> 12151-13011 	<b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ

⑬ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



TOYOTA						
Ltr.						
1,6 1ZR-FAE <b>[NEW]</b>	97 kW (132 PS) AURIS AVENSIS COROLLA VERSO	01/09→	<b>S38279-02</b> 04111-37201 <b>D38279-02</b> 04112-37201	<b>H40558-00</b> 11115-37060 0,7 mm MLS 	<b>T40558-00</b> 90910-02166 (10x) 	
1,6 1ZR-FE	91-97 kW (124-132 PS) AURIS VVTi COROLLA COROLLA VVTi	11/06→	<b>S38279-00</b> 04111-0T081 <b>D38279-00</b> 04112-0T011	<b>H40558-00</b> 11115-37060 0,7 mm MLS 	<b>T40558-00</b> 90910-02166 (10x) 	
1,6 12T 12T-J 2T	54-66 kW (73-90 PS) CARINA CELICA COROLLA	02/76-09/83	<b>S80878-00</b> 04111-28014 <b>D80878-00</b> 04112-28014	<b>H80878-00</b> 11115-26024 87 Ø 		
1,6 3ZZ-FE	81 kW (110 PS) AVENSIS VVT-i COROLLA COROLLA VVT-i	02/00-03/09	<b>S40033-00</b> 04111-22060 <b>D40033-00</b> 04112-22060	<b>H40033-00</b> 11115-22040 80 Ø MLS 	<b>T40341-00</b> 90910-02152 (10x) 	
1,6 4A-C	55-57 kW (75-78 PS) COROLLA	05/83-08/87	<b>S80945-00</b> 04111-16080  <b>D80945-00</b> 04112-16080	<b>H80945-00</b> 11115-16050 82,5 Ø 		
1,6 4A-F 4A-FE	66-77 kW (90-105 PS) CARINA CELICA STi COROLLA	08/87-11/93	<b>S80946-00</b> 04111-16120  <b>D80946-00</b> 04112-16120	<b>H80946-00</b> 11115-16082 82 Ø 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 	

⑫ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена

⑬ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус впускного коллектора



<b>V38278-00</b> 11213-0T020 +11193-0T010 (4x) 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> 90080-31084 <b>P76880-00</b> 90080-31085	<b>X82513-01</b> 17177-37030 	<b>X59400-01</b> 17173-0T020 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77746-01 K →</b> 90311-W0011 78x110x8,5 A SL LD FPM
<b>V38278-00</b> 11213-0T020 +11193-0T010 (4x) 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> 90080-31084 <b>P76880-00</b> 90080-31085	<b>X82513-01</b> 17177-37030 	<b>X59400-01</b> 17173-0T020 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77746-01 K →</b> 90311-W0011 78x110x8,5 A SL LD FPM
<b>X83189-01</b> 11213-25012 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89613-01</b> 17177-25030 	<b>X82138-01</b> 17173-25012 	<b>X54854-01</b> 12151-25010 	<b>P77590-01 K ←</b> 90311-38013 38,5x58x11 A SL RD MVQ <b>P77512-01 K →</b> 75x100x13 A SL LD MVQ
<b>V37974-00</b> 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x)	<b>X89723-01</b> 17171-22030 	<b>X82243-01</b> 17173-22010 	<b>70-31414-10</b> 	<b>P77587-01 K ←</b> 90311-38017 38x50x8 A SL RD NBR <b>P77515-01 K →</b> 90311-76001 76x94x8,5 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83233-01</b> 11213-15040 	<b>N93020-00</b> 90913-02038 (8x)	<b>X89815-01</b> 17172-15010 		<b>70-31414-10</b> 	<b>P77580-01 K ←</b> 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>X83236-01</b> 11213-15050 	<b>N93009-01</b> 90913-02062 (8x) +90913-02089 (8x)	<b>X89647-01</b> 17171-16031  <b>X89827-01</b> 17171-15020 	<b>X82174-01</b> 17173-15011 	<b>70-31414-10</b> 	<b>P77580-01 K ←</b> 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ

⑭ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска

ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA						
Ltr.						
1,6 4A-FE	74-84 kW (101-114 PS)	AVENSIS COROLLA	07/92-10/00	<b>S80993-00</b> 04111-16230  <b>D80993-00</b> 04112-16230 ⑫ ⑬	<b>H80993-00</b> 11115-16150 82 Ø 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 
1,6 4A-FE	76-85 kW (103-116 PS)	CARINA COROLLA	07/92-09/97	<b>S80993-00</b> 04111-16230 ① →06/94  <b>S80993-01</b> 04111-16300 ① 07/94→ <b>D80993-00</b> 04112-16230 ① →06/94 <b>D80993-01</b> ① 07/94→ ⑫ ⑬	<b>H80993-00</b> 11115-16150 82 Ø 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 
1,6 4A-FE	77 kW (105 PS)	COROLLA	08/88-06/92	<b>S80946-00</b> 04111-16120  <b>D80946-00</b> 04112-16120 ⑫ ⑬	<b>H80946-00</b> 11115-16082 82 Ø 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 
1,6 4A-FE	77-88 kW (105-120 PS)	CARINA COROLLA	10/87-03/92	<b>S80946-00</b> 04111-16120  <b>D80946-00</b> 04112-16120 ⑫ ⑬	<b>H80946-00</b> 11115-16082 82 Ø 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>V37961-00</b> 	<b>N93006-01</b> 90913-02089 (8x) +90913-02090 (8x) 	<b>X89683-01</b> 17171-15030 	<b>X82210-01</b> 17173-15040 	<b>70-31414-10</b> 	<b>P77580-01 K ←</b> 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37961-00</b> 	<b>N93006-01</b> 90913-02089 (8x) +90913-02090 (8x) 	<b>X89683-01</b> 17171-15030 ① →06/94 <b>X89690-01 L</b> ① 07/94→ <b>X89691-01 R</b> ① 07/94→ 	<b>X82210-01</b> 17173-15040 	<b>70-31414-10</b> 	<b>P77580-01 K ←</b> 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37961-00</b> 	<b>N93009-01</b> 90913-02062 (8x) +90913-02089 (8x) 	<b>X89647-01</b> 17171-16031  <b>X89827-01 ⑩</b> 17171-15020 	<b>X82174-01</b> 17173-15011 	<b>70-31414-10</b> 	<b>P77580-01 K ←</b> 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
	<b>N93009-01</b> 90913-02062 (8x) +90913-02089 (8x) 	<b>X89647-01</b> 17171-16031  <b>X89827-01 ⑩</b> 17171-15020 	<b>X82174-01</b> 17173-15011 	<b>70-31414-10</b> 	<b>P77580-01 K ←</b> 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ

























TOYOTA						
Ltr.						
1,6 4A-FE	85 kW (115 PS) CARINA COROLLA	04/92-09/97	<b>S80946-00</b> (12) (13) 04111-16120 1 → 05/92  <b>S80993-00</b> (12) (13) 04111-16230 1 → 06/92-06/94  <b>S80993-01</b> (12) (13) 04111-16300 1 → 07/94 → <b>D80946-00</b> (12) 04112-16120 1 → 05/92 <b>D80993-00</b> (12) 04112-16230 1 → 06/92-06/94 <b>D80993-01</b> (12) 04112-16300 1 → 07/94 →	<b>H80946-00</b> 11115-16082 82 Ø 1 → 05/92  <b>H80993-00</b> 11115-16150 82 Ø 1 → 06/92 → 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 	
1,6 4A-FE Lean Burn	74 kW (101 PS) AVENSIS	09/97-10/00	<b>S80993-02</b> (12) (13) 04111-02022  <b>D80993-02</b> (12) 04112-02022	<b>H80993-00</b> 11115-16150 82 Ø 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 	
1,6 4A-GE 4A-GEC 4A-GEL 4A-GELC 4A-GEU	85-96 kW (115-131 PS) CELICA COROLLA MR 2	06/83-06/93	<b>S37205-00</b> (12) (13) 04111-16023  <b>D37205-00</b> (12) 04112-16023	<b>H80944-00</b> 11115-16070 82 Ø 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 	
1,6 4A-GE (20V) <b>[NEW]</b>	102-121 kW (118-165 PS)		<b>S40734-00</b> (12) (13) 04111-16211 1 → 12/95 <b>S40734-01</b> (12) (13) 04111-16330 1 → 01/96 → <b>D40734-00</b> (12) 04112-16210 1 → 12/95 <b>D40734-01</b> (12) 04112-16330 1 → 01/96 →	<b>H40734-00</b> 11115-16111 82,5 Ø 1,4 mm 		

Ⓜ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

























<b>V37961-00</b> 1 → 06/92 → 	<b>N93009-01</b> 90913-02062 (8x) +90913-02089 (8x) 1 → 05/92 <b>N93006-01</b> 90913-02089 (8x) +90913-02090 (8x) 1 → 06/92 →	<b>X89647-01</b> 17171-16031 1 → 05/92  <b>X89683-01</b> 17171-15030 1 → 06/92-06/94  <b>X89690-01</b> L 1 → 07/94 →  <b>X89691-01</b> R 1 → 07/94 →  <b>X89827-01</b> Ⓜ 17171-15020 1 → 05/92 	<b>X82174-01</b> 17173-15011 1 → 05/92  <b>X82210-01</b> 17173-15040 1 → 06/92 → 	<b>70-31414-10</b> 	<b>P77580-01</b> K ← 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01</b> K → 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01</b> N 90311-35040 35x49x6 A SL RD MVQ
<b>V37973-00</b> 	<b>N93006-01</b> 90913-02089 (8x) +90913-02090 (8x)	<b>X89722-01</b> 17171-15030 	<b>X82210-01</b> 17173-15040 	<b>70-31414-10</b> 	<b>P77580-01</b> K ← 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01</b> K → 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01</b> N 90311-35040 35x49x6 A SL RD MVQ
<b>X83234-01</b> 2x 11213-16010  <b>X83235-01</b> 11214-16020 	<b>N93009-01</b> 90913-02062 (8x) +90913-02089 (8x)	<b>X89646-01</b> 17177-16011 	<b>X82173-01</b> 17173-16011 	<b>70-31414-10</b> 	<b>P77580-01</b> K ← 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01</b> K → 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01</b> N 90311-35040 35x49x6 A SL RD MVQ
<b>V38754-00</b> 11213-16021 (1x) +11193-16010 (4x) +90210-09016 (3x) 	<b>N93031-01</b> 90913-02093 (12x) +90913-02092 (8x)	<b>X59950-01</b> 17177-16020 1 → 12/95  <b>X59953-01</b> 17177-16030 1 → 01/96 →  <b>X59951-01</b> Ⓜ 17179-16010 1 → 12/95  <b>X59954-01</b> Ⓜ 17179-16030 1 → 01/96 → 	<b>X59952-01</b> 17173-16020 1 → 12/95  <b>X59955-01</b> 17173-16030 1 → 01/96 → 	<b>70-31414-10</b> 	<b>P77580-01</b> K ← 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01</b> K → 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01</b> N 90311-35040 35x49x6 A SL RD MVQ <b>P77854-01</b> N 90311-40016 40,5x54,5x7 A SL RD



TOYOTA						
Ltr. 						
1,6 4A-GZE	91 kW (124 PS) MR 2	11/84-06/90	<b>S80944-00</b> (12) (13) 04111-16110 <b>D80944-00</b> (12) 04112-16110	<b>H80944-00</b> 11115-16070 82 Ø 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 	
1,6 4A-LC	55 kW (75 PS) CARINA	10/83-11/87	<b>S80870-00</b> (12) (13) 04111-16041 01/84-12/85  <b>S80945-01</b> (12) (13) 04111-16090 01/86→  <b>D80870-00</b> (12) 04112-16041 01/84-12/85 <b>D80945-01</b> (12) 04112-16090 01/86→	<b>H80870-10</b> 11115-16020 82,5 Ø 01/84-12/85  <b>H80945-00</b> 11115-16050 82,5 Ø 01/86→ 		
1,8 1C	41-49 kW (56-67 PS) COROLLA D LITEACE LITEACE D	10/82-06/93	<b>S80978-00</b> (12) (13) 04111-64111  <b>D80978-00</b> (12) 04112-64061	<b>H80978-00</b> 11115-64110 84 Ø MLS 	<b>T40334-00</b> 90910-02097 (8x) +90910-02099 (10x) 	
1,8 1C	43 kW (58 PS) COROLLA D	01/83-09/83	<b>S37223-00</b> (12) (13) 04111-64012  <b>D37223-00</b> (12) 04112-64010	<b>H40370-00</b> 11115-64010 86 Ø 		
1,8 1C-L	47 kW (64 PS) COROLLA D	06/83-05/88	<b>S80889-00</b> (12) (13) 04111-64061  <b>D80889-01</b> (12) 04112-64040	<b>H80889-10</b> 11115-64070 82,6 Ø MLS 	<b>T40334-00</b> 90910-02097 (8x) +90910-02099 (10x) 	

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



<b>X83234-01</b> 2x 11213-16010 	<b>N93009-01</b> 90913-02062 (8x) +90913-02089 (8x) 	<b>X89646-01</b> 17177-16011 	<b>X82173-01</b> 17173-16011 	<b>70-31414-10</b> 	<b>P77580-01 K</b> ← 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K</b> → 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37936-00</b> 01/84-12/85  <b>X83233-01</b> 11213-15040 01/86→ 	<b>N93020-00</b> 90913-02038 (8x) 	<b>X89815-01</b> ⑦ 17172-15010 		<b>70-31414-10</b> 	<b>P77580-01 K</b> ← 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K</b> → 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>V37938-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82175-01</b> 17173-64020 	<b>70-31414-10</b> 	<b>P77595-01 K</b> ← 90311-42003 42x60x7 A SL RD NBR <b>P77529-01 K</b> → 90x110x9 A SL LD NBR <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>V37938-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82175-01</b> 17173-64020 	<b>70-31414-10</b> 	<b>P77595-01 K</b> ← 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K</b> → 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>V37938-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82175-01</b> 17173-64020 	<b>70-31414-10</b> 	<b>P77595-01 K</b> ← 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K</b> → 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR



TOYOTA						
Ltr.						
1,8 1C-TL	54 kW (73 PS) CAMRY TD	11/83-01/88	<b>S80889-01</b> 04111-64032 <b>D80889-00</b> 04112-64030	⑫ ⑬ <b>H80889-10</b> 11115-64070 82,6 Ø MLS	<b>T40334-00</b> 90910-02097 (8x) +90910-02099 (10x)	
1,8 1S-L	66-74 kW (90-101 PS) CAMRY CARINA	02/83-08/88	<b>S80874-00</b> 04111-63020 <b>D80874-00</b> 04112-63020	⑫ ⑬ <b>H80874-00</b> 11115-63010 83 Ø		
1,8 1ZZ-FE	92-105 kW (125-143 PS) AVENSIS AVENSIS VWT-i CELICA VT-i COROLLA COROLLA VWTi MR 2 VT-i RAV VWTi VITZ VWTi	08/99→	<b>S40033-00</b> 04111-22060 <b>D40033-00</b> 04112-22060	⑫ ⑬ <b>H40033-00</b> 11115-22040 80 Ø MLS	<b>T40341-00</b> 90910-02152 (10x)	
1,8 13T 3T 3T-C 3T-E	57-63 kW (78-86 PS) CARINA COROLLA CORONA	01/78-09/83	<b>S80878-00</b> 04111-28014 <b>D80878-00</b> 04112-28014	⑫ ⑬ <b>H80878-00</b> 11115-26024 87 Ø		
1,8 2Y 2Y-C	58-61 kW (79-83 PS) F BUS HIACE HILUX	11/82-07/94	<b>S80876-00</b> 04111-73010 <b>D80876-00</b> 04112-73010	⑫ ⑬ <b>H80876-20</b> 11115-73041 88 Ø		
1,8 2ZR-FAE <b>[NEW]</b>	98-108 kW (133-147 PS) AURIS VERSO WISH	02/09→	<b>S38279-02</b> 04111-37201 <b>D38279-02</b> 04112-37201	⑫ ⑬ ⑰ <b>H40558-00</b> 11115-37060 0,7 mm MLS	<b>T40558-00</b> 90910-02166 (10x)	

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена

⑰ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>V37938-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82185-01</b> 17173-64050 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77529-01 K →</b> 90x110x9 A SL LD NBR <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83188-01</b> 11213-63010 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89816-01</b> ⑦ 17172-63010 		<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>V37974-00</b> 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x)	<b>X89723-01</b> 17171-22030 	<b>X82243-01</b> 17173-22010 	<b>70-31414-10</b> 	<b>P77587-01 K ←</b> 90311-38017 38x50x8 A SL RD NBR <b>P77515-01 K →</b> 90311-76001 76x94x8,5 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83189-01</b> 11213-25012 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89613-01</b> 17177-25030 	<b>X82138-01</b> 17173-25012 	<b>X54854-01</b> 12151-25010 	<b>P77590-01 K ←</b> 90311-38013 38,5x58x11 A SL RD MVQ <b>P77512-01 K →</b> 75x100x13 A SL LD MVQ
<b>X83115-01</b> 11213-71020 NBR 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)		<b>X81945-01</b> ⑦ 17172-73010 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77516-01 K →</b> 90311-80007 80x100x8,5 A SL LD FPM
<b>V38278-00</b> 11213-0T020 +11193-0T010 (4x) 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> ES 8x 90080-31084 <b>P76880-00</b> AS 8x 90080-31085	<b>X82513-01</b> 17177-37030 	<b>X59400-01</b> 17173-0T020 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77746-01 K →</b> 90311-W0011 78x110x8,5 A SL LD FPM

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA						
Ltr.						
1,8 2ZR-FE	100 kW (136 PS) AURIS VTI COROLLA WTL-i	10/06→	<b>S38279-00</b> 04111-0T081 <b>D38279-00</b> 04112-0T011	<b>H40558-00</b> 11115-37060 0,7 mm MLS 	<b>T40558-00</b> 90910-02166 (10x) 	
1,8 2ZR-FXE	73 kW (99 PS) AURIS HYBRID PRIUS	04/09→	<b>S38279-01</b> 04111-37310 <b>D38279-01</b> 04112-37250	<b>H40558-00</b> 11115-37060 0,7 mm MLS 	<b>T40558-00</b> 90910-02166 (10x) 	
1,8 2ZZ-GE	141 kW (192 PS) CELICA TS COROLLA WTL-i	08/99-02/07	<b>S40565-00</b> 04111-22071 <b>D40565-00</b> 04112-22071	<b>H40565-00</b> 11115-22060 MLS 	<b>T40565-00</b> 90910-02140 (10x) 	
1,8 2ZZ-GE	165 kW (224 PS) COROLLA WTL-i	02/05-02/07	<b>S40565-00</b> 04111-22071 <b>D40565-00</b> 04112-22071	<b>H40565-00</b> 11115-22060 MLS 	<b>T40565-00</b> 90910-02140 (10x) 	
1,8 7A-FE	79-92 kW (107-125 PS) AVENSIS CARINA CELICA COROLLA	04/92-12/01	<b>S40004-00</b> 04111-16280  <b>D40004-00</b> 04112-16280	<b>H40004-00</b> 11115-16120 82 Ø MLS 	<b>T40320-00</b> 90910-02120 (5x) +90910-02121 (5x) 	

⑬ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>V38278-00</b> 11213-0T020 +11193-0T010 (4x) 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> 90080-31084 ES 8x <b>P76880-00</b> 90080-31085 AS 8x	<b>X82513-01</b> 17177-37030 	<b>X59400-01</b> 17173-0T020 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77746-01 K →</b> 90311-W0011 78x110x8,5 A SL LD FPM
<b>V38305-00</b> 11213-37040 +11193-37020 (4x) 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> 90080-31084 ES 8x <b>P76880-00</b> 90080-31085 AS 8x	<b>X82513-01</b> 17177-37030 	<b>X59400-01</b> 17173-0T020 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77746-01 K →</b> 90311-W0011 78x110x8,5 A SL LD FPM
<b>V59467-00</b> 11213-88600 (1x) +11193-15010 (4x) 	<b>N93152-00</b> 90913-02114 (8x) +90913-02115 (8x) <b>P93151-00</b> 90913-02114 ES 8x <b>P93152-00</b> 90913-02115 AS 8x	<b>X59464-01</b> 17177-22010 	<b>X59465-01</b> 17173-88600 ⑬ →02/03  <b>X59466-01</b> 17173-88601 ⑬ 03/03→ 	<b>70-31414-10</b> 	<b>P76130-01 K ←</b> 38x50x8 A SL RD FPM <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM
<b>V59467-00</b> 11213-88600 (1x) +11193-15010 (4x) 	<b>N93152-00</b> 90913-02114 (8x) +90913-02115 (8x) <b>P93151-00</b> 90913-02114 ES 8x <b>P93152-00</b> 90913-02115 AS 8x	<b>X59464-01</b> 17177-22010 	<b>X59466-01</b> 17173-88601 	<b>70-31414-10</b> 	<b>P76130-01 K ←</b> 38x50x8 A SL RD FPM <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM
<b>V37961-00</b> 	<b>N93006-01</b> 90913-02089 (8x) +90913-02090 (8x)	<b>X89683-01</b> 17171-15030 	<b>X82210-01</b> 17173-15040 	<b>70-31414-10</b> 	<b>P77580-01 K ←</b> 90311-32017 32x46x6 A SL RD MVQ <b>P77506-01 K →</b> 90311-70004 70x92x8,5 A SL LD MVQ <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA						
Ltr.						
1,9 1WZ	51 kW (69 PS) COROLLA D	02/00-01/02	<b>S32985-00</b> (12) (13) SU001-00003  <b>D32985-00</b> (12) SU001-00042 	<b>H05616-00</b> SU001-00021 84 Ø 1,26 mm 3 <b>H05616-10</b> SU001-00022 1,3 mm 4 <b>H05616-20</b> SU001-00023 1,34 mm 5 <b>H15616-30</b> SU001-00024 1,38 mm 6 <b>H15616-40</b> SU001-00025 1,42 mm 7 <b>H15616-50</b> 84 Ø 1,47 mm 4 	<b>T05616-00</b> 	
2,0 1AD-FTV	93 kW (126 PS) AURIS D-4D AVENSIS D AVENSIS D-4D COROLLA D-4D	03/06→	<b>S38291-00</b> (12) (13) 04111-0R180  <b>D38291-00</b> (12) 04112-0R180 	<b>H40546-00</b> 11115-26052-A0 87 Ø 1 mm 1 <b>H40546-10</b> 11115-26052-B0 87 Ø 1,05 mm 2 <b>H40546-20</b> 11115-26052-C0 87 Ø 1,1 mm 3 <b>H40546-30</b> 11115-26052-D0 87 Ø 1,15 mm 4 <b>H40546-40</b> 11115-26052-E0 87 Ø 1,2 mm 5 	<b>T40546-00</b> 90910-02158 (10x) 	
2,0 1AZ-FE	110-114 kW (150-155 PS) AVENSIS WTi AVENSIS WTi RAV VTi	06/00→	<b>S40075-01</b> (12) (13) 04111-28074 <b>D40075-01</b> (12) 04112-28074	<b>H40075-00</b> 11115-28022 88 Ø 0,5 mm MLS 		

0 arriba / oben / top / haut / superiore / сверху



<b>X53733-01</b> U  <b>X53780-01</b> 0 	<b>N90300-00</b> SU001-00464 (8x)		<b>X52327-01</b> 2x SU001-00319 	<b>X07793-01</b> 	<b>P76151-01</b> K ← SU001-00061 42x62x7 A RD FPM <b>P76386-01</b> K → SU001-00060 90x110x7 A SL LD FPM <b>P76099-11</b> N SU001-00084 35x50x8 A SL WD FPM
<b>V59394-00</b> 11213-26010 +11214-26010 	<b>N93146-00</b> 90913-W2001 (16x) <b>P76886-00</b> 16x 90913-W2001	<b>X59435-01</b> 17171-0R010 	<b>X59371-01</b> 17173-0R010 	<b>70-31414-10</b> 	<b>P77739-01</b> K ← 90311-W0009 48x63x6,5 A SL RD FPM <b>P77740-01</b> K → 90311-W0010 90x106x8,5 A SL LD FPM
<b>X83309-01</b> 11213-28021 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x)	<b>X89768-01</b> 17177-28010 	<b>X82285-01</b> 17173-28010 	<b>70-31414-10</b> 	<b>P77551-01</b> K → 90311-89007 89x105x10 SL LD FPM <b>P77587-01</b> N 90311-38017 38x50x8 A SL RD NBR

U debajo / unten / bottom / bas / inferiore / снизу



TOYOTA						
Ltr.						
2,0 1AZ-FSE	108-110 kW (147-150 PS)	AVENSIS AVENSIS WT-i	10/00-11/08	<b>S40075-00</b> ⑫ ⑬ 04111-0H160 <b>D40075-00</b> ⑫ 04112-0H013	<b>H40075-00</b> 11115-28022 88 Ø 0,5 mm MLS 	
2,0 1CD-FTV	66-85 kW (90-116 PS)	AVENSIS D-4D COROLLA D-4D PREVIA D-4D	10/99-01/06	<b>S83280-00</b> ⑫ ⑬ 04111-0B010 →09/01 <b>S83280-01</b> ⑫ ⑬ 04111-27100 10/01→ <b>D83280-00</b> ⑫ 04112-0B010 →09/01 <b>D83280-01</b> ⑫ 04112-27090 10/01→	<b>H01055-00</b> 11115-27010-A0 83 Ø 1 mm MLS <b>H01055-10</b> 11115-27010-B0 83 Ø 1,05 mm MLS <b>H01055-20</b> 11115-27010-C0 83 Ø 1,1 mm MLS <b>H11055-30</b> 11115-27010-D0 83 Ø 1,15 mm MLS <b>H11055-40</b> 11115-27010-E0 83 Ø 1,2 mm MLS 	<b>T40340-00</b> 90910-02136 (8x) +90910-02139 (10x) 
2,0 1CD-FTV	66-85 kW (90-116 PS)	COROLLA D-4D	01/02-03/09	<b>S83280-01</b> ⑫ ⑬ 04111-27100  <b>D83280-01</b> ⑫ 04112-27090 	<b>H01055-00</b> 11115-27010-A0 83 Ø 1 mm MLS <b>H01055-10</b> 11115-27010-B0 83 Ø 1,05 mm MLS <b>H01055-20</b> 11115-27010-C0 83 Ø 1,1 mm MLS <b>H11055-30</b> 11115-27010-D0 83 Ø 1,15 mm MLS <b>H11055-40</b> 11115-27010-E0 83 Ø 1,2 mm MLS 	<b>T40340-00</b> 90910-02136 (8x) +90910-02139 (10x) 

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>X83308-01</b> 11213-28041 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x)	<b>X89766-01</b> 17171-28010 <b>X89831-01</b> ⑩ 17177-28020 	<b>X82285-01</b> 17173-28010 	<b>70-31414-10</b> 	<b>P77551-01 K</b> → 90311-89007 89x105x10 SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83280-01</b> 11213-27010 	<b>N93005-00</b> 90913-02066 (8x) +90913-02090 (8x)	<b>X89721-01</b> 17177-27010 	<b>X82246-01</b> 17173-27010 	<b>70-31414-10</b> 	<b>P77560-01 K</b> ← 45x63x7,5 A SL RD NBR <b>P77529-01 K</b> → 90x110x9 A SL LD NBR <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR →09/01 <b>P77413-01 N</b> 90311-28091 38x50x6 A SL RD NBR 10/01→
<b>X83280-01</b> 11213-27010 	<b>N93005-00</b> 90913-02066 (8x) +90913-02090 (8x)	<b>X89721-01</b> 17177-27010 	<b>X82246-01</b> 17173-27010 	<b>70-31414-10</b> 	<b>P77560-01 K</b> ← 45x63x7,5 A SL RD NBR <b>P77529-01 K</b> → 90x110x9 A SL LD NBR <b>P77413-01 N</b> ← 90311-28091 38x50x6 A SL RD NBR



TOYOTA						
Ltr.						
2,0 1CD-FTV	85 kW (116 PS) AVENSIS D-4D RAV D-4D	08/01-11/08	<b>S83280-00</b> 04111-0B010  <b>D83280-00</b> 04112-0B010 	<b>H01055-00</b> 11115-27010-A0 83 Ø 1 mm MLS 1 <b>H01055-10</b> 11115-27010-B0 83 Ø 1,05 mm MLS 2 <b>H01055-20</b> 11115-27010-C0 83 Ø 1,1 mm MLS 3 <b>H11055-30</b> 11115-27010-D0 83 Ø 1,15 mm MLS 4 <b>H11055-40</b> 11115-27010-E0 83 Ø 1,2 mm MLS 5 	<b>T40340-00</b> 90910-02136 (8x) +90910-02139 (10x) 	
2,0 1G-EU	80 kW (109 PS) CRESSIDA	11/82-12/84	<b>S80948-00</b> 04111-70013  <b>D80948-00</b> 04112-70013	<b>H80948-00</b> 11115-70010 77 Ø 		
2,0 1RZ 1RZ-E <b>[NEW]</b>	74-81 kW (101-110 PS) HIACE HILUX	08/89-07/05	<b>S40737-00</b> 04111-75012 <b>D40737-00</b> 04112-75010	<b>H40737-00</b> 11115-75010 1,4 mm 	<b>T40336-00</b> 90910-02091 (10x) 	
2,0 1TR-FE	100 kW (136 PS) HILUX	04/08→	<b>S38251-00</b> 04111-0C081 <b>D38251-00</b> 04112-0C051	<b>H40534-00</b> 11115-0C011 88 Ø 	<b>T40336-00</b> 90910-02091 (10x) 	
2,0 2C 2C-L	50-54 kW (68-73 PS) CARINA D	02/84-06/92	<b>S80953-00</b> 04111-64075  <b>D80953-00</b> 04112-64071	<b>H80953-10</b> 11115-64100 87,5 Ø MLS 	<b>T40334-00</b> 90910-02097 (8x) +90910-02099 (10x) 	

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска



<b>X83280-01</b> 11213-27010 	<b>N93005-00</b> 90913-02066 (8x) +90913-02090 (8x)	<b>X89721-01</b> 17177-27010 	<b>X82246-01</b> 17173-27010 	<b>70-31414-10</b> 	<b>P77560-01 K ←</b> 45x63x7,5 A SL RD NBR <b>P77529-01 K →</b> 90x110x9 A SL LD NBR <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83237-01</b> 11213-70010 		<b>X89648-01</b> 17177-70011 	<b>X82176-01</b> 17173-70010 3x 	<b>70-31414-10</b> 	<b>P77496-01 K ←</b> 90311-45015 45x62x9 A SL RD FPM <b>P77511-01 K →</b> 90311-75009 75x100x8,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83274-01</b> 11213-75020 	<b>N92321-00</b> 90913-02116 (8x)	<b>X89711-01</b> 17177-75010 	<b>X82232-01</b> 17173-75010 	<b>70-31414-10</b> 	<b>P77558-01 K ←</b> 90311-48029 48x68x7 A SL RD MVQ <b>P77525-01 K →</b> 90311-88005 88x106x8,5 A SL LD MVQ
<b>V59338-00</b> 11213-0C010 +11214-0C010 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> ES 8x 90080-31084 <b>P76880-00</b> AS 8x 90080-31085	<b>X89774-01</b> 17177-0C010 	<b>X59341-01</b> 17173-0C010 	<b>70-31414-10</b> 	<b>P77725-01 K ←</b> 90311-T0025 A SL RD <b>P77525-01 K →</b> 90311-T0026 A SL LD
<b>V37938-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82185-01</b> 17173-64050 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K →</b> 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR

ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA						
Ltr.						
2,0 2C	51-54 kW (69-73 PS) CARINA D COROLLA D LITEACE D	08/88-04/97	<b>S80953-01</b> 04111-64202  <b>D80953-01</b> 04112-64143	<b>H80953-10</b> 11115-64100 87,5 Ø MLS 	<b>T40334-00</b> 90910-02097 (8x) +90910-02099 (10x) 	
2,0 2C	54 kW (73 PS) CARINA D	03/88-06/92	<b>S80953-01</b> 04111-64202  <b>D80953-01</b> 04112-64143	<b>H80953-10</b> 11115-64100 87,5 Ø MLS 	<b>T40334-00</b> 90910-02097 (8x) +90910-02099 (10x) 	
2,0 2C	63 kW (86 PS) i20	08/85→	<b>S80953-01</b> 04111-64202  <b>D80953-01</b> 04112-64143	<b>H80953-10</b> 11115-64100 87,5 Ø MLS 	<b>T40334-00</b> 90910-02097 (8x) +90910-02099 (10x) 	
2,0 2C-E 2C-T	53-66 kW (72-90 PS) CAMRY TD CARINA TD COROLLA D	11/86-02/00	<b>S40009-00</b> 04111-64280  <b>D40009-00</b> 04112-64210	<b>H40009-00</b> 11115-64122 87 Ø MLS 	<b>T40334-00</b> 90910-02097 (8x) +90910-02099 (10x) 	
2,0 2C-TE	66 kW (90 PS) AVENSIS TD	09/97-02/03	<b>S83265-00</b> 04111-64364   <b>D83265-00</b> 04112-64272 	<b>H01063-00</b> 11115-64200-01 87 Ø 1,25 mm 1 MLS <b>H11063-10</b> 11115-64200-02 87 Ø 1,35 mm 2 MLS <b>H21063-20</b> 11115-64200-03 87 Ø 1,45 mm 3 MLS 		



<b>V37938-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82270-01</b> 17173-64090  <b>X82323-01</b> 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K →</b> 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83265-01</b> 11213-64061 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82270-01</b> 17173-64090  <b>X82323-01</b> 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K →</b> 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>V37938-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82270-01</b> 17173-64090 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K →</b> 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83265-01</b> 11213-64061 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82270-01</b> 17173-64090 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K →</b> 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83265-01</b> 11213-64061 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82270-01</b> 17173-64090 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K →</b> 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR





TOYOTA							
Ltr.							
2,0 2S-E 2S-EL 2S-ELC	73-79 kW (99-107 PS) CAMRY	01/83-01/88	<b>S80875-00</b> 04111-74010 <b>D80875-00</b> 04112-74010	⑫ ⑬	<b>H80875-00</b> 11115-74010 85,5 Ø		
2,0 3S-FE	88-89 kW (120-121 PS) CAMRY	11/86-05/91	<b>S80947-00</b> 04111-74051 <b>D80947-00</b> 04112-74050	⑫ ⑬	<b>H80947-00</b> 11115-79015 87,5 Ø		<b>T40321-00</b> 90109-10132 (10x) 
2,0 3S-FE	89-94 kW (121-128 PS) CARINA	12/87-04/92	<b>S80991-01</b> 04111-74053 ① →09/89  <b>S80991-02</b> 04111-74191 ① 10/89→ <b>D80991-01</b> 04112-74190	⑫ ⑬	<b>H80991-00</b> 11115-74070 87,5 Ø		<b>T40321-00</b> 90109-10132 (10x) 
2,0 3S-FE	90-94 kW (122-129 PS) AVENSIS PICNIC RAV	05/96-12/01	<b>S80992-00</b> 04111-74592  <b>D80992-00</b> 04112-74592	⑫ ⑬	<b>H80992-00</b> 11115-74110 87 Ø MLS		<b>T40321-00</b> 90109-10132 (10x) 
2,0 3S-FE	93 kW (126 PS) CARINA	12/92-09/97	<b>S80991-02</b> 04111-74191 <b>D80991-01</b> 04112-74190	⑫ ⑬	<b>H80991-00</b> 11115-74070 87,5 Ø		<b>T40321-00</b> 90109-10132 (10x) 

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



<b>X83188-01</b> 11213-63010 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x) 	<b>X89816-01</b> 17172-63010 ⑦ 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>V37960-00</b> 	<b>N92012-01</b> 90913-02062 (16x)	<b>X89682-01</b> 17177-74070 	<b>X82209-01</b> 17173-74040 	<b>70-31414-10</b> 
<b>V37960-00</b> 	<b>N93005-01</b> 90913-02062 (8x) +90913-02066 (8x)	<b>X89682-01</b> 17177-74070 	<b>X82209-01</b> 17173-74040 	<b>70-31414-10</b> 
<b>V37960-00</b> 	<b>N93005-00</b> 90913-02066 (8x) +90913-02090 (8x)	<b>X89682-01</b> 17177-74070 	<b>X82209-01</b> 17173-74040 	<b>70-31414-10</b> 
<b>V37960-00</b> 	<b>N93005-01</b> 90913-02062 (8x) +90913-02066 (8x)	<b>X89682-01</b> 17177-74070 	<b>X82209-01</b> 17173-74040 	<b>70-31414-10</b> 



TOYOTA				
Ltr.	Power	Model	Year	Icon
2,0 3S-FE	94 kW (128 PS)	CAMRY	11/86-05/91	
				<b>S80991-01</b> (12) (13) 04111-74053  <b>D80991-01</b> (12) 04112-74190
				<b>H80991-00</b> 11115-74070 87,5 Ø 
				<b>T40321-00</b> 90109-10132 (10x) 
2,0 3S-FE	98 kW (133 PS)	CARINA	04/92-09/97	
				<b>S80991-00</b> (12) (13) 04111-74490  <b>D80991-00</b> (12) 04112-74490
				<b>H80991-00</b> 11115-74070 87,5 Ø 
				<b>T40321-00</b> 90109-10132 (10x) 
2,0 3S-GE	115 kW (156 PS)	MR 2	12/89-05/00	
				<b>S80949-03</b> (12) (13) 04111-74220  <b>D80949-02</b> (12) 04112-74220
				<b>H80949-00</b> 11115-88382 88 Ø 
2,0 3S-GEL 3S-GELC	103-110 kW (140-150 PS)	CELICA	08/85-08/89	
				<b>S80950-00</b> (12) (13) 04111-74042 → 8999999 <b>S80950-01</b> (12) (13) 04111-74033 → 9000000 → <b>D80950-00</b> (12) 04112-74041 → 8999999 <b>D80950-01</b> (12) 04112-74031 → 9000000 →
				<b>H80950-00</b> 11115-88362 88 Ø 
2,0 3S-GELU	110 kW (150 PS)	CELICA	08/85-08/89	
				<b>S80950-01</b> (12) (13) 04111-74033 <b>D80950-01</b> (12) 04112-74031
				<b>H80950-00</b> 11115-88362 88 Ø 
2,0 3S-GELU	110 kW (150 PS)	CELICA	01/87-08/89	
				<b>S80950-00</b> (12) (13) 04111-74042 <b>D80950-00</b> (12) 04112-74041
				<b>H80950-00</b> 11115-88362 88 Ø 

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>V37960-00</b> 	<b>N93005-01</b> 90913-02062 (8x) +90913-02066 (8x)	<b>X89682-01</b> 17177-74070 	<b>X82209-01</b> 17173-74040 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>V37960-00</b> 	<b>N93005-00</b> 90913-02066 (8x) +90913-02090 (8x)	<b>X89682-01</b> 17177-74070 	<b>X82209-01</b> 17173-74040 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>V38000-00</b> 	<b>N93005-00</b> 90913-02066 (8x) +90913-02090 (8x)	<b>X89785-01</b> 17177-74060 <b>X89840-01</b> (10) 17171-74020 	<b>X82298-01</b> 17173-88382 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77551-01 K →</b> 90311-89007 89x105x10 SL LD FPM <b>P77586-01 N</b> 2x 90311-35040 35x49x6 A SL RD MVQ
<b>V37950-00</b> 	<b>N92012-01</b> 90913-02062 (16x)	<b>X89649-01</b> 17177-88360 	<b>X82178-01</b> 17173-88362 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR → 8999999 <b>P77586-01 N</b> 2x 90311-35040 35x49x6 A SL RD MVQ
<b>V37950-00</b> 	<b>N92012-01</b> 90913-02062 (16x)	<b>X89649-01</b> 17177-88360 	<b>X82178-01</b> 17173-88362 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77586-01 N</b> 2x 90311-35040 35x49x6 A SL RD MVQ
<b>V37950-00</b> 	<b>N92012-01</b> 90913-02062 (16x)	<b>X89649-01</b> 17177-88360 	<b>X82178-01</b> 17173-88362 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ



TOYOTA						
Ltr.						
2,0 3S-GTE	136 kW (185 PS) CELICA	03/88-08/89	<b>S80949-00</b> 04111-74062  <b>D80949-00</b> 04112-74062		<b>H80949-00</b> 11115-88382 88 Ø 	
2,0 3Y	65-79 kW (88-107 PS) DYNIA F BUS SUPER HILUX	01/84-08/88	<b>S80876-00</b> 04111-73010 <b>D80876-00</b> 04112-73010		<b>H80876-20</b> 11115-73041 88 Ø 	<b>T50670-00</b> 
2,0 3Y	79 kW (107 PS) DYNIA	08/85-08/88	<b>S80876-00</b> 04111-73010 <b>D80876-00</b> 04112-73010		<b>H80876-20</b> 11115-73041 88 Ø 	<b>T50670-00</b> 
2,0 3ZR-FAE	112-116 kW (152-158 PS) AVENSIS WISH	02/09→	<b>S38279-02</b> 04111-37201 <b>D38279-02</b> 04112-37201		<b>H40558-00</b> 11115-37060 0,7 mm MLS 	<b>T40558-00</b> 90910-02166 (10x) 
2,0 3ZR-FAE	114-116 kW (155-158 PS) NOAH RAV 4	06/07→	<b>S40607-00</b> 1→02/09 <b>S38279-02</b> 04111-37201 1→03/09→ <b>D40607-00</b> 1→02/09 <b>D38279-02</b> 04112-37201 1→03/09→		<b>H40607-00</b> 11115-37040 0,7 mm MLS 1→02/09 	<b>T40558-00</b> 90910-02166 (10x) 
2,2 L	46-53 kW (63-72 PS) CRESSIDA D CROWN D HIACE D	01/79-11/89	<b>S80863-00</b> 04111-54035 <b>D80863-00</b> 04112-54035		<b>H80863-00</b> 11115-54012 95 Ø 	

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена

⑬ con junta de culata MLS / mit Mehrlagen-Zylinderkopfichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>V37950-00</b> 	<b>N92012-01</b> 90913-02062 (16x) 	<b>X89649-01</b> 17177-88360 	<b>X82177-01</b> 17173-88380 	2x <b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77586-01 N</b> 90311-35040 35x49x6 A SL RD MVQ
<b>X83115-01</b> 11213-71020 NBR 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X81945-01</b> 17172-73010 ⑦ 1→08/85→ 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77516-01 K →</b> 90311-80007 80x100x8,5 A SL LD FPM	
<b>X83115-01</b> 11213-71020 NBR 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X81945-01</b> 17172-73010 ⑦ 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77516-01 K →</b> 90311-80007 80x100x8,5 A SL LD FPM	
<b>V38278-00</b> 11213-0T020 +11193-0T010 (4x) 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> ES 8x 90080-31084 AS 8x <b>P76880-00</b> 90080-31085	<b>X82513-01</b> 17177-37030 	<b>X59400-01</b> 17173-0T020 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77746-01 K →</b> 90311-W0011 78x110x8,5 A SL LD FPM
<b>V38278-00</b> 11213-0T020 +11193-0T010 (4x) 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> ES 8x 90080-31084 AS 8x <b>P76880-00</b> 90080-31085	<b>X82513-01</b> 17177-37030 	<b>X59400-01</b> 17173-0T020 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77746-01 K →</b> 90311-W0011 78x110x8,5 A SL LD FPM
<b>V37939-00</b> 	<b>N93051-00</b> 90913-02060 (8x)	<b>X89650-01</b> 17177-54012 	<b>X82179-01</b> 17173-54011 	<b>X54862-01</b> 12151-54020 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77595-01 N</b> 90311-42003 42x60x7 A SL RD NBR

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска

ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA

TOYOTA						
Ltr.						
2,2 2AD-FHV 2AD-FTV	100-130 kW (136-177 PS)	AURIS D AVENSIS D AVENSIS D-CAT COROLLA D COROLLA D-4D COROLLA D4d RAV D-CAT RAV D-4D RAV 4 RAV 4 D-4D	07/05→	<b>S38291-00</b> 04111-0R180  <b>D38291-00</b> 04112-0R180 	<b>H40546-00</b> 11115-26052-A0 87 Ø 1 mm MLS 1 <b>H40546-10</b> 11115-26052-B0 87 Ø 1,05 mm MLS 2 <b>H40546-20</b> 11115-26052-C0 87 Ø 1,1 mm MLS 3 <b>H40546-30</b> 11115-26052-D0 87 Ø 1,15 mm MLS 4 <b>H40546-40</b> 11115-26052-E0 87 Ø 1,2 mm MLS 5 	<b>T40546-00</b> 90910-02158 (10x) 
2,2 3C-TE	66 kW (90 PS)	PICNIC D	08/97-12/01	<b>S83265-00</b> 04111-64364   <b>D83265-00</b> 04112-64272 	<b>H01063-00</b> 11115-64200-01 87 Ø 1,25 mm MLS 1 <b>H11063-10</b> 11115-64200-02 87 Ø 1,35 mm MLS 2 <b>H21063-20</b> 11115-64200-03 87 Ø 1,45 mm MLS 3 	
2,2 4Y 4Y-EC	69-72 kW (94-98 PS)	F BUS HILUX LITEACE	01/87-01/95	<b>S37036-00</b> 04111-73045 <b>D37036-00</b> 04111-73043	<b>H40028-00</b> 11115-73030 93 Ø 1,6 mm <b>H40028-10</b> 93 Ø 2 mm 	<b>T50670-00</b> 
2,2 5S-FE 5S-FNE	96 kW (131 PS)	CAMRY	08/96-11/01	<b>S40035-00</b> 04111-74641 <b>D40035-00</b> 04112-74581	<b>H40035-00</b> 11115-21030 88 Ø MLS 	<b>T40321-00</b> 90109-10132 (10x) 

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



<b>V59394-00</b> 11213-26010 +11214-26010 	<b>N93146-00</b> 90913-W2001 (16x) <b>P76886-00</b> 90913-W2001 16x 	<b>X59435-01</b> 17171-0R010 	<b>X59371-01</b> 17173-0R010 	<b>70-31414-10</b> 	<b>P77739-01 K ←</b> 90311-W0009 48x63x6,5 A SL RD FPM <b>P77740-01 K →</b> 90311-W0010 90x106x8,5 A SL LD FPM
<b>X83265-01</b> 11213-64061 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89654-01</b> 17177-64010 	<b>X82270-01</b> 17173-64090 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77528-01 K →</b> 90311-90003 90x110x9,5 A SL LD MVQ <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83115-01</b> 11213-71020 NBR 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X81945-01</b> ⑦ 17172-73010 		<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77516-01 K →</b> 90311-80007 80x100x8,5 A SL LD FPM
<b>V37960-00</b> 	<b>N93005-00</b> 90913-02066 (8x) +90913-02090 (8x)	<b>X89682-01</b> 17177-74070 	<b>X82209-01</b> 17173-74040 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR



TOYOTA						
Ltr.						
2,2 5S-FE	100 kW (136 PS) CAMRY	06/91-08/96	<b>S80990-00</b> ⑫ ⑬ 04111-64421 ① →08/95  <b>S80990-01</b> ⑫ ⑬ 04111-64178 ① 09/95→  <b>D80990-00</b> ⑫ 04112-74292	<b>H80990-00</b> 11115-74081 88 Ø 	<b>T40321-00</b> 90109-10132 (10x) 	
2,4 2AZ-FE	112-125 kW (152-170 PS) CAMRY CAMRY VVT-i CAMRY VVTi PREVIA TARAGO	08/00→	<b>S40076-00</b> ⑫ ⑬ 04111-28056 <b>D40076-00</b> ⑫ 04112-28056	<b>H40076-00</b> 11115-28012 90 Ø 0,5 mm MLS 		
2,4 2AZ-FSE <b>[NEW]</b>	120-125 kW (163-170 PS) AVENSIS	09/03-11/08	<b>S40718-00</b> ⑫ ⑬ ⑰ 04111-28810 <b>D40718-00</b> ⑫ ⑰ 04112-28670	<b>H40718-00</b> 11115-28040 90 Ø 0,5 mm MLS 	<b>T40718-00</b> 90910-02141 (10x) 	
2,4 2AZ-FXE <b>[NEW]</b>	105-110 kW (143-150 PS) ALPHARD CAMRY VVTi PREVIA	01/06→		<b>H40718-00</b> 11115-28040 90 Ø 0,5 mm MLS 	<b>T40589-02</b> 90910-02162 (10x) 	
2,4 2L	53-59 kW (72-80 PS) HIACE D HILUX D LAND CRUISER D	01/84-08/06	<b>S31458-02</b> ⑫ ⑬ 04111-54083   <b>D31458-02</b> ⑫ 04112-54071 	<b>H40371-00</b> 11115-54084-B0 93,5 Ø 1,45 mm MLS 1 <b>H40371-10</b> 11115-54084-D0 93,5 Ø 1,55 mm MLS 2 <b>H40371-20</b> 11115-54084-F0 93,5 Ø 1,65 mm MLS 3 	<b>T40318-00</b> 90910-02080 (14x) +90910-02081 (4x) 	

⑫ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

⑰ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>V37960-00</b> 	<b>N93005-00</b> 90913-02066 (8x) +90913-02090 (8x)	<b>X89682-01</b> 17177-74070 	<b>X82209-01</b> 17173-74040  <b>X82322-01</b> 90917-06039 ① →08/95 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83309-01</b> 11213-28021 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x)	<b>X89768-01</b> 17177-28010 	<b>X82285-01</b> 17173-28010 	<b>70-31414-10</b> 	<b>P77551-01 K →</b> 90311-89007 89x105x10 SL LD FPM <b>P77587-01 N</b> 90311-38017 38x50x8 A SL RD NBR
<b>X83308-01</b> 11213-28041 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) ES 8x <b>P76879-00</b> AS 8x 90080-31084 <b>P76880-00</b> AS 8x 90080-31085	<b>X89766-01</b> 17171-28010  <b>X89831-01</b> ⑩ 17177-28020 	<b>X82285-01</b> 17173-28010 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77551-01 K →</b> 90311-89007 89x105x10 SL LD FPM
<b>X83309-01</b> 11213-28021 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) ES 8x <b>P76879-00</b> AS 8x 90080-31084 <b>P76880-00</b> AS 8x 90080-31085	<b>X89768-01</b> 17177-28010 	<b>X82285-01</b> 17173-28010 	<b>70-31414-10</b> 	<b>P77141-01 K ←</b> 90311-W0012 38x50x6 A SL RD FPM <b>P77551-01 K →</b> 90311-89007 89x105x10 SL LD FPM
<b>X83377-01</b> 11213-54050 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89965-01</b> 17177-54020 	<b>X82383-01</b> 17173-54030  <b>X82325-01</b>	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77580-01 N</b> 90311-32017 32x46x6 A SL RD MVQ

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
 ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска























TOYOTA						
Ltr.						
2,4 2L-T	55 kW (75 PS) HIACE D	05/84-11/89	<b>S80864-01</b> 04111-54041 <b>D80864-01</b> 04112-54032	<b>H80864-00</b> 11115-54021 94,8 Ø	<b>T40357-00</b> 90910-02090 (18x)	
2,4 2L-TE	55 kW (75 PS) HIACE D	05/84-11/89	<b>S80864-01</b> 04111-54041 <b>D80864-01</b> 04112-54032	<b>H80864-00</b> 11115-54021 94,8 Ø	<b>T40357-00</b> 90910-02090 (18x)	
2,4 2L-T	63-66 kW (86-90 PS) CRESSIDA TD LAND CRUISER TD	05/85-05/90	<b>S80864-01</b> 04111-54041 <b>D80864-01</b> 04112-54032	<b>H80864-00</b> 11115-54021 94,8 Ø	<b>T40357-00</b> 90910-02090 (18x)	
2,4 2L-T	66 kW (90 PS) HIACE TD HILUX TD LAND CRUISER TD	08/89-08/06	<b>S31458-01</b> 04111-54103  <b>D31458-01</b> 04112-54101 	<b>H40371-00</b> 11115-54084-B0 93,5 Ø 1,45 mm 1 MLS <b>H40371-10</b> 11115-54084-D0 93,5 Ø 1,55 mm 2 MLS <b>H40371-20</b> 11115-54084-F0 93,5 Ø 1,65 mm 3 MLS 	<b>T40318-00</b> 90910-02080 (14x) +90910-02081 (4x) 	
2,4 2RZ-E	85-88 kW (115-120 PS) HIACE	08/89-02/05	<b>S40023-00</b> 04111-75041 <b>D40023-00</b> 04112-75040	<b>H40023-00</b> 11115-75020 96,5 Ø 	<b>T40336-00</b> 90910-02091 (10x) 	
2,4 2RZ-FE	103 kW (140 PS) HILUX	08/97-07/05	<b>S40026-00</b> 04111-75092 <b>D40026-00</b> 04112-75091	<b>H40026-00</b> 11115-75031 97 Ø 	<b>T40336-00</b> 90910-02091 (10x) 	

























<b>V37939-00</b> 	<b>N93051-00</b> 90913-02060 (8x)	<b>X89650-01</b> 17177-54012 	<b>X82182-01</b> 17173-54020 	<b>X54862-01</b> 12151-54020 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77595-01 N</b> 90311-42003 42x60x7 A SL RD NBR
<b>V37939-00</b> 	<b>N93051-00</b> 90913-02060 (8x)	<b>X89650-01</b> 17177-54012 	<b>X82182-01</b> 17173-54020 	<b>X54862-01</b> 12151-54020 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77595-01 N</b> 90311-42003 42x60x7 A SL RD NBR
<b>V37939-00</b> 	<b>N93051-00</b> 90913-02060 (8x)	<b>X89650-01</b> 17177-54012 	<b>X82182-01</b> 17173-54020 	<b>X54862-01</b> 12151-54020 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77595-01 N</b> 90311-42003 42x60x7 A SL RD NBR
<b>X83377-01</b> 11213-54050 	<b>N92321-00</b> 90913-02116 (8x) <b>P76554-00</b> 90913-02116	<b>X89965-01</b> 17177-54020 8x 	<b>X82303-01</b> 17173-54050 	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77580-01 N</b> 90311-32017 32x46x6 A SL RD MVQ
<b>X83274-01</b> 11213-75020 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89711-01</b> 17177-75010 	<b>X82232-01</b> 17173-75010 	<b>70-31414-10</b> 	<b>P77481-01 K ←</b> 17x28x7 A SL RD NBR <b>P77525-01 K →</b> 90311-88005 88x106x8,5 A SL LD MVQ
<b>V37969-00</b> 	<b>N93028-00</b> 90913-02071 (16x)	<b>X89714-01</b> 	<b>X82235-01</b> 	<b>70-31414-10</b> 	<b>P77481-01 K ←</b> 17x28x7 A SL RD NBR <b>P77525-01 K →</b> 90311-88005 88x106x8,5 A SL LD MVQ

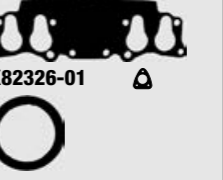

TOYOTA					
Ltr. 					
2,4 2TZ-FE	97 kW (132 PS) PREVIA	05/90-08/00	<b>S80989-00</b> 04111-76071  <b>D80989-00</b> 04112-76071	<b>H80989-00</b> 11115-76030 97 ∅ 	<b>T40336-00</b> 90910-02091 (10x) 
2,4 22R 22RE 22REC	77-84 kW (105-114 PS) LAND CRUISER 4 RUNNER	11/84-12/96	<b>S80951-00</b> 04111-35070 <b>D80951-00</b> 04112-35060	<b>H80951-00</b> 11115-35030 94,5 ∅ 	<b>T50621-00</b> 
2,5 2KD-FTV	65-86 kW (88-117 PS) HIACE D HIACE D-4D HILUX D HILUX D-4D HILUX D4d	08/01→	<b>S83307-00</b> 04111-30420 <b>D83307-00</b> 04112-30070	<b>H01074-00</b> 11115-30040-A0 93,5 ∅ 1  MLS <b>H01074-10</b> 11115-30040-B0 93,5 ∅ 2  MLS <b>H01074-20</b> 11115-30040-C0 93,5 ∅ 3  MLS <b>H11074-30</b> 11115-30040-D0 93,5 ∅ 4  MLS <b>H11074-40</b> 11115-30040-E0 93,5 ∅ 5  MLS 	<b>T40533-00</b> 90910-02145 (10x) +90910-02146 (8x) 
2,5 2VZ-FE	118 kW (160 PS) CAMRY V6	02/88-05/91	<b>S40005-00</b> 04111-62021 <b>D40005-00</b> 04112-62020	<b>H40005-00</b> R 11115-62060 89,5 ∅  <b>H40030-00</b> L 11116-62060 89,5 ∅ 	

Ⓜ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



					
<b>V37959-00</b> 	<b>N93006-02</b> 90913-02085 (8x) +90913-02090 (8x)	<b>X89681-01</b> 17177-76020 	<b>X82208-01</b> 17173-76010 	<b>70-31414-10</b> 	<b>P77481-01</b> K ← 17x28x7 A SL RD NBR <b>P77525-01</b> K → 90311-88005 88x106x8,5 A SL LD MVQ
<b>V37937-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89715-01</b> 90311-45002 <b>X89828-01</b> Ⓜ 	<b>X82237-01</b> 17173-76010 <b>X82326-01</b> 	<b>X54907-01</b> 	<b>P77497-01</b> K ← 90311-45002 45x68x12 A SL RD ACM <b>P77536-01</b> K → 80x100x12 A SL LD MVQ <b>P77586-01</b> N 90311-35040 35x49x6 A SL RD MVQ
<b>X83307-01</b> 11213-30020 	<b>N93041-01</b> 90913-02121 (16x)	<b>X89767-01</b> 17177-30010 	<b>X82254-01</b> 17173-30020 	<b>70-31414-10</b> 	<b>P77499-01</b> K ← 90311-50017 50x68x9/14 A SL RD FPM <b>P77552-01</b> K ← 90080-31098 65x79x7 A SL RD FPM <b>P77533-01</b> K → 90311-95008 95x115x12/9,5 B SL LD MVQ <b>P77580-01</b> N 90311-32017 32x46x6 A SL RD MVQ
<b>V37963-00</b> 2x 	<b>N93028-02</b> 90913-02071 (24x)	<b>X89695-01</b> 2x 17177-62030 	<b>X82221-01</b> 2x 17173-62020 	<b>70-31414-10</b> 	<b>P77597-01</b> K ← 35x48x7 A SL RD MVQ <b>P77531-01</b> K → 90311-92006 92x110x8,5 A SL LD MVQ <b>P77587-01</b> N 90311-38017 38x50x8 A SL RD NBR



TOYOTA						
Ltr.						
2,5 4GR-FSE <b>[NEW]</b>	149 kW (203 PS) MARK X	10/09→	<b>S38744-00</b> <b>D38744-00</b> 04112-31330	<b>H40725-00</b> R 11115-31051 84,5 Ø 0,5 mm MLS  <b>H40726-00</b> L 11116-31031 84,5 Ø 0,5 mm MLS 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 	
2,5 5GR-FE <b>[NEW]</b>	145 kW (194 PS)			<b>H40723-00</b> R 11115-31041 89,5 Ø 0,5 mm MLS  <b>H40724-00</b> L 11116-31021 89,5 Ø 0,5 mm MLS 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 	
2,7 2TR-FE <b>[NEW]</b>	106-120 kW (144-163 PS) COASTER LAND CRUISER	11/03→	<b>S40080-01</b> 04111-75864 <b>D40080-01</b> 04112-75783	<b>H40080-00</b> 11115-75051 97 Ø 0,6 mm MLS <b>H40080-10</b> 1 0,9 mm MLS 	<b>T40336-00</b> 90910-02091 (10x) 	
2,7 2TR-FZE	111 kW (151 PS) QUANTUM	01/05→	<b>S40080-00</b> 04111-75810 <b>D40080-00</b> 04112-75710	<b>H40080-00</b> 11115-75051 97 Ø 0,6 mm MLS <b>H40080-10</b> 0,9 mm MLS 	<b>T40336-00</b> 90910-02091 (10x) 	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

⑪ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>V59899-00</b> R 11213-31040 +11193-70010 (3x)  <b>V59900-00</b> L 11214-31020 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085	<b>X59908-01</b> 2x 17177-31021  <b>X59957-01</b> ⑩ 3x 	<b>X59904-01</b> 2x 17173-31020 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM
<b>V59900-00</b> L 11214-31020 +11193-70010 (3x)  <b>V83412-00</b> R 11213-31050 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085		<b>X59904-01</b> 2x 17173-31020 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM
<b>V59338-00</b> 11213-0C010 +11214-0C010 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x) <b>P76879-00</b> 8x 90080-31084 <b>P76880-00</b> 8x 90080-31085	<b>X89774-01</b> 17177-0C010 	<b>X59341-01</b> 17173-0C010  <b>X82294-01</b> 17173-75040 	<b>70-31414-10</b> 	<b>P77558-01</b> K ← 90311-48029 48x68x7 A SL RD MVQ <b>P77525-01</b> K → 90311-88005 88x106x8,5 A SL LD MVQ
<b>V59338-00</b> 11213-0C010 +11214-0C010 	<b>N76879-00</b> 90080-31084 (8x) +90080-31085 (8x)	<b>X89774-01</b> 17177-0C010 	<b>X82294-01</b> 17173-75040 	<b>70-31414-10</b> 	<b>P77558-01</b> K ← 90311-48029 48x68x7 A SL RD MVQ <b>P77525-01</b> K → 90311-88005 88x106x8,5 A SL LD MVQ

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска





TOYOTA						
Ltr.						
2,7 3RZ-FE	105-112 kW (143-152 PS) HIACE 4 RUNNER	11/95→	<b>S40026-00</b> 04111-75092 <b>D40026-00</b> 04112-75091	<sup>12</sup> <sup>13</sup> <b>H40026-00</b> 11115-75031 97 Ø 	<b>T40336-00</b> 90910-02091 (10x) 	
2,8 3L	61 kW (83 PS) HILUX LN 57, LN 67	08/88→	<b>S31458-02</b> 04111-54083  <b>D31458-02</b> 04112-54071 	<sup>12</sup> <sup>13</sup> <b>H01048-00</b> 11115-54071-B0 97,5 Ø 1,45 mm MLS <b>H11048-10</b> 11115-54071-D0 97,5 Ø 1,55 mm MLS <b>H21048-20</b> 11115-54071-F0 97,5 Ø 1,65 mm MLS 	<b>T40318-00</b> 90910-02080 (14x) +90910-02081 (4x) 	
2,8 5M-GE	125 kW (170 PS) CELICA CROWN	08/81-12/85	<b>S80884-00</b> 04111-43040 <b>D80884-00</b> 04112-43040	<sup>12</sup> <sup>13</sup> <b>H80884-00</b> 11115-43030 85 Ø 		
3,0 B	59 kW (80 PS) LAND CRUISER D	02/74-10/84	<b>S80956-00</b> 04111-56040 <b>D80956-00</b> 04112-56030	<sup>12</sup> <sup>13</sup> <b>H80956-00</b> 11115-56120 102,5 Ø 		
3,0 1KD-FTV	80-140 kW (109-190 PS) DYNA D4d FORTUNER D HIACE D HILUX HILUX D HILUX D LAND CRUISER D-4D	10/00→	<b>S38242-00</b> 04111-30711  <b>D38242-00</b> 04112-30331 	<sup>12</sup> <sup>13</sup> <b>H40533-00</b> 11115-0L020-A0 0,7 mm MLS <b>H40533-10</b> 11115-0L020-B0 0,75 mm MLS <b>H40533-20</b> 11115-0L020-C0 0,8 mm MLS <b>H40533-30</b> 11115-0L020-D0 0,85 mm MLS <b>H40533-40</b> 11115-0L020-E0 0,9 mm MLS 	<b>T40533-00</b> 90910-02145 (10x) +90910-02146 (8x) 	



<b>V37969-00</b> 	<b>N93028-00</b> 90913-02071 (16x) 	<b>X89714-01</b> 	<b>X82235-01</b> <b>X82327-01</b> 	<b>70-31414-10</b> 	<b>P77481-01 K ←</b> 17x28x7 A SL RD NBR <b>P77525-01 K →</b> 90311-88005 88x106x8,5 A SL LD MVQ
<b>X83377-01</b> 11213-54050 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89965-01</b> 17177-54020 	<b>X82383-01</b> 17173-54030 <b>X82325-01</b> 2x	<b>70-31414-10</b> 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77523-01 K →</b> 90311-85003 85x105x10 A SL LD FPM <b>P77580-01 N</b> 90311-32017 32x46x6 A SL RD MVQ
<b>X83190-01</b> 2x 11213-43020 	<b>N93190-00</b> 90913-02116 (12x) <b>P76554-00</b> 90913-02116 12x	<b>X89651-01</b> 17177-43010 	<b>X82180-01</b> 17173-43020 	<b>X54860-01</b> 12151-41010 	<b>P77595-01 K ←</b> 90311-42003 42x60x7 A SL RD NBR <b>P77536-01 K →</b> 80x100x12 A SL LD MVQ <b>P77590-01 N</b> 90311-38013 38,5x58x11 A SL RD MVQ
<b>X83238-01</b> 11213-56012 	<b>N93018-00</b> 90913-02051 (8x)	<b>X89775-01</b> 17171-56010 	<b>X82181-01</b> 17173-58010 	<b>70-31414-10</b> 	<b>P77557-01 K ←</b> 90311-50013 50x72 A SL RD FPM <b>P77534-01 K →</b> 95x115x12 A SL LD MVQ
<b>X59336-01</b> 11213-0L010 ACM 	<b>N93041-01</b> 90913-02121 (16x)	<b>X59331-01</b> 17177-0L011 	<b>X59332-01</b> 17173-0L020 	<b>70-31414-10</b> 	<b>P77499-01 K ←</b> 90311-50017 50x68x9/14 A SL RD FPM <b>P77552-01 K ←</b> 90080-31098 65x79x7 A SL RD FPM <b>P77723-01 K →</b> 90080-31100 95x115x9,5 A SL RD FPM <b>P77724-01 N</b> 90311-32019 32x46x6 FPM



TOYOTA						
Ltr.						
3,0 1KZ-T	92 kW (125 PS) LAND CRUISER TD 4 RUNNER D	05/93-05/96	<b>S37977-00</b> ⑫ 04111-67021  <b>D37977-00</b> ⑫ 04112-67020 	<b>H01065-00</b> 11115-67040-01 97 Ø 0,75 mm 1 □ MLS <b>H11065-10</b> 11115-67050-03 97 Ø 0,85 mm 3 □ MLS <b>H21065-20</b> 11115-67040-05 97 Ø 0,95 mm 5 □ MLS 	<b>T40343-00</b> 90910-02112 (18x) 	
3,0 1KZ-TE	92-103 kW (125-140 PS) LAND CRUISER TD	04/95→	<b>S37977-01</b> ⑫ ⑬ 04111-67025  <b>D37977-01</b> ⑫ 04112-67022 	<b>H01065-00</b> 11115-67040-01 97 Ø 0,75 mm 1 □ MLS <b>H11065-10</b> 11115-67050-03 97 Ø 0,85 mm 3 □ MLS <b>H21065-20</b> 11115-67040-05 97 Ø 0,95 mm 5 □ MLS 	<b>T40343-00</b> 90910-02112 (18x) 	
3,0 1MZ-FE <b>[NEW]</b>	135-140 kW (183-190 PS) CAMRY CAMRY V6	09/93-11/01	<b>S40738-00</b> ⑫ ⑬ 04111-20041 <b>D40738-00</b> ⑫ 04112-20031	<b>H40738-00</b> R 11115-20010  <b>H40739-00</b> L 11116-20010 	<b>T40738-00</b> 2x 90910-02117 (8x) 	

⑫ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission /  
guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>V37977-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89732-01</b> 17177-67011 4x 	<b>X82255-01</b> 17173-67030 	<b>70-31414-10</b> 	<b>P77499-01</b> K ← 90311-50017 50x68x9/14 A SL RD FPM <b>P77533-01</b> K → 90311-95008 95x115x12/9,5 B SL LD MVQ <b>P77580-01</b> N 90311-32017 32x46x6 A SL RD MVQ
<b>V37977-00</b> 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89732-01</b> 4x 17177-67011 	<b>X82254-01</b> 17173-30020 	<b>70-31414-10</b> 	<b>P77499-01</b> K ← 90311-50017 50x68x9/14 A SL RD FPM <b>P77533-01</b> K → 90311-95008 95x115x12/9,5 B SL LD MVQ <b>P77580-01</b> N 90311-32017 32x46x6 A SL RD MVQ
<b>V59941-00</b> R 11213-20020 +11193-70010 (3x)  <b>V59942-00</b> L 11214-20010 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> 12x 90080-31084 <b>P76880-00</b> 12x 90080-31085	<b>X59943-01</b> R 17177-20020  <b>X59944-01</b> L 17178-20020  <b>X59945-01</b> ⑩ 17176-62030 	<b>X59946-01</b> 2x 17173-20030 	<b>70-31414-10</b> 	<b>P77553-01</b> K ← 90311-40013 40x55x6 A SL RD <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM <b>P77619-01</b> N 2x 90311-38034 38x50x10,5 A SL RD FPM



TOYOTA						
Ltr.						
3,0 1MZ-FE <b>[NEW]</b>	137-145 kW (186-197 PS) AVALON CAMRY CAMRY V6	04/00-11/06	<b>S40740-00</b> 04111-20043 →12/02 <b>S40742-00</b> 04111-0A073 →01/03→ <b>D40740-00</b> 04112-20033 →12/02 <b>D40742-00</b> 04112-0A073 →01/03→	<b>H40740-00</b> R 11115-20042 88,9 Ø 1,3 mm MLS →12/02  <b>H40741-00</b> L 11116-20042 88,9 Ø 1,3 mm MLS →12/02  <b>H40742-00</b> R 11115-20032 88,9 Ø 1,3 mm MLS →01/03→  <b>H40743-00</b> L 11116-20032 88,9 Ø 1,3 mm MLS →01/03→ 	<b>T40738-00</b> 90910-02117 (8x) 	2x
3,0 1MZ-FE <b>[NEW]</b>	137-162 kW (186-220 PS) ALPHARD CAMRY	04/03-11/08	<b>S40742-00</b> 04111-0A073 <b>D40742-00</b> 04112-0A073	<b>H40742-00</b> R 11115-20032 88,9 Ø 1,3 mm MLS  <b>H40743-00</b> L 11116-20032 88,9 Ø 1,3 mm MLS 	<b>T40738-00</b> 90910-02117 (8x) 	2x

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>V59941-00</b> R 11213-20020 +11193-70010 (3x) →12/02 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> 90080-31084 <b>P76880-00</b> 90080-31085	<b>X59943-01</b> R 17177-20020  <b>X59944-01</b> L 17178-20020  <b>X59945-01</b> ⑩ 17176-62030 →12/02  <b>X59960-01</b> ⑩ 17176-20010 →01/03→ 	<b>X59946-01</b> 2x 17173-20030 	<b>70-31414-10</b> 	<b>P77553-01</b> K ← 90311-40013 40x55x6 A SL RD <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM <b>P77619-01</b> N 2x 90311-38034 38x50x10,5 A SL RD FPM
<b>V59942-00</b> L 11214-20010 +11193-70010 (3x) →12/02 	<b>V59958-00</b> R 11213-20030 +11193-70010 (3x) →01/03→ 	<b>V59959-00</b> L 11214-20030 +11193-70010 (3x) →01/03→ 	<b>X59943-01</b> R 17177-20020  <b>X59944-01</b> L 17178-20020  <b>X59960-01</b> ⑩ 17176-20010 		
<b>V59958-00</b> R 11213-20030 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> 90080-31084 <b>P76880-00</b> 90080-31085	<b>V59959-00</b> L 11214-20030 +11193-70010 (3x) 	<b>X59943-01</b> R 17177-20020  <b>X59944-01</b> L 17178-20020  <b>X59960-01</b> ⑩ 17176-20010 	<b>X59946-01</b> 2x 17173-20030 	<b>70-31414-10</b> 

⑩ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



TOYOTA						
Ltr.						
3,0 1MZ-FE <b>[NEW]</b>	140-154 kW (190-209 PS) AVALON SIENNA	03/95-05/05				2x
			<b>S40738-00</b> (12) (13) 04111-20041 [1] →12/99 <b>S40740-00</b> (12) (13) (19) 04111-20043 [1] 01/00→ <b>D40738-00</b> (12) 04112-20031 [1] →12/99 <b>D40740-00</b> (12) (19) 04112-20033 [1] 01/00→	<b>H40738-00</b> R 11115-20010 [1] →12/99  <b>H40739-00</b> L 11116-20010 [1] →12/99  <b>H40740-00</b> R 11115-20042 88,9 Ø 1,3 mm MLS [1] 01/00→  <b>H40741-00</b> L 11116-20042 88,9 Ø 1,3 mm MLS [1] 01/00→ 	<b>T40738-00</b> 90910-02117 (8x) 	
3,0 11B	61-75 kW (88-102 PS) DYNA D DYNA 200	08/88→	<b>S83272-00</b> (12) (13) 04111-56060  <b>D83272-00</b> (12) 	<b>H40017-10</b> 11115-56100 96 Ø 1,6 mm 3 M MLS 		
3,0 2JZ-GE <b>[NEW]</b>	162 kW (220 PS) CROWN	08/91-08/99	<b>S81762-00</b> (12) (13) (19) 04111-46065 <b>D81762-00</b> (12) (19) 04112-46065	<b>H81762-00</b> 11115-46045 87,5 Ø 0,3 mm MLS 	<b>T81762-00</b> 90910-02102 (14x) 	
3,0 2JZ-GE <b>[NEW]</b>	168 kW (228 PS) SUPRA	05/93-08/02	<b>S81762-00</b> (12) (13) (19) 04111-46065 [1] →09/97 <b>S81762-01</b> (12) (13) (19) 04111-46102 [1] 10/97→ <b>D81762-00</b> (12) (19) 04112-46065 [1] →09/97 <b>D81762-01</b> (12) (19) 04112-46102 [1] 10/97→	<b>H81762-00</b> 11115-46045 87,5 Ø 0,3 mm MLS 	<b>T81762-00</b> 90910-02102 (14x) 	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

⑪ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>V59941-00</b> R 11213-20020 +11193-70010 (3x)  <b>V59942-00</b> L 11214-20010 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> 12x 90080-31084 <b>P76880-00</b> 12x 90080-31085	<b>X59943-01</b> R 17177-20020  <b>X59944-01</b> L 17178-20020  <b>X59945-01</b> ⑩ 17176-62030 	<b>X59946-01</b> 2x 17173-20030 	<b>70-31414-10</b> 	<b>P77553-01</b> K ← 90311-40013 40x55x6 A SL RD <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM <b>P77619-01</b> N 2x 90311-38034 38x50x10,5 A SL RD FPM
<b>X83272-01</b> 11213-56030 	<b>N93016-00</b> 90913-02076 (8x)	<b>X89775-01</b> 17171-56010 	<b>X82181-01</b> 17173-58010  <b>X82317-01</b> ⚠ 90917-06012 	<b>70-31414-10</b> 	<b>P77557-01</b> K ← 90311-50013 50x72 A SL RD FPM <b>P77533-01</b> K → 90311-95008 95x115x12/9,5 B SL LD MVQ
<b>X89989-01</b> ES 11213-46020  <b>X89990-01</b> AS 11214-46011 	<b>N93006-03</b> 90913-02090 (12x) +90913-02089 (12x) <b>P93184-00</b> ES 12x 90913-02090 <b>P93185-00</b> AS 12x 90913-02089	<b>X89995-01</b> 17177-46040  <b>X89996-01</b> ⑩ 17176-46020 	<b>X89997-01</b> 2x 17173-46020 	<b>70-31414-10</b> 	<b>P93188-01</b> K ← 90311-46001 45,5x63x6,5 A SL RD <b>P93189-01</b> K → 90311-90006 90x110x9,5 A SL LD <b>P93190-01</b> N 2x 90311-40020 40,5x52,5x6,5 A SL RD
<b>X89989-01</b> ES 11213-46020 [1] →09/97  <b>X89991-01</b> ES 11213-46030 [1] 10/97→  <b>X89990-01</b> AS 11214-46011 	<b>N93006-03</b> 90913-02090 (12x) +90913-02089 (12x) <b>P93184-00</b> ES 12x 90913-02090 <b>P93185-00</b> AS 12x 90913-02089	<b>X89995-01</b> 17177-46040 [1] →09/97  <b>X90006-01</b> 17177-46060 [1] 10/97→  <b>X89996-01</b> ⑩ 17176-46020 	<b>X89997-01</b> 2x 17173-46020 [1] →09/97  <b>X89998-01</b> 2x 17173-46051 [1] 10/97→ 	<b>70-31414-10</b> 	<b>P93188-01</b> K ← 90311-46001 45,5x63x6,5 A SL RD <b>P93189-01</b> K → 90311-90006 90x110x9,5 A SL LD <b>P93190-01</b> N 2x 90311-40020 40,5x52,5x6,5 A SL RD

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA						
Ltr.						
3,0 2JZ-GTE <b>[NEW]</b>	243 kW (330 PS) SUPRA V6 TURBO	05/93-08/02	<b>S40747-00</b> 04111-46094 <b>D40747-00</b> 04112-46094 ⑫ ⑬ ⑰	<b>H40747-00</b> 11115-46052 87,5 Ø 1,25 mm MLS 	<b>T81762-00</b> 90910-02102 (14x) 	
3,0 3GR-FE <b>[NEW]</b>	167-170 kW (227-231 PS) CROWN	09/04-11/12		<b>H40723-00</b> R 11115-31041 89,5 Ø 0,5 mm MLS 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 	
				<b>H40724-00</b> L 11116-31021 89,5 Ø 0,5 mm MLS 		
3,0 3GR-FSE <b>[NEW]</b>	183-188 kW (249-256 PS)		<b>S38743-00</b> ⑫ ⑬ ⑰ 04111-31290 <b>D38743-00</b> ⑫ ⑰ 04112-31160	<b>H40723-00</b> R 11115-31041 89,5 Ø 0,5 mm MLS 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 	
				<b>H40724-00</b> L 11116-31021 89,5 Ø 0,5 mm MLS 		

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

⑰ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>X89989-01</b> ES 11213-46020 	<b>N93006-03</b> 90913-02090 (12x) +90913-02089 (12x) <b>P93184-00</b> ES 12x 90913-02090 <b>P93185-00</b> AS 12x 90913-02089	<b>X90023-01</b> 17177-46031 	<b>X90018-01</b> ⑩ 17176-46030 	<b>X90019-01</b> 17173-46040 Zyl. 1-3 	<b>X90020-01</b> 17198-46010 Zyl. 4-6 
<b>V59900-00</b> L 11214-31020 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085	<b>X59904-01</b> 2x 17173-31020 	<b>X59903-01</b> ⑩ 17176-31020 	<b>70-31414-10</b> 	<b>P93188-01</b> K ← 90311-46001 45,5x63x6,5 A SL RD <b>P93189-01</b> K → 90311-90006 90x110x9,5 A SL LD <b>P93190-01</b> N 2x 90311-40020 40,5x52,5x6,5 A SL RD
<b>V59900-00</b> L 11214-31020 +11193-70010 (3x) 	<b>V83412-00</b> R 11213-31050 +11193-70010 (3x) 	<b>X59908-01</b> 2x 17177-31021 	<b>X59904-01</b> 2x 17173-31020 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM
<b>V59899-00</b> R 11213-31040 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085	<b>X59908-01</b> 2x 17177-31021 	<b>X59903-01</b> ⑩ 17176-31020 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM
<b>V59900-00</b> L 11214-31020 +11193-70010 (3x) 					

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска

ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA						
Ltr.						
3,0 3VZ-E	105 kW (143 PS) 4 RUNNER V6	07/90-11/95				
			<b>S40077-00</b> ⑫ ⑬ 04111-65018 <b>D40077-00</b> ⑫ 04112-65015	<b>H40077-00</b> L 11116-65031 89 Ø 1,45 mm  <b>H40078-00</b> R 11115-65031 89 Ø 1,45 mm 		
3,0 3VZ-FE	138-140 kW (188-190 PS) CAMRY CAMRY V6	06/91-07/01	<b>S40005-01</b> ⑫ ⑬ 04111-62050 <b>D40005-01</b> ⑫ 04112-62040	<b>H40005-00</b> R 11115-62060 89,5 Ø  <b>H40030-00</b> L 11116-62060 89,5 Ø 		
3,0 5L	65 kW (88 PS) HILUX LN	08/97→	<b>S31458-02</b> ⑫ ⑬ 04111-54083   <b>D31458-02</b> ⑫ 04112-54071 	<b>H01064-00</b> 11115-54120-B0 100,5 Ø 1,45 mm 1 MLS <b>H11064-10</b> 11115-54120-D0 100,5 Ø 1,55 mm 2 MLS <b>H21064-20</b> 11115-54120-F0 100,5 Ø 1,65 mm 3 MLS 	<b>T40318-00</b> 90910-02080 (14x) +90910-02081 (4x) 	
3,0 7M-GEU 7M-GTE	149-175 kW (203-238 PS) CELICA SUPRA SUPRA V6 TURBO	09/87→	<b>S80952-00</b> ⑫ ⑬ 04111-42030 <b>D80952-00</b> ⑫ 04112-42030	<b>H80952-00</b> 11115-42020 84,5 Ø 	<b>T40358-00</b> 90110-12002 (14x) 	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>X83310-01</b> 2x 11213-65010 	<b>N93014-00</b> 90913-02053 (6x) A +90913-02091 (6x) E	<b>X89770-01</b> 2x 17177-65010  <b>X89832-01</b> ⑩ 17176-65020 	<b>X82287-01</b> L 17198-65031  <b>X82288-01</b> R 17173-65031 	<b>70-31414-10</b> 	<b>P77553-01</b> K ← 90311-40013 40x55x6 A SL RD <b>P77531-01</b> K → 90311-92006 92x110x8,5 A SL LD MVQ <b>P77620-01</b> N ← 90311-42027 42x55x8 A SL RD FPM
<b>V37994-00</b> 2x 11213-62020 	<b>N93049-00</b> 90913-02103 (12x) E +90913-02095 (12x) A	<b>X89769-01</b> 2x 17177-62050 	<b>X82286-01</b> 2x 17173-62040 	<b>70-31414-10</b> 	<b>P77597-01</b> K ← 35x48x7 A SL RD MVQ <b>P77531-01</b> K → 90311-92006 92x110x8,5 A SL LD MVQ <b>P77619-01</b> N ← 2x 90311-38034 38x50x10,5 A SL RD FPM
<b>X83377-01</b> 11213-54050 	<b>N92321-00</b> 90913-02116 (8x) <b>N93061-00</b> 90913-02102 (8x)	<b>X89965-01</b> 17177-54020 	<b>X82383-01</b> 17173-54030  <b>X82325-01</b> 2x 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77523-01</b> K → 90311-85003 85x105x10 A SL LD FPM <b>P77580-01</b> N 90311-32017 32x46x6 A SL RD MVQ
<b>X83239-01</b> 2x 11213-42020 	<b>N92012-03</b> 90913-02062 (24x)	<b>X89652-01</b> 17177-42010 	<b>X82180-01</b> 17173-43020 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77536-01</b> K → 80x100x12 A SL LD MVQ <b>P77586-01</b> N 90311-35040 35x49x6 A SL RD MVQ



TOYOTA									
Ltr.									
3,3	3MZ-FE <b>[NEW]</b>	165-171 kW (224-233 PS)	CAMRY CAMRY VVTi KLUGER SIENNA	08/02-11/09	<b>S40744-00</b> 04111-20630 <b>D40744-00</b> 04112-20270	⑫ ⑬ ⑰	<b>H40744-00</b> R 11115-20051 93,4 Ø 1,3 mm MLS	<b>T40738-00</b> 90910-02117 (8x)	2x
							<b>H40745-00</b> L 11116-20051 93,4 Ø 1,3 mm MLS		
3,4	13B	66 kW (90 PS)	DYNA D	08/77-08/87	<b>S80867-00</b> 04111-58013  <b>S80867-01</b> 04111-58050  <b>D80867-00</b> 04112-58011 <b>D80867-01</b> 04112-58042	⑫ ⑬	<b>H80867-00</b> 11115-58013 106,8 Ø		
3,4	3B	66 kW (90 PS)	DYNA D	08/77-08/87	<b>S80867-00</b> 04111-58013 ① →08/84  <b>S80867-01</b> 04111-58050 ① 11/84→  <b>D80867-00</b> 04112-58011 ① →08/84 <b>D80867-01</b> 04112-58042 ① 11/84→	⑫ ⑬	<b>H80867-00</b> 11115-58013 106,8 Ø		
3,4	3B	70 kW (95 PS)	LAND CRUISER D	11/84-12/96	<b>S80867-01</b> 04111-58050 ① →08/88  <b>S40018-00</b> 04111-58060 ① 09/88→ <b>D80867-01</b> 04112-58042 ① →08/88 <b>D40018-00</b> 04112-58050 ① 09/88→	⑫ ⑬	<b>H40018-00</b> 11115-58081 103,5 Ø MLS <b>H80867-00</b> 11115-58013 106,8 Ø	<b>T40322-00</b> 90910-02084 (18x) ① 09/88→ 	

⑰ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>V59958-00</b> R 11213-20030 +11193-70010 (3x)  <b>V59959-00</b> L 11214-20030 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> 90080-31084 <b>P76880-00</b> 90080-31085	<b>X59943-01</b> R 17177-20020 <b>X59944-01</b> L 17178-20020 <b>X59963-01</b> ⑩ 17176-20020 	<b>X59946-01</b> 2x 17173-20030 	<b>70-31414-10</b> 	<b>P77553-01</b> K ← 90311-40013 40x55x6 A SL RD <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM <b>P77619-01</b> N 2x 90311-38034 38x50x10,5 A SL RD FPM
<b>X83238-01</b> 11213-56012 	<b>N93018-00</b> 90913-02051 (8x)	<b>X89613-01</b> 17177-25030 	<b>X82181-01</b> 17173-58010 <b>X82317-01</b> 90917-06012 	<b>70-31414-10</b> 	<b>P77557-01</b> K ← 90311-50013 50x72 A SL RD FPM <b>P77534-01</b> K → 95x115x12 A SL LD MVQ
<b>X83238-01</b> 11213-56012 	<b>N93018-00</b> 90913-02051 (8x)	<b>X89613-01</b> 17177-25030 	<b>X82181-01</b> 17173-58010 <b>X82317-01</b> 90917-06012 	<b>70-31414-10</b> 	<b>P77557-01</b> K ← 90311-50013 50x72 A SL RD FPM <b>P77534-01</b> K → 95x115x12 A SL LD MVQ
<b>X83238-01</b> 11213-56012 ① →08/88  <b>X83272-01</b> 11213-56030 ① 09/88→ 	<b>N93018-00</b> 90913-02051 (8x) ① →08/88 <b>N93016-00</b> 90913-02076 (8x) ① 09/88→	<b>X89775-01</b> 17171-56010 ① 09/88→ 	<b>X82181-01</b> 17173-58010 ① →08/88 <b>X82248-01</b> ① 09/88→ <b>X82317-01</b> 90917-06012 	<b>70-31414-10</b> 	<b>P77557-01</b> K ← 90311-50013 50x72 A SL RD FPM <b>P77534-01</b> K → 95x115x12 A SL LD MVQ

⑩ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



TOYOTA						
Ltr.						
3,4 5VZ-FE <b>[NEW]</b>	131-136 kW (178-185 PS) HILUX LAND CRUISER V6	11/95→		<p><b>S38721-00</b> ⑫ ⑬ 04111-62081 ① →12/98 <b>S38723-00</b> ⑫ ⑬ ⑰ 04111-62130 ① 01/99→ <b>D38722-00</b> ⑫ 04112-62071 ① →12/98 <b>D38724-00</b> ⑫ ⑰ 04112-62110 ① 01/99→</p>	<p><b>H40712-00</b> R 11115-62071 95,5 Ø 1,3 mm ① →12/98</p> <p><b>H40713-00</b> L 11116-62071 95,5 Ø 1,3 mm ① →12/98</p> <p><b>H40714-00</b> R 11115-62081 1,3 mm MLS ① 01/99→</p> <p><b>H40715-00</b> L 11116-62081 1,3 mm MLS ① 01/99→</p>	<p><b>T40712-00</b> 2x 90910-02077 (8x)</p>
3,4 5VZ-FE <b>[NEW]</b>	131-140 kW (178-190 PS) HILUX LAND CRUISER TUNDRA	04/99-07/05		<p><b>S38723-00</b> ⑫ ⑬ ⑰ 04111-62130 <b>D38724-00</b> ⑫ ⑰ 04112-62110</p>	<p><b>H40714-00</b> R 11115-62081 1,3 mm MLS</p> <p><b>H40715-00</b> L 11116-62081 1,3 mm MLS</p>	<p><b>T40712-00</b> 2x 90910-02077 (8x)</p>
3,4 5VZ-FE <b>[NEW]</b>	136 kW (185 PS) 4 RUNNER V6	11/95-03/96		<p><b>S38721-00</b> ⑫ ⑬ 04111-62081 <b>D38722-00</b> ⑫ 04112-62071</p>	<p><b>H40712-00</b> R 11115-62071 95,5 Ø 1,3 mm</p> <p><b>H40713-00</b> L 11116-62071 95,5 Ø 1,3 mm</p>	<p><b>T40712-00</b> 2x 90910-02077 (8x)</p>

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

<p><b>V37994-01</b> 2x 11213-62020 +11193-70010 (3x) +90210-05007 (8x)</p>	<p><b>N93049-00</b> 90913-02103 (12x) E +90913-02095 (12x) A</p>	<p><b>X59892-01</b> 2x 17177-62060 <b>X59893-01</b> ⑩ 2x 17176-62040</p>	<p><b>X59894-01</b> 2x 17173-62050</p>	<p><b>70-31414-10</b></p>	<p><b>P77553-01</b> K ← 90311-40013 40x55x6 A SL RD <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM <b>P77852-01</b> N 2x 90311-38051 38,5x50x10 A SL RD</p>
<p><b>V37994-01</b> 2x 11213-62020 +11193-70010 (3x) +90210-05007 (8x)</p>	<p><b>N93049-00</b> 90913-02103 (12x) E +90913-02095 (12x) A</p>	<p><b>X59892-01</b> 2x 17177-62060 <b>X59893-01</b> ⑩ 2x 17176-62040</p>	<p><b>X59894-01</b> 2x 17173-62050</p>	<p><b>70-31414-10</b></p>	<p><b>P77553-01</b> K ← 90311-40013 40x55x6 A SL RD <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM <b>P77852-01</b> N 2x 90311-38051 38,5x50x10 A SL RD</p>
<p><b>V37994-01</b> 2x 11213-62020 +11193-70010 (3x) +90210-05007 (8x)</p>	<p><b>N93049-00</b> 90913-02103 (12x) E +90913-02095 (12x) A</p>	<p><b>X59892-01</b> 2x 17177-62060 <b>X59893-01</b> ⑩ 2x 17176-62040</p>	<p><b>X59894-01</b> 2x 17173-62050</p>	<p><b>70-31414-10</b></p>	<p><b>P77553-01</b> K ← 90311-40013 40x55x6 A SL RD <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM <b>P77852-01</b> N 2x 90311-38051 38,5x50x10 A SL RD</p>

⑰ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров





TOYOTA						
Ltr.						
3,5 1PZ	85 kW (116 PS) LAND CRUISER 3500 PZ570 LAND CRUISER 3500 PZ577	01/90-08/92	<b>S83275-00</b> ⑫ ⑬ 04111-17030  <b>D83275-00</b> ⑫ 04112-17030 	<b>H40025-20</b> 11115-18010-05 95,5 Ø 5 MLS 	<b>T40337-00</b> 90910-02096 (22x) 	
3,5 2GR-FE <b>[NEW]</b>	197-206 kW (268-280 PS) ALPHARD AVALON VVTi CAMRY CAMRY VVTi	01/05→	<b>S38719-00</b> ⑬ ⑰ 04111-31444 <b>D38719-00</b> ⑫ ⑰ 04112-31272	<b>H40721-00</b> R 11115-31080 96 Ø 0,5 mm MLS  <b>H40722-00</b> L 11116-31060 96 Ø 0,5 mm MLS 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 	
3,5 2GR-FSE <b>[NEW]</b>	218-235 kW (296-320 PS)		<b>S38720-00</b> ⑫ ⑬ ⑰ 04111-31602 <b>D38720-00</b> ⑫ ⑰	<b>H40721-00</b> R 11115-31080 96 Ø 0,5 mm MLS  <b>H40722-00</b> L 11116-31060 96 Ø 0,5 mm MLS 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

⑰ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>X83275-01</b> 11213-18010 	<b>N93013-00</b> 90913-02072 (10x) 	<b>X89712-01</b> 4x 17179-17010  <b>X89713-01</b> 1x 17171-17010 	<b>X82233-01</b> L 17173-17010  <b>X82234-01</b> R 17179-18010  <b>X82328-01</b> 	<b>70-31414-10</b> 	<b>P77501-01</b> K ← 90311-58006 58x72x7 A SL RD MVQ <b>P77533-01</b> K → 90311-95008 95x115x12/9,5 B SL LD MVQ <b>P77580-01</b> N 90311-32017 32x46x6 A SL RD MVQ
<b>V59900-00</b> L 11214-31020 +11193-70010 (3x)  <b>V83412-00</b> R 11213-31050 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085	<b>X59905-01</b> R 17177-31040  <b>X59906-01</b> L 17178-31030  <b>X59901-01</b> ⑩ 3x 17176-31090 	<b>X59904-01</b> 2x 17173-31020 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM
<b>V59899-00</b> R 11213-31040 +11193-70010 (3x)  <b>V59900-00</b> L 11214-31020 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085	<b>X59907-01</b> 2x 17177-31060 	<b>X59904-01</b> 2x 17173-31020 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA						
Ltr.						
3,5	2GR-FXE	183 kW (249 PS)	1	<b>S38742-00</b> (12) (13) (19) 04111-31891 <b>D38742-00</b> (12) (19) 04112-31561	<b>H40721-00</b> R 11115-31080 96 Ø 0,5 mm MLS  <b>H40722-00</b> L 11116-31060 96 Ø 0,5 mm MLS 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 
3,7	14B	71 kW (97 PS) DYNAD	08/88-07/01	<b>S80867-01</b> (12) (13) 04111-58050  <b>S83272-00</b> (12) (13) 04111-56060  <b>D83272-00</b> (12) 	<b>H01049-00</b> 11115-58070 1,5 mm <b>H11049-10</b> 11115-58090 1,6 mm <b>H21049-20</b> 11115-58100 1,7 mm 	<b>T40322-00</b> 90910-02084 (18x) 
4,0	1GR-FE	175-183 kW (238-249 PS) HILUX LAND CRUISER 4 RUNNER VVTi	08/02→	<b>S40589-00</b> (12) (13) (19) 04111-31343 <b>D40589-00</b> (12) 04112-31123	<b>H40589-00</b> R 11115-31031 MLS  <b>H40590-00</b> L 11116-31011 MLS 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 
4,0	1GR-FE	175-207 kW (238-282 PS) FJ CRUISER FORTUNER LAND CRUISER V6 LAND CRUISER V6 VVTi	01/10→	<b>S40601-00</b> (12) (13) (19) 04111-31A23 <b>D40601-00</b> (19) 04112-31700	<b>H40601-00</b> R 11115-31090 MLS  <b>H40602-00</b> L 11116-31070 	<b>T40589-00</b> 2x 90910-02162 (8x) +90105-10521 (2x) 

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

⑱ con junta de culata MLS / mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>V59900-00</b> L 11214-31020 +11193-70010 (3x)  <b>V83412-00</b> R 11213-31050 +11193-70010 (3x) 	<b>N93193-00</b> 2x 90913-02101 (6x) +90913-02112 (6x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085	<b>X59905-01</b> R 17177-31040  <b>X59906-01</b> L 17178-31030  <b>X59901-01</b> (10) 3x 17176-31090 	<b>X59904-01</b> 2x 17173-31020 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77531-11</b> K → 90311-92010 92x110x8,5 A SL LD FPM
<b>X83272-01</b> 11213-56030 	<b>N93016-00</b> 90913-02076 (8x)	<b>X89652-01</b> 17177-42010 	<b>X82317-01</b> 90917-06012 	<b>70-31414-10</b> 	<b>P77557-01</b> K ← 90311-50013 50x72 A SL RD FPM <b>P77533-01</b> K → 90311-95008 95x115x12/9,5 B SL LD MVQ
<b>X59520-01</b> R 11213-31030 ACM  <b>X59521-01</b> L 11214-31010 ACM 	<b>N76879-01</b> 90080-31084 (12x) +90080-31085 (12x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085	<b>X59528-01</b> R 17177-31010  <b>X59529-01</b> L 17178-31010  <b>X59522-01</b> (10) 17176-31010 	<b>X59530-01</b> 2x 17173-31010 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77775-01</b> K → 90311-99010 100x118x8,6 A SL LD FPM
<b>V83412-00</b> R 11213-31050 +11193-70010 (3x)  <b>V83413-00</b> L 11214-31030 (1x) +11193-70010 (3x) ACM 	<b>N76879-01</b> 90080-31084 (12x) +90080-31085 (12x) <b>P76879-00</b> ES 12x 90080-31084 <b>P76880-00</b> AS 12x 90080-31085	<b>X82530-01</b> R 17177-31050  <b>X82531-01</b> L 17178-31040  <b>X82548-01</b> (10) 17176-31100 	<b>X82532-01</b> 2x 17173-31050 	<b>70-31414-10</b> 	<b>P77595-01</b> K ← 90311-42003 42x60x7 A SL RD NBR <b>P77775-01</b> K → 90311-99010 100x118x8,6 A SL LD FPM

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
 ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



TOYOTA						
Ltr.						
4,0 12HT	100 kW (136 PS) LAND CRUISER TD	10/85-12/89	<b>S80958-00</b> ⑫ ⑬ 04111-68030 <b>D80958-00</b> ⑫ 04112-68030	<b>H80958-00</b> 11115-68030 92 Ø 		
4,0 2H	74-77 kW (101-105 PS) LAND CRUISER D	08/80-01/88	<b>S80957-00</b> ⑫ ⑬ 04111-68020 <b>D80957-00</b> ⑫ 04112-68020	<b>H80957-00</b> 11115-68020 92,5 Ø 		
4,0 3F	101 kW (137 PS) LAND CRUISER	11/84-08/87	<b>S80857-02</b> ⑫ ⑬ 04111-61070 <b>D80857-01</b> ⑫ 04112-61060	<b>H80857-00</b> 11115-61010 97 Ø 		
4,2 1HD-FT <b>[NEW]</b>	125 kW (170 PS) LAND CRUISER TD	03/95-12/97		<b>H40680-00</b> 11115-17031-01 1 mm 1		
				<b>H40680-10</b> 11115-17031-03 1,1 mm 3		
				<b>H40680-20</b> 11115-17031-05 1,2 mm 5		
4,2 1HD-FTE <b>[NEW]</b>	150 kW (204 PS) LAND CRUISER TD LAND CRUISER TDi	01/98→		<b>H40680-00</b> 11115-17031-01 1 mm 1		
				<b>H40680-10</b> 11115-17031-03 1,1 mm 3		
				<b>H40680-20</b> 11115-17031-05 1,2 mm 5		
4,2 1HD-T 1H-Z	92-123 kW (125-167 PS) COASTER TD LAND CRUISER D LAND CRUISER TD	10/87→	<b>S83289-00</b> ⑫ ⑬ 04111-17011  <b>D83289-00</b> ⑫ 04112-17011 	<b>H01068-00</b> 11115-17010-01 95 Ø 1,2 mm 1	<b>T40337-02</b> 90910-02096 (26x) 	
				<b>H11068-10</b> 11115-17010-03 95 Ø 1,3 mm 3		
				<b>H21068-20</b> 11115-17010-05 95 Ø 1,4 mm 5		
4,2 2F	88-89 kW (120-121 PS) LAND CRUISER	01/75-01/88	<b>S80857-01</b> ⑫ ⑬ 04111-61044 <b>D80857-00</b> ⑫ 04112-61041	<b>H80857-00</b> 11115-61010 97 Ø 		

⑫ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



<b>X83242-01</b> 11213-68020 	<b>N93021-00</b> 90913-02050 (12x) 	<b>X89716-01</b> 	<b>X82183-01</b> 17173-68010 6x 	<b>70-31414-10</b> 	<b>P77499-01 K ←</b> 90311-50017 50x68x9/14 A SL RD FPM <b>P77534-01 K →</b> 95x115x12 A SL LD MVQ
<b>X83241-01</b> 11213-68010 	<b>N93021-00</b> 90913-02050 (12x) 		<b>X82183-01</b> 17173-68010 6x 	<b>X54893-01</b> 12151-68010 	<b>P77557-01 K ←</b> 90311-50013 50x72 A SL RD FPM <b>P77534-01 K →</b> 95x115x12 A SL LD MVQ
<b>X83240-01</b> 11213-61020 	<b>N93023-00</b> 90913-02048 (12x) 		<b>X89818-01</b> ⑦ 17172-61060 	<b>X54861-01</b> 12151-60021 	<b>P77535-01 K →</b> 90311-99005 105x120x11 A SL LD MVQ
<b>X59841-01</b> 11213-17020 	<b>N93183-01</b> 90913-02096 (24x) <b>P76948-00</b> 90913-02096	<b>X59842-01</b> 2x 17171-17020 	<b>X59849-01</b> 2x 17173-17020 	<b>70-31414-10</b> 	<b>P77501-01 K ←</b> 90311-58006 58x72x7 A SL RD MVQ <b>P77533-01 K →</b> 90311-95008 95x115x12/9,5 B SL LD MVQ <b>P77580-01 N</b> 90311-32017 32x46x6 A SL RD MVQ
<b>X59840-01</b> 11213-17030 	<b>N93183-01</b> 90913-02096 (24x) <b>P76948-00</b> 90913-02096	<b>X59847-01</b> 2x 17171-17030 <b>X59848-01</b> ⑩ 17116-17020 	<b>X59849-01</b> 2x 17173-17020 	<b>70-31414-10</b> 	<b>P77552-01 K ←</b> 90080-31098 65x79x7 A SL RD FPM <b>P77533-01 K →</b> 90311-95008 95x115x12/9,5 B SL LD MVQ <b>P77580-01 N</b> 90311-32017 32x46x6 A SL RD MVQ
<b>X83289-01</b> 11213-17010 	<b>N76827-00</b> 90913-02094 (12x) <b>P76827-00</b> 90913-02094	<b>X89712-01</b> 5x 17179-17010 	<b>X82233-01</b> 2x 17173-17010 	<b>70-31414-10</b> 	<b>P77501-01 K ←</b> 90311-58006 58x72x7 A SL RD MVQ <b>P77533-01 K →</b> 90311-95008 95x115x12/9,5 B SL LD MVQ <b>P77580-01 N</b> 90311-32017 32x46x6 A SL RD MVQ
		<b>X89713-01</b> 1x 17171-17010 			
<b>X83191-01</b> 11213-61011 	<b>N93021-00</b> 90913-02050 (12x) 		<b>X82342-01</b> 	<b>X54861-01</b> 12151-60021 	<b>P77497-01 K ←</b> 90311-45002 45x68x12 A SL RD ACM

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус выпускного коллектора



<b>TOYOTA</b>							
Ltr.				1			
4,5	1FZ-FE	151 kW (205 PS)	LAND CRUISER	08/92-12/97	<b>S40640-00</b> (12) (13) 04111-66035 <b>D40640-00</b> (12) 04112-66035	<b>H40640-00</b> 11115-66031 1,4 mm 	<b>T40640-00</b> 90910-02111 (14x) 

Ⓜ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

<b>V59668-00</b> 11213-66021 (1x) +11193-15010 (6x) 	<b>N93183-00</b> 90913-02096 (12x) +90913-02105 (12x) <b>P76948-00</b> ES 12x 90913-02096 <b>P76949-00</b> AS 12x 90913-02105	<b>X59690-01</b> 17177-66040  <b>X59693-01</b> Ⓜ R 17171-66010  <b>X59694-01</b> Ⓜ L 17179-66010 	<b>X59691-01</b> R 17173-66020  <b>X59692-01</b> L 17198-66010 	<b>70-31414-10</b> 	<b>P77823-01</b> K ← 90311-52022 52x70 A SL RD <b>P77824-01</b> K → 90311-99009 99x119x9,5 A SL LD

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска

