

VOLKSWAGEN

VOLKSWAGEN

Table with 2 columns: Code and Value. Includes sections for 0-9 and A.

Table with 2 columns: Code and Value. Starts with ADZ and ends with AKN.

Table with 2 columns: Code and Value. Starts with AKP and ends with AS.

Table with 2 columns: Code and Value. Starts with ASV and ends with AXW.

Table with 2 columns: Code and Value. Starts with AXX and ends with BER.



Table with 2 columns: Code and Value. Starts with BEU and ends with BLV.



Table with 2 columns: Code and Value. Starts with BLX and ends with BVX.



Table with 2 columns: Code and Value. Starts with BVY and ends with CBZA.

VOLKSWAGEN

VOLKSWAGEN

 Code	
CBZB	1606
CBZC	1606
CCCA	1734
CCHA	1704
CCHB	1704
CCNA	1600
CCRA	1636
CCSA	1636
CCTA	1706
CCTB	1706
CCZA	1706
CCZB	1706
CCZC	1706
CCZD	1706
CD	1652
CDAA	1664
CDAB	1664
CDBA	1708
CDCA	1708
CDDA	1620
CDE	1638
CDF	1638
CDGA	1622
CDLA	1698
CDLC	1698
CDLF	1698
CDLG	1698
CDVA	1754
CDVB	1754
CDXA	1686
CDXB	1686
CE	1652
CEA	1664
CEBA	1734
CEBB	1734
CECA	1734
CECB	1734
CED	1662
CEN	1708
CEXA	1746
CEZA	1748
CFCA	1708
CFEA	1704
CFFA	1710
CFFB	1710
CFFD	1710
CFFE	1710
CFGB	1710
CFGD	1710
CFHB	1710
CFHC	1710
CFHE	1710
CFHF	1710
CFJA	1710
CFLA	1752
CFNA	1642
CFNB	1642
CFPA	1706
CFRA	1760
CFWA	1606
CFZA	1636
CG	1736
CGEA	1748
CGFA	1748
CGGA	1622
CGGB	1622

 Code	
CGM	1704
CGNA	1756
CGPA	1604
CGPB	1604
CGRA	1754
CGYA	1664
CGZ	1708
CH	1710
CHFA	1606
CHFB	1604
CHGA	1636
CHNA	1754
CHPA	1622
CHYA	1600
CHYB	1600
CJ	1710
CJAA	1706
CJGD	1750
CJKA	1704
CJKB	1704
CJLA	1606
CJMA	1750
CJTA	1748
CJZA	1608
CJZB	1608
CK	1624
CKDA	1758
CKMA	1622
CKTB	1708
CKTC	1708
CKUB	1708
CKUC	1708
CLCA	1710
CLCB	1710
CLHA	1642
CLHB	1642
CLJA	1710
CLLA	1710
CLNA	1640
CLPA	1624
CLRA	1638
CLSA	1642
CMAA	1622
CMBA	1622
CMR	1642
CMSB	1622
CMTA	1754
CMVA	1754
CMXA	1636
CNEA	1708
CNFA	1708
CNFB	1708
CNGA	1750
CNKA	1642
CNLA	1622
CNNA	1754
CNRB	1750
CNWA	1622
CNWB	1622
CP	1722-1724
CPBA	1600
CPGA	1602
CPLA	1710
CPPA	1710
CPTA	1624
CR	1644

 Code	
CRBC	1712
CRCA	1750
CRJA	1622
CRKB	1642
CRLB	1712
CRVA	1712
CRZA	1698
CS	1644
CSHA	1708
CT	1634
CTHA	1622
CTHB	1622
CTHC	1622
CTHD	1622
CTHE	1622
CTKA	1622
CU	1712
CV	1712
CY	1628
CZ	1634



<b>D</b>	
D	1608
DF	1688
DG	1688
DH	1688
DJ	1714
DL	1724
DS	1664
DT	1646
DTA	1646
DV	1724
DW	1724
DX	1664
DZ	1664

<b>E</b>	
E	1608
EG	1646
EM	1646
EP	1610
EU	1610
EV	1664
EW	1626
EWA	1626
EX	1664
EZ	1626
EZA	1626

<b>F</b>	
F	1608
FA	1602
FB	1626
FF	1626
FH	1626
FJ	1602
FK	1626
FN	1646
FP	1646
FR	1646
FS	1646
FT	1646
FV	1646
FY	1610
FZ	1610

 Code	
<b>G</b>	
GE	1710
GF	1610
GG	1602
GH	1626
GK	1610
GL	1602
GN	1602
GS	1610
GT	1610
GU	1664
GW	1688
GX	1664
GZ	1664

<b>H</b>	
H	1626
HA	1596
HB	1602-1604
HC	1602
HH	1610
HJ	1610
HK	1610
HM	1626
HN	1626
HP	1712
HS	1724
HT	1664
HV	1664
HW	1610
HY	1716
HZ	1596

<b>J</b>	
JB	1626
JH	1664
JJ	1664
JK	1628
JN	1666
JP	1628
JR	1628
JS	1712
JT	1716
JU	1646
JX	1646

<b>K</b>	
K	1626
KR	1666
KT	1664
KV	1716
KX	1716
KY	1652



  

<b>L</b>	
L	1626

<b>M</b>	
M	1626
M51	1608
ME	1646
MF	1648
MH	1610
MN	1612
MV	1714

VOLKSWAGEN



 Code	
<b>N</b>	
NU	1610
NZ	1608

<b>P</b>	
P	1628
PB	1664
PD	1666
PF	1664
PG	1666
PL	1666
PN	1626
PP	1646
PY	1612

<b>R</b>	
RA	1648
RD	1664



 Code	
RE	1626
RF	1626
RG	1664
RH	1664
RL	1646
RM	1664
RP	1664
RV	1664

<b>S</b>	
SB	1648
SP	1688
SR	1714
SS	1714

<b>T</b>	
T	1628



 Code	
<b>U</b>	
U	1628
UDH	1662
UNF	1638
UPD	1638
UQG	1714

<b>V</b>	
V	1652

<b>W</b>	
W	1652
WE	1716
WL	1654
WN	1690
WP	1646
WV	1646
WY	1646

 Code	
<b>Y</b>	
YH	1646
YJ	1626
YK	1646
YN	1646
YP	1646
YS	1646
YU	1646
YX	1654
YY	1646

<b>Z</b>	
Z	1652
ZA	1612
ZB	1626
ZC	1626
ZF	1612

VOLKSWAGEN							
0,9 HA	29 kW (40 PS)	DERBY POLO	→ 866 2500 000 → 866 2500 000	09/75-09/81	<b>S30579-00</b> (12) (13) 052198001 <b>D30579-00</b> (12) 052 198 012 AE <b>B30579-00</b> (13) 052 198 011 A	<b>H03693-00</b> 052 103 383 AA 71 Ø 	<b>T04125-00</b> 049 103 384 B (10x) 
0,9 HA	29 kW (40 PS)	DERBY POLO	867 2300 001 → 867 2300 001 →	09/75-09/81	<b>S30580-00</b> (12) (13) 052198001L <b>D30580-00</b> (12) 052 198 012 AF <b>B30579-00</b> (13) 052 198 011 A	<b>H04132-00</b> 052 103 383 AB 71 Ø 	<b>T04132-00</b> 049 103 385 (10x) 
1,0 AAK HZ	33-37 kW (45-50 PS)	DERBY GOLF POLO		08/81-09/94	 <b>D31187-00</b> (12) 030 198 012 A <b>B30579-00</b> (13) 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 
1,0 AAU ACM	33 kW (45 PS)	POLO	→ 80 N 500 000	01/85-12/99	 <b>D31187-00</b> (12) 030 198 012 A <b>B30579-00</b> (13) 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 
1,0 AAU ACM	33 kW (45 PS)	POLO	80 P 000 001 →	01/85-12/99	<b>S32714-00</b> (12) (13) <b>D32714-00</b> (12) 030 198 012 B <b>B30579-00</b> (13) 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 



<b>X03744-01</b> ✗ 052 103 483 A Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 	<b>X03745-01</b> 030 129 717 D → 07/79 <b>X03742-01</b> 036 129 717 C 08/79 →	<b>X03743-01</b> 2x 030 253 039 A  <b>X51310-01</b> ⚠ 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>X03744-01</b> ✗ 052 103 483 A Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 	<b>X03745-01</b> 030 129 717 D → 07/79 <b>X03742-01</b> 036 129 717 C 08/79 →	<b>X03743-01</b> 2x 030 253 039 A  <b>X51310-01</b> ⚠ 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V31187-00</b> 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 	<b>X03745-01</b> 030 129 717 D 	<b>X03743-01</b> 2x 030 253 039 A  <b>X51310-01</b> ⚠ 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V31187-00</b> 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 	<b>X03745-01</b> 030 129 717 D 	<b>X03743-01</b> 2x 030 253 039 A  <b>X51310-01</b> ⚠ 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V31187-00</b> 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 	<b>X03745-01</b> 030 129 717 D 	<b>X03743-01</b> 2x 030 253 039 A  <b>X51310-01</b> ⚠ 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN						
Ltr.						
1,0 AER	37 kW (50 PS) LUPO POLO	09/96-07/05	<b>D32949-00</b> ⑫ 030 198 012 F <b>B32705-00</b> ⑬ 030 198 011 A → AER 220 083 <b>B32949-00</b> ⑬ ⑳ → AER 220 084→	<b>H50943-00</b> 030 103 383 AK 68 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 	
1,0 AEV	33 kW (45 PS) POLO	10/94-09/96	<b>S32710-00</b> ⑫ ⑬ <b>D32710-00</b> ⑫ 030 198 012 D <b>B32705-00</b> ⑬ 030 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	
1,0 AHT	37 kW (50 PS) LUPO	10/98-05/00	<b>D36701-00</b> ⑫ <b>B36701-00</b> ⑬	<b>H80471-00</b> 047 103 383 B 73,5 Ø 	<b>T80471-00</b> N 907 957 01 (5x) +N 907 958 01 (4x) +N 907 956 01 (1x) 	
1,0 ALD ANV AUC	37 kW (50 PS) LUPO POLO	09/98-07/05	<b>D32950-00</b> ⑫	<b>H80093-00</b> 030 103 383 BE 68 Ø MLS 	<b>T50493-00</b> WHT 001 808 (10x) 	

⑳ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>M37167-00</b> 030 198 717 	<b>X51584-01</b> 032 253 039 E 	<b>70-31414-10</b> 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM → AER 220 083 <b>P77313-01 K</b> ← 036 103 085 H 32x42x6/7 A SL RD NBR → AER 220 084→ <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AER 220 083 <b>P77317-01 K</b> → 028 103 171 B PTFE → AER 220 084→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X58344-01</b> 030 129 717 D 	<b>X51584-01</b> 032 253 039 E 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53041-01</b> 047 103 483 NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X87468-01</b> 2x 047 129 717 B 	<b>X81438-01</b> L 047 253 039 H <b>X81439-01</b> 047 253 050 <b>X81682-01</b> R 047 253 039 J 	<b>X54718-01</b> 047 103 609 B 	<b>P76230-01 K</b> ← 047 103 085 42x58x8 A SL RD FPM <b>P77290-01 K</b> → 047 103 085 A 85x105x12 A SL LD FPM
	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>M37167-00</b> 030 198 717 	<b>X51580-01</b> 030 253 039 H 	<b>70-31414-10</b> 	<b>P77313-01 K</b> ← 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77350-01 K</b> → 030 103 171 K PTFE <b>P77313-01 N</b> 036 103 085 H 32x42x6/7 A SL RD NBR



VOLKSWAGEN						
Ltr.						
1,0 ALL	37 kW (50 PS) Lupo POLO	09/96-07/05	<b>D32949-00</b> ⑫ 030 198 012 F <b>B32949-00</b> ⑬ ⑮	<b>H50943-00</b> 030 103 383 AK 68 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 	
1,0 AqZ AZN BJE BJR BNW BNX BTY CCNA	40-56 kW (54-76 PS) GOL VOYAGE	10/05→	<b>D37194-00</b> ⑫	<b>H80796-00</b> 036 103 383 AF 68 Ø MLS 	<b>T80786-00</b> WHT 001 865 (10x) 	
1,0 ARA	43-58 kW (58-79 PS)		<b>D37195-00</b> ⑫ <b>B37195-00</b> ⑭	<b>H80796-00</b> 036 103 383 AF 68 Ø MLS 	<b>T80344-00</b> 036 103 384 E (10x) 	
1,0 AZP <b>[NEW]</b>	51 kW (69 PS) GOL	09/97-09/05	<b>B37195-00</b> ⑭	<b>H80796-00</b> 036 103 383 AF 68 Ø MLS 	<b>T80344-00</b> 036 103 384 E (10x) 	
1,0 CHYA CHYB <b>[NEW]</b>	44-55 kW (60-75 PS) UP	12/11→	<del><b>S40694-00</b> ⑫ ⑬ ⑮</del> <del><b>D40694-00</b> ⑫</del>	<b>H40694-00</b> 04C 103 383 H 75,5 Ø MLS 	<b>T40706-01</b> WHT 004 926 (8x) 	
1,0 CPBA <b>[NEW]</b>	54 kW (73 PS)			<b>H80796-00</b> 036 103 383 AF 68 Ø MLS 	<b>T80786-00</b> WHT 001 865 (10x) 	

⑭ sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала  
 ⑮ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала  
 ⑯ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>M37167-00</b> 030 198 717 	<b>X51584-01</b> 032 253 039 E 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77317-01 K →</b> 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>70-31414-10</b> 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675 8x	<b>X89552-01</b> 4x 030 129 717 E 	<b>X51580-01</b> 030 253 039 H 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77313-01 N</b> 036 103 085 H 32x42x6/7 A SL RD NBR
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X58340-01</b> 4x 030 129 717 F 	<b>X51579-01</b> 036 253 039 F 	<b>70-31414-10</b> 	<b>P77329-01 N</b> 2x 036 103 085 A 27x42x8 A SL RD NBR
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X58997-01</b> 4x 036 129 717 E 	<b>X51579-01</b> 036 253 039 F 	<b>70-31414-10</b> 	<b>P77329-01 N</b> 2x 036 103 085 A 27x42x8 A SL RD NBR
<b>X59875-01</b> 04C 103 483 B i →04/13 	<b>N93196-01</b> 04E 109 675 (6x) +04E 109 675 A (6x) <b>P76960-00</b> AS 6x 04E 109 675 A <b>P76961-00</b> ES 6x 04E 109 675	<b>X58997-01</b> 3x 036 129 717 E 	<b>X59947-01</b> 1S0 253 115 B 	<b>70-31414-10</b> 	<b>P77841-01 K ←</b> 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77843-01 N ←</b> 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77844-01 N →</b> 04E 103 085 24x39x8 A SL LD PTFE
<b>X59949-01</b> 04C 103 483 E i 05/13→ 		<b>X59876-01</b> 04C 129 717 B 			
<b>70-31414-10</b> 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675 8x		<b>X51580-01</b> 030 253 039 H 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
 ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска





VOLKSWAGEN						
Ltr.						
1,0 CPGA	50 kW (68 PS) UP	11/12→				
<b>[NEW]</b>						
1,0 GL GN	29-33 kW (40-45 PS) DERBY GOLF POLO	10/81-10/86	<b>S40699-00</b> (12) (13) (38) <b>D40699-00</b> (12)	<b>H40699-00</b> 04C 103 383 N 75,5 Ø MLS 	<b>T40706-01</b> WHT 004 926 (8x) 	
1,1 FA GG HB HC	37-44 kW (50-60 PS) GOLF POLO SCIROCCO	04/74-07/83	<b>S32711-00</b> (12) (13) <b>D32711-00</b> (12) 052 198 012 R <b>B30579-00</b> (13) 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	
1,1 FJ	38 kW (52 PS) GOLF	01/81-07/83	<b>S30579-00</b> (12) (13) 052198001 1 →06/76 <b>S30580-00</b> (12) (13) 052198001L 1 →07/76→ <b>D30579-00</b> (12) 052 198 012 AE 1 →06/76 <b>D30580-00</b> (12) 052 198 012 AF 1 →07/76→ <b>B30579-00</b> (13) 052 198 011 A	<b>H03693-00</b> 052 103 383 AA 71 Ø 1 →06/76  <b>H04132-00</b> 052 103 383 AB 71 Ø 1 →07/76→ 	<b>T04125-00</b> 049 103 384 B (10x) 	

Ⓢ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



<b>X59875-01</b> 04C 103 483 B 1 →04/13 	<b>N93197-00</b> 04E 109 675 A (12x) <b>P76960-00</b> 04E 109 675 A 12x 	<b>X58997-01</b> 036 129 717 E 3x <b>X59876-01</b> 04C 129 717 B 	<b>X59949-01</b> 04C 103 483 E 1 →05/13→ 	<b>X59947-01</b> 1S0 253 115 B 	<b>70-31414-10</b> 
<b>X53151-01</b> 052 103 483 C Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x 	<b>X58344-01</b> 030 129 717 D 	<b>X03743-01</b> 030 253 039 A 2x <b>X51310-01</b> 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P77841-01</b> K ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77843-01</b> N ← 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77844-01</b> N → 04E 103 085 24x39x8 A SL LD PTFE
<b>X03744-01</b> ✗ 052 103 483 A Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x 	<b>X03742-01</b> ✗ 036 129 717 C 	<b>X03743-01</b> 030 253 039 A 2x <b>X51310-01</b> 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>X53151-01</b> 052 103 483 C Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x 	<b>X03742-01</b> 036 129 717 C 	<b>X03743-01</b> 030 253 039 A 2x <b>X51310-01</b> 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN						
1,1 HB	37 kW (50 PS)	DERBY	02/77-09/81	<b>S30580-00</b> <sup>(12)</sup> <sup>(13)</sup> 052 198 001 L <b>D30580-00</b> <sup>(12)</sup> 052 198 012 AF <b>B30579-00</b> <sup>(13)</sup> 052 198 011 A	<b>H04132-00</b> 052 103 383 AB 71 Ø 	<b>T04125-00</b> 049 103 384 B (10x) 
1,2 ANY AYZ	45 kW (61 PS)	LUPO TDI	07/99-07/05	<del></del> <del></del> <b>B32959-00</b> <sup>(13)</sup> <sup>(38)</sup>	<b>H09197-00</b> 045 103 383 C 1,45 mm MLS 1 <b>H19197-10</b> 045 103 383 D 1,53 mm MLS 2 <b>H29197-20</b> 045 103 383 E 77,5 Ø 1,61 mm MLS 3 	
1,2 AWY BMD	40 kW (54-55 PS)	FOX POLO	01/02→	<del></del> <del></del> <b>B36702-00</b> <sup>(12)</sup> <b>B36702-00</b> <sup>(13)</sup>	<b>H80386-00</b> 03D 103 383 G 77,5 Ø MLS 	<b>T80386-00</b> WHT 001 808 (8x) 
1,2 AWY BMD	40 kW (54-55 PS)	FOX POLO	01/02→	<del></del> <del></del> <b>B36702-00</b> <sup>(12)</sup> <b>B36702-00</b> <sup>(13)</sup>	<b>H80386-00</b> 03D 103 383 G 77,5 Ø MLS 	<b>T80386-00</b> WHT 001 808 (8x) 
1,2 AZQ BME BZG CGPA CGPB	44-51 kW (60-70 PS)	POLO	10/01→	<del></del> <del></del> <b>B36702-00</b> <sup>(12)</sup> <b>B36702-00</b> <sup>(13)</sup>	<b>H80385-00</b> 03E 103 383 F 77,5 Ø MLS 	<b>T80385-00</b> 036 103 384 B (8x) 
1,2 BBM CHFB	40-44 kW (55-60 PS)	FOX POLO	04/05→	<del></del> <del></del> <b>B36702-00</b> <sup>(12)</sup> <b>B36702-00</b> <sup>(13)</sup>	<b>H80386-00</b> 03D 103 383 G 77,5 Ø MLS 	<b>T80386-00</b> WHT 001 808 (8x) 

Ⓢ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



<b>X03744-01</b> <sup>(X)</sup> 052 103 483 A Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X03742-01</b> <sup>(X)</sup> 036 129 717 C 	<b>X03743-01</b> <sup>(A)</sup> 030 253 039 A 2x <b>X51310-01</b> <sup>(A)</sup> 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> <sup>(K)</sup> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> <sup>(K)</sup> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> <sup>(N)</sup> 068 103 085 E 32x47x10 A SL WD FPM
<b>X83111-01</b> 045 103 483 C NBR 	<b>N92001-00</b> 027 109 675 (6x) <b>P76532-00</b> 027 109 675 6x	<b>X86491-01</b> 045 129 717 	<b>X52968-01</b> 045 253 039 	<b>70-31414-10</b> 	<b>P76096-11</b> <sup>(K)</sup> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01</b> <sup>(N)</sup> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>70-31414-10</b> 	<b>N92024-00</b> 036 109 675 (6x) <b>P76662-00</b> 036 109 675 6x	<b>X88298-01</b> <sup>(K)</sup> 03D 129 717 A 	<b>X81435-01</b> 03D 253 039 B 	<b>70-31414-10</b> 	<b>P76096-11</b> <sup>(K)</sup> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01</b> <sup>(K)</sup> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
<b>70-31414-10</b> 	<b>N92024-00</b> 036 109 675 (6x) <b>P76662-00</b> 036 109 675 6x	<b>W88299-01</b> <sup>(K)</sup> 03D 129 717 B 	<b>X81435-01</b> 03D 253 039 B 	<b>70-31414-10</b> 	<b>P76096-11</b> <sup>(K)</sup> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01</b> <sup>(K)</sup> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
<b>70-31414-10</b> 	<b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675 12x	<b>W88302-01</b> <sup>(K)</sup> 03E 129 717 B 	<b>X81445-01</b> 03E 253 039 A 	<b>70-31414-10</b> 	<b>P76096-11</b> <sup>(K)</sup> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01</b> <sup>(K)</sup> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
<b>70-31414-10</b> 	<b>N92024-00</b> 036 109 675 (6x) <b>P76662-00</b> 036 109 675 6x	<b>W88299-01</b> <sup>(K)</sup> 03D 129 717 B 	<b>X81435-01</b> 03D 253 039 B 	<b>70-31414-10</b> 	<b>P76096-11</b> <sup>(K)</sup> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01</b> <sup>(K)</sup> → 021 103 051 C 85x105x11 A SL LD PTFE ACM



VOLKSWAGEN						
Ltr.						
1,2 CBZA CBZB CBZC <b>[NEW]</b>	05/09→	63-77 kW (86-105 PS)	BEETLE TSI CADDY TSI GOLF TSI JETTA TSI POLO TSI TOURAN TSI	<b>D40579-00</b>  <b>B38301-00</b> (13) (35)	<b>H40579-00</b> 03F 103 383 E 72 Ø MLS 	<b>T40579-00</b> WHT 004 790 (10x) 
1,2 CFWA <b>[NEW]</b>	10/09→	55 kW (75 PS)	POLO TDI	<b>D38304-00</b> (12) <b>B38298-00</b> (14)	<b>H40645-00</b> 03P 103 383 C 82 Ø 1,55 mm 1 MLS <b>H40645-10</b> 03P 103 383 D 82 Ø 1,63 mm 2 MLS <b>H40645-20</b> 03P 103 383 E 82 Ø 1,71 mm 3 MLS 	<b>T50034-01</b> WHT 002 131 (8x) 
1,2 CHFA	09/10→	44 kW (60 PS)	FOX  5Z 64 000 001	<b>D36702-00</b> (12) <b>B36702-00</b> (13)	<b>H80386-00</b> 03D 103 383 G 77,5 Ø MLS 	<b>T80386-00</b> WHT 001 808 (8x) 
1,2 CHFA	09/10→	44 kW (60 PS)	FOX  5Z 64 014 186	<b>D36702-00</b> (12) <b>B36702-00</b> (13)	<b>H80386-00</b> 03D 103 383 G 77,5 Ø MLS 	<b>T80386-00</b> WHT 001 808 (8x) 
1,2 CJLA <b>[NEW]</b>		55 kW (75 PS)		<b>D36703-00</b> (12) <b>B36702-00</b> (13)	<b>H80385-00</b> 03E 103 383 F 77,5 Ø MLS 	<b>T80385-00</b> 036 103 384 B (8x) 

(14) sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала



<b>X59883-01</b> X 03F 103 483 A Metall  <b>70-31414-10</b> 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675 8x	<b>X59475-01</b> 03F 129 717 A 1x  <b>X59480-01</b> 03F 129 717 4x 	<b>X82520-01</b> 03F 253 041 P 	<b>70-31414-10</b> 	<b>P77181-01 K</b> ← 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77479-01 K</b> → 036 103 171B PTFE
<b>X59485-01</b> 03P 103 483 	<b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675 12x	<b>X59473-01</b> 03P 129 717 	<b>X82519-01</b> 03P 253 039 	<b>70-31414-10</b> 	<b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
<b>70-31414-10</b> 	<b>N92024-00</b> 036 109 675 (6x) <b>P76662-00</b> 036 109 675 6x	<b>X88298-01</b> 03D 129 717 A 3x 	<b>X81435-01</b> 03D 253 039 B 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
<b>70-31414-10</b> 	<b>N92024-00</b> 036 109 675 (6x) <b>P76662-00</b> 036 109 675 6x	<b>W88299-01</b> 03D 129 717 B 3x 	<b>X81435-01</b> 03D 253 039 B 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
<b>70-31414-10</b> 	<b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675 12x	<b>W88302-01</b> 03E 129 717 B 3x 	<b>X81445-01</b> 03E 253 039 A 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM

(35) contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала





VOLKSWAGEN						
Ltr.						
1,2 CJZA CJZB <b>[NEW]</b>	63-77 kW (86-105 PS)	GOLF TSI	11/12→	<b>D38726-00</b> ⑫ <b>B38725-00</b> ⑬ ⑳	<b>H40705-00</b> 04E 103 383 T 72 Ø MLS 	<b>T40706-00</b> WHT 004 926 (10x) 
1,2 D	25 kW (34 PS)	KAEFER KARMANN	09/57-12/85	<b>A30252-00</b> ⑭ 111 198 005 <b>D30252-00</b> ⑱ 113 198 101 A	<b>H03807-00</b> 113 101 343 B 90 Ø 	4x
1,2 M51	22 kW (30 PS)	KAEFER	01/54-07/65	<b>S37025-00</b> ⑯ 111 198 003		
1,2 122/2				<b>D30252-00</b> ⑱ 113 198 101 A		
1,3 AAV NZ 2G 3F	40-57 kW (54-78 PS)	GOLF JETTA POLO ↔ 80 N 500 000	06/86-09/94	<b>S31187-00</b> ⑫ ⑬  <b>D31187-00</b> ⑫ 030 198 012 A <b>B30579-00</b> ⑬ 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 
1,3 AAV NZ 2G 3F	40-57 kW (54-78 PS)	POLO ↔ 80 P 000 801→	07/87-09/94	<b>S32714-00</b> ⑫ ⑬ <b>D32714-00</b> ⑫ 030 198 012 B <b>B30579-00</b> ⑬ 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 
1,3 AB AC AR E F	27-32 kW (37-44 PS)	KAEFER KARMANN	07/64-03/81	<b>A30576-00</b> ⑭ 111 198 007 <b>D30252-00</b> ⑱ 113 198 101 A		


⑫ sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала  
 ⑬ con anillos para camisa de cilindro / mit Zylinderlaufbuchsenringe / with cylinder liner rings / avec joints de chemises de cylindre / con anelli tenuta canna cilindro / с прокладками гильз цилиндров  
 ⑭ para una culata de cilindro / für einen Zylinderkopf / for one cylinder head / pour une culasse / per una testata / для головки блока цилиндров



<b>X59930-01</b> 04E 103 483 H 	<b>N93196-00</b> 04E 109 675 (8x) +04E 109 675 A (8x) <b>P76960-00</b> AS 8x 04E 109 675 A <b>P76961-00</b> ES 8x 04E 109 675	<b>X58997-01</b> 036 129 717 E 4x 	<b>X59925-01</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>P77841-01</b> K ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77843-01</b> N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77844-01</b> N → 04E 103 085 24x39x8 A SL LD PTFE
<b>X00991-01</b> 2x 113 101 481 F Kork 			<b>X03808-01</b> 4x 111 251 261 C 		<b>P76303-01</b> K → 113 105 245 F 70x90x10 A LD ACM
<b>X83114-01</b> 2x 111 101 481 		<b>X89182-01</b> 2x N 13 821 1 			
<b>X00991-01</b> 2x 113 101 481 F Kork 			<b>X03808-01</b> 4x 111 251 261 C 		
<b>V31187-00</b> 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X03745-01</b> 030 129 717 D 	<b>X03743-01</b> 2x 030 253 039 A <b>X51310-01</b> Δ 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V31187-00</b> 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X03745-01</b> 030 129 717 D 	<b>X03743-01</b> 2x 030 253 039 A <b>X51310-01</b> Δ 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>X00991-01</b> 2x 113 101 481 F Kork 		<b>X00995-01</b> 2x 113 129 717 A 	<b>X03808-01</b> 4x 111 251 261 C 		<b>P76303-01</b> K → 113 105 245 F 70x90x10 A LD ACM
		<b>X03811-01</b> 2x 311 129 707 			

⑳ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач  
 AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
 ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



VOLKSWAGEN													
1,3	ADX	40 kW (55 PS)	POLO	10/94-07/95	<b>D32713-00</b> ⑫ 032 198 012 A <b>B32705-00</b> ⑬ 030 198 011 A	<b>H50505-00</b> 030 103 383 AH 77,5 Ø MLS	<b>T50505-00</b> 032 103 384 (10x)	<b>X53497-01</b> 030 103 483 K NBR	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57506-01</b> 032 129 717 C	<b>X51584-01</b> 032 253 039 E	<b>X03370-01</b> 032 103 609 B  <b>70-31414-10</b>	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,3	EP EU	44 kW (60 PS)	PASSAT	08/80-07/86	<b>S31194-00</b> ⑫ ⑬ <b>D31194-00</b> ⑫ 056 198 012 G <b>B30584-00</b> ⑬ 037 198 011 C	<b>H07850-00</b> 056 103 383 L 79 Ø 1,8 mm	<b>T04125-00</b> 049 103 384 B (10x)	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D	<b>X03747-01</b> 4x 026 129 589 A  <b>X07854-01</b> △ 841 253 115 B	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,3	FY FZ GF GS HH HJ	40-44 kW (55-60 PS)	DERBY GOLF JETTA PASSAT POLO SANTANA SCIROCCO	05/73-07/88	<b>S30583-00</b> ⑫ ⑬ <b>D30583-00</b> ⑫ 052 198 012 AB <b>B30579-00</b> ⑬ 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm	<b>T04132-00</b> 049 103 385 (10x)	<b>X03744-01</b> 052 103 483 A Kork  <b>X53151-01</b> 052 103 483 C Kork	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X03742-01</b> 8x 036 129 717 C  <b>X03745-01</b> 030 129 717 D	<b>X03743-01</b> 2x 030 253 039 A  <b>X51310-01</b> △ 861 253 115 A	<b>X03370-01</b> 032 103 609 B	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,3	GK GT HK HW	37-55 kW (50-75 PS)	DERBY GOLF JETTA POLO SCIROCCO	08/82-09/89	<b>S32711-00</b> ⑫ ⑬ <b>D32711-00</b> ⑫ 052 198 012 R <b>B30579-00</b> ⑬ 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm	<b>T04132-00</b> 049 103 385 (10x)	<b>X53151-01</b> 052 103 483 C Kork	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X58344-01</b> 8x 030 129 717 D	<b>X03743-01</b> 2x 030 253 039 A  <b>X51310-01</b> △ 861 253 115 A	<b>X03370-01</b> 032 103 609 B	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,3	MH NU	37-40 kW (50-55 PS)	GOLF JETTA POLO	08/83-09/94	<b>S31187-00</b> ⑫ ⑬  <b>D31187-00</b> ⑫ 030 198 012 A <b>B30579-00</b> ⑬ 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm	<b>T04125-00</b> 049 103 384 B (10x)	<b>V31187-00</b>	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X03745-01</b> 030 129 717 D	<b>X03743-01</b> 2x 030 253 039 A  <b>X51310-01</b> X △ 861 253 115 A	<b>X03370-01</b> 032 103 609 B	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN						
Ltr.						
1,3 MN	33 kW (45 PS)	POLO D	08/86-08/90	<b>S31188-00</b> <sup>(12) (13)</sup>  <b>D31188-00</b> <sup>(12)</sup> 031 198 012 A  <b>B30579-00</b> <sup>(13)</sup> 052 198 011 A	<b>H07907-00</b> 031 103 383 M 1,53 mm 1 <b>H17907-10</b> 031 103 383 N 1,57 mm 2 <b>H27907-20</b> 031 103 383 P 76,5 Ø 1,61 mm 3	<b>T02673-00</b> 068 103 384 A (10x) 
1,3 PY	83-85 kW (113-115 PS)	POLO G40	01/87-09/94	<b>D32712-00</b> <sup>(12)</sup> 030 198 012 C <b>B30579-00</b> <sup>(13)</sup> 052 198 011 A	<b>H80499-00</b> 030 103 383 R 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 
1,3 ZA ZF	40-44 kW (55-60 PS)	PASSAT	05/73-01/78	<b>S30584-00</b> <sup>(12) (13)</sup> 056198001A <b>D30584-00</b> <sup>(12)</sup> 056 198 012 D <b>B30584-00</b> <sup>(13)</sup> 037 198 011 C	<b>H04128-00</b> 049 103 383 M 78,5 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 
1,4 ABD	40-44 kW (55-60 PS)	GOLF VENTO	10/91-09/98	<b>S31187-00</b> <sup>(12) (13)</sup> 1 →07/94  <b>S32714-00</b> <sup>(12) (13)</sup> →ABD 558 154 <b>S32715-00</b> <sup>(12) (13)</sup> →ABD 558 155→ <b>D31187-00</b> <sup>(12)</sup> 030 198 012 A 1 →07/94 <b>D32714-00</b> <sup>(12)</sup> 030 198 012 B →ABD 558 154 <b>D32710-00</b> <sup>(12)</sup> 030 198 012 D →ABD 558 155→ <b>B30579-00</b> <sup>(13)</sup> 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 



<b>V31187-00</b> 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X03745-01</b> 030 129 717 D 	<b>X03743-01</b> 030 253 039 A 2x 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X07909-01</b> 3x NBR  <b>X53500-01</b> 030 103 483 C NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X58344-01</b> 030 129 717 D 	<b>X03743-01</b> 2x 030 253 039 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X04875-01</b> 026 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A <b>X07854-01</b> 841 253 115 B 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V31187-00</b> 1 →07/94  <b>X07908-01</b> 030 103 483 G NBR →ABD 558 154  <b>X53497-01</b> 030 103 483 K NBR →ABD 558 155→ 	<b>N90300-00</b> 026 109 675 (8x) 1 →07/92 <b>N91190-00</b> 027 109 675 (8x) 1 08/92→ <b>P76531-00</b> 026 109 675 1 →07/92 <b>P76532-00</b> 027 109 675 1 08/92→	<b>X03745-01</b> 030 129 717 D 	<b>X03743-01</b> 2x 030 253 039 A 1 →07/94 <b>X51584-01</b> 032 253 039 E 1 08/94→  <b>X51310-01</b> 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN						
Ltr.						
1,4 AEX	40-44 kW (55-60 PS) CADDY GOLF POLO VENTO	10/91-01/04	<b>S32705-00</b> (12) (13) → AEX 908 121 <b>D32705-00</b> (12) 032 198 012 B <b>B32705-00</b> (13) 030 198 011 A → AEX 908 121 <b>B32949-00</b> (13) (35) AEX 908 122 →	<b>H50505-00</b> 030 103 383 AH 77,5 Ø MLS 	<b>T50505-00</b> 032 103 384 (10x) 	
1,4 AFH	74 kW (100 PS) POLO	04/96-10/99	<b>D32951-00</b> (12) 030 198 012 E <b>B32705-00</b> (13) 030 198 011 A → AFH 030 000 <b>B37020-00</b> (13) (35) AFH 030 001 → 	<b>H80266-00</b> 036 103 383 K 77,5 Ø MLS 	<b>T80266-00</b> 036 103 384 (10x) 	
1,4 AFK AHW AKQ APE AQQ AUA AUB BBY BBZ BCA BCC BKY BUD	55-74 kW (75-101 PS) BORA CADDY GOLF LUPO POLO	08/97 →	<b>D36621-00</b> (12) <b>B32957-00</b> (13) (38) 036 198 011	<b>H80140-00</b> 036 103 383 AM 77,5 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 	
1,4 AGY	62 kW (84 PS)		<b>D37196-00</b> (12) <b>B37196-00</b> (13) (35)	<b>H80795-00</b> 17S 103 383 78,5 Ø MLS 	<b>T50469-00</b> 050 103 384 (10x) 	

(35) contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>M37167-00</b> 030 198 717 	<b>X51584-01</b> 032 253 039 E 	<b>70-31414-10</b> 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM → AEX 908 121 <b>P77313-01 K</b> ← 036 103 085 H 32x42x6/7 A SL RD NBR AEX 908 122 → <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AEX 908 121 <b>P77317-01 K</b> → 028 103 171 B PTFE AEX 908 122 → <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X58997-01</b> 4x 036 129 717 E 	<b>X52864-01</b> 036 253 039 C 	<b>70-31414-10</b> 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AFH 030 000 <b>P77317-01 K</b> → 028 103 171 B PTFE AFH 030 001 → <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X58997-01</b> 4x 036 129 717 E 	<b>X51579-01</b> 036 253 039 F 	<b>70-31414-10</b> 	<b>P77313-01 K</b> ← 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77329-01 N</b> 2x 036 103 085 A 27x42x8 A SL RD NBR
<b>X53263-01</b> 051 103 483 A ACM 2 Dichtlippen 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55430-01</b> 048 129 717 A 	<b>X03747-01</b> 4x 026 129 589 A 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P77317-01 K</b> → 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

(38) sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.						
1,4 AKK AKP ANW AUD	40-44 kW (54-60 PS) CADDY LUPO POLO	11/95-07/05	<b>D36554-00</b> <sup>(12)</sup>	<b>H80389-00</b> 030 103 383 AT 77,5 Ø MLS 	<b>T50493-00</b> WHT 001 808 (10x) 	
1,4 AKV	44 kW (60 PS) CADDY POLO	07/95-01/04	<b>S32705-00</b> <sup>(12) (13)</sup> → AKV 095 009 <b>D32705-00</b> <sup>(12)</sup> 032 198 012 B <b>B32705-00</b> <sup>(13)</sup> 030 198 011 A → AKV 095 009 <b>B32949-00</b> <sup>(13) (35)</sup> → AKV 095 010→	<b>H50505-00</b> 030 103 383 AH 77,5 Ø MLS 	<b>T50505-00</b> 032 103 384 (10x) 	
1,4 AMF ATL BAY	55-66 kW (75-90 PS) LUPO TDI POLO TDI	01/99→	<b>D36624-00</b> <sup>(12)</sup>  <b>B32959-00</b> <sup>(13) (38)</sup> 	<b>H09198-00</b> 045 103 383 F 1,45 mm MLS <b>H19198-10</b> 045 103 383 G 1,53 mm MLS <b>H29198-20</b> 045 103 383 H 80,5 Ø 1,61 mm MLS 	<b>T09198-00</b> 038 103 384 (8x) 	
1,4 ANM	74 kW (101 PS)		<b>D36621-00</b> <sup>(12)</sup>	<b>H80140-00</b> 036 103 383 AM 77,5 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 	

<sup>(35)</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	2x 16x	<b>M37167-00</b> 030 198 717 	<b>X51580-01</b> 030 253 039 H 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77350-01 K →</b> 030 103 171 K PTFE <b>P77313-01 N</b> 036 103 085 H 32x42x6/7 A SL RD NBR
<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	8x 	<b>M37167-00</b> 030 198 717 	<b>X51584-01</b> 032 253 039 E 	<b>70-31414-10</b> 
<b>X83111-01</b> 045 103 483 C NBR 	<b>N92001-00</b> 027 109 675 (6x) <b>P76532-00</b> 027 109 675	6x 	<b>X86491-01</b> 045 129 717 	<b>X52968-01</b> 045 253 039  <b>X52970-01</b> 1H0 253 115 A 	<b>70-31414-10</b> 
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	16x 	<b>X58997-01</b> 4x 036 129 717 E  <b>X87493-01</b> 03C 129 717 C 	<b>X51579-01</b> 036 253 039 F  <b>X81385-01</b> 155 253 115 	<b>P77313-01 K →</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77329-01 N</b> 2x 036 103 085 A 27x42x8 A SL RD NBR

<sup>(38)</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN



VOLKSWAGEN						
Ltr.						
1,4 ANX APQ	40-44 kW (54-60 PS)	CADDY POLO	07/95-01/04	<b>D32705-00</b> 032 198 012 B <b>B32949-00</b>	<b>H50505-00</b> 030 103 383 AH 77,5 Ø MLS	<b>T50505-00</b> 032 103 384 (10x)
1,4 ARR	77 kW (105 PS)	LUPO FSI	02/01-07/05	<b>D36621-00</b> <b>B32957-00</b> 036 198 011	<b>H80140-00</b> 036 103 383 AM 77,5 Ø MLS	<b>T50943-00</b> 036 103 384 B (10x)
1,4 AXP	55 kW (75 PS)	BORA GOLF	08/97-06/06	<b>D36621-00</b> <b>B32957-00</b> 036 198 011	<b>H80140-00</b> 036 103 383 AM 77,5 Ø MLS	<b>T50943-00</b> 036 103 384 B (10x)
1,4 AXU	63 kW (86 PS)	POLO FSI	02/02-07/06	<b>S36776-00</b> <b>D36776-00</b>	<b>H80622-00</b> 03C 103 383 D 77,5 Ø MLS	<b>T50943-00</b> 036 103 384 B (10x)
1,4 BKG BLN	66 kW (90 PS)	GOLF FSI	10/03→	<b>S36776-00</b> <b>D36776-00</b>	<b>H80622-00</b> 03C 103 383 D 77,5 Ø MLS	<b>T50943-00</b> 036 103 384 B (10x)
1,4 BKR BLM	55-63 kW (75-86 PS)	FOX	04/05→	<b>D37167-00</b> <b>B37167-00</b>	<b>H80786-00</b> 032 103 383 N 77,7 Ø MLS	<b>T80786-00</b> WHT 001 865 (10x)

⑫ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

⑬ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53497-01</b> 030 103 483 K NBR	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>M37167-00</b> 030 198 717	<b>X51584-01</b> 032 253 039 E	<b>70-31414-10</b>	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77317-01 K →</b> 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>70-31414-10</b>	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X58997-01</b> 4x 036 129 717 E <b>X87493-01</b> 03C 129 717 C <b>X87494-01</b> ⑩ 036 129 717 K	<b>X51579-01</b> 036 253 039 F <b>X81385-01</b> 155 253 115	<b>70-31414-10</b>	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77350-01 K →</b> 030 103 171 K PTFE <b>P77329-01 N ←</b> 036 103 085 A 27x42x8 A SL RD NBR <b>P77342-01 N →</b> 036 103 085 F 35x46x7 A SL RD FPM
<b>70-31414-10</b>	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X58997-01</b> 4x 036 129 717 E	<b>X51579-01</b> 036 253 039 F	<b>70-31414-10</b>	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77350-01 K →</b> 030 103 171 K PTFE <b>P77329-01 N</b> 2x 036 103 085 A 27x42x8 A SL RD NBR
<b>70-31414-10</b>	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C <b>X89175-01</b> ⑩ 4x 03C 129 717 A	<b>X81446-01</b> 03C 253 039 D <b>X52978-01</b> 1J0 253 115 S	<b>70-31414-10</b>	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77351-01 K →</b> 030 103 171 L PTFE
<b>70-31414-10</b>	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C <b>X89175-01</b> ⑩ 4x 03C 129 717 A	<b>X81446-01</b> 03C 253 039 D <b>X52978-01</b> 1J0 253 115 S	<b>70-31414-10</b>	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77376-01 K →</b> 030 103 171 S PTFE
<b>70-31414-10</b>	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>X89552-01</b> 4x 030 129 717 E	<b>X51580-01</b> 030 253 039 H	<b>70-31414-10</b>	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77313-01 N</b> 036 103 085 H 32x42x6/7 A SL RD NBR

⑩ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN

VOLKSWAGEN						
Ltr.						
1,4 BLG CAVD	118-125 kW (160-170 PS)	BEETLE TSI EOS TSI GOLF TSI JETTA TSI SCIROCCO TSI TIGUAN TSI	11/05→	<b>S37091-00</b> <sup>(12)</sup> <sup>(13)</sup> <sup>(38)</sup>	<b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS 	<b>T80752-00</b> WHT 000 912 (10x) 
1,4 BMG CDDA	55-63 kW (75-85 PS)	POLO	06/09→	<b>S80752-00</b> <sup>(12)</sup> <sup>(13)</sup> <sup>(38)</sup>	<b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS 	<b>T59457-00</b> WHT 000 675 (10x) 
1,4 BMS BWB	51-59 kW (70-80 PS)	POLO TDI	04/05-11/09	<b>D37057-00</b> <sup>(12)</sup>  <b>B32959-00</b> <sup>(13)</sup> <sup>(38)</sup>	<b>H09198-00</b> 045 103 383 F 1,45 mm 1 MLS <b>H19198-10</b> 045 103 383 G 1,53 mm 2 MLS <b>H29198-20</b> 045 103 383 H 80,5 Ø 1,61 mm 3 MLS	<b>T09198-00</b> 038 103 384 (8x) 
1,4 BMY	103 kW (140 PS)	GOLF TSI JETTA TSI TOURAN TSI	02/06→	<b>S37091-00</b> <sup>(12)</sup> <sup>(13)</sup> <sup>(38)</sup>	<b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS 	<b>T80752-00</b> WHT 000 912 (10x) 
1,4 BNM BNV	51-59 kW (70-80 PS)	FOX TDI POLO TDI	04/05→	<b>D37013-00</b> <sup>(12)</sup>  <b>B32959-00</b> <sup>(13)</sup> <sup>(38)</sup>	<b>H09198-00</b> 045 103 383 F 1,45 mm 1 MLS <b>H19198-10</b> 045 103 383 G 1,53 mm 2 MLS <b>H29198-20</b> 045 103 383 H 80,5 Ø 1,61 mm 3 MLS	<b>T09198-00</b> 038 103 384 (8x) 

<sup>(12)</sup> junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	16x	<b>X87493-01</b> 03C 129 717 C <b>X89175-01</b> <sup>(10)</sup> 4x 03C 129 717 A 	<b>X81446-01</b> 03C 253 039 D 		<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	16x	<b>X82517-01</b> 03C 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM
<b>X83126-01</b> 045 103 483 E NBR 	<b>N92001-00</b> 027 109 675 (6x) <b>P76532-00</b> 027 109 675	6x	<b>X86491-01</b> 045 129 717 	<b>X81831-01</b> 045 253 039 B 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	16x	<b>X87493-01</b> 03C 129 717 C <b>X89175-01</b> <sup>(10)</sup> 4x 03C 129 717 A 	<b>X81446-01</b> 03C 253 039 D 		<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77479-01 K →</b> 036 103 171B PTFE → <i>BMY 033 816</i> →
<b>X83111-01</b> 045 103 483 C NBR 	<b>N92001-00</b> 027 109 675 (6x) <b>P76532-00</b> 027 109 675	6x	<b>X86491-01</b> 045 129 717 	<b>X52968-01</b> 045 253 039  <b>X52970-01</b> 1H0 253 115 A 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

<sup>(38)</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.						
1,4 BWK CAVA CAVE CKMA CMSB CNWA CNWB CTHA CTHB CTHC CTHD CTHE CTKA	90-132 kW (122-180 PS)	BEETLE TSI CC TSI EOS TSI GOLF TSI JETTA TSI PASSAT TSI POLO GTI SCIROCCO TSI SHARAN TSI TIGUAN TSI TOURAN TSI	09/07→	<b>S37091-00</b> <sup>12</sup> <sup>13</sup> <sup>38</sup>	<b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS 	<b>T80752-00</b> WHT 000 912 (10x) 
1,4 CAVB CAVC	103-125 kW (140-170 PS)	TOURAN TSI	02/06→	<b>S37091-00</b> <sup>12</sup> <sup>13</sup> <sup>38</sup>	<b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS 	<b>T80752-00</b> WHT 000 912 (10x) 
1,4 CAXA	90 kW (122 PS)	EOS TSI GOLF TSI JETTA TSI PASSAT TSI SCIROCCO TSI TIGUAN TSI	05/07→	<b>S37091-00</b> <sup>12</sup> <sup>13</sup> <sup>38</sup>	<b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS 	<b>T80752-00</b> WHT 000 912 (10x) 
1,4 CDGA	110 kW (150 PS)	PASSAT TSI TOURAN TSI	01/09→		<b>H40567-00</b> 06H 103 383 AC 83 Ø MLS 	<b>T80752-00</b> WHT 000 912 (10x) 
1,4 CGGA CGGB CMAA	59-63 kW (80-85 PS)	GOLF POLO	05/06→	<b>D36621-00</b> <sup>12</sup> <b>B32957-00</b> <sup>13</sup> <sup>38</sup> 036 198 011	<b>H80140-00</b> 036 103 383 AM 77,5 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 
1,4 CHPA CMBA CNLA CRJA	90-110 kW (122-150 PS)	GOLF TSI JETTA TSI	04/11→	<b>D38727-00</b> <sup>12</sup> <b>B38725-00</b> <sup>13</sup> <sup>38</sup>	<b>H40706-00</b> 04E 103 383 BJ 75 Ø MLS 	<b>T40706-00</b> WHT 004 926 (10x) 

[NEW]

[NEW]

<sup>12</sup> junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

<sup>38</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C <b>X89175-01</b> <sup>10</sup> 4x 03C 129 717 A 	<b>X81446-01</b> 03C 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77479-01 K</b> → 036 103 171B PTFE
	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C <b>X89175-01</b> <sup>10</sup> 4x 03C 129 717 A 	<b>X81446-01</b> 03C 253 039 D 		<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77479-01 K</b> → 036 103 171B PTFE
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C <b>X89175-01</b> <sup>10</sup> 4x 03C 129 717 A 	<b>X81446-01</b> 03C 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77479-01 K</b> → 036 103 171B PTFE CAXA 010 452→
<b>70-31414-10</b> 	<b>N93133-00</b> 036 109 675 A (8x) +03C 109 675 A (8x) <b>P76662-00</b> 036 109 675 <b>P76844-00</b> 03C 109 675 A	<b>X87493-01</b> 03C 129 717 C <b>X89175-01</b> <sup>10</sup> 4x 03C 129 717 A 	<b>X81446-01</b> 03C 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77479-01 K</b> → 036 103 171B PTFE
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X58997-01</b> 4x 036 129 717 E 	<b>X51579-01</b> 036 253 039 F 	<b>70-31414-10</b> 	<b>P77313-01 K</b> ← 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77479-01 K</b> → 036 103 171B PTFE <b>P77329-01 N</b> 2x 036 103 085 A 27x42x8 A SL RD NBR
<b>X59930-01</b> 04E 103 483 H 	<b>N93196-00</b> 04E 109 675 (8x) +04E 109 675 A (8x) <b>P76960-00</b> AS 8x 04E 109 675 A <b>P76961-00</b> ES 8x 04E 109 675	<b>X58997-01</b> 4x 036 129 717 E 	<b>X59925-01</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>P77841-01 K</b> ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77843-01 N</b> ← 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77844-01 N</b> → 04E 103 085 24x39x8 A SL LD PTFE

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска

ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска



VOLKSWAGEN

VOLKSWAGEN			
1.4 CLPA 63 kW (85 PS) POLO	06/09→		<p><b>S80752-00</b> ⑫ ⑬ ⑳</p> <p><b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS</p> <p><b>T59457-00</b> WHT 000 675 (10x)</p>
1.4 CPTA 103 kW (140 PS) GOLF TSI POLO TSI	10/12→		<p><b>D38727-01</b> ⑫ <b>B38725-00</b> ⑬ ⑳</p> <p><b>H40706-00</b> 04E 103 383 BJ 75 Ø MLS</p> <p><b>T40706-00</b> WHT 004 926 (10x)</p>
1.4 1W 35 kW (48 PS) POLO D	↔80 NW 500 000 08/90-09/94		<p><b>S31188-00</b> ⑫ ⑬ </p> <p><b>D31188-00</b> ⑫ 031 198 012 A</p> <p></p> <p><b>B30579-00</b> ⑬ 052 198 011 A</p> <p><b>H07907-00</b> 031 103 383 M 1,53 mm 1 </p> <p><b>H17907-10</b> 031 103 383 N 1,57 mm 2 </p> <p><b>H27907-20</b> 031 103 383 P 76,5 Ø 1,61 mm 3 </p> <p><b>T02673-00</b> 068 103 384 A (10x)</p>
1.4 1W 35 kW (48 PS) POLO D	↔80 PW 000 001→ 08/90-09/94		<p><b>S31187-00</b> ⑫ ⑬ </p> <p><b>D37026-00</b> ⑫ 031 198 012 C</p> <p></p> <p><b>B30579-00</b> ⑬ 052 198 011 A</p> <p><b>H07907-00</b> 031 103 383 M 1,53 mm 1 </p> <p><b>H17907-10</b> 031 103 383 N 1,57 mm 2 </p> <p><b>H27907-20</b> 031 103 383 P 76,5 Ø 1,61 mm 3 </p> <p><b>T02673-00</b> 068 103 384 A (10x)</p>
1.5 CK 37 kW (50 PS) GOLF D JETTA D PASSAT D	08/76-07/80		<p><b>S30435-00</b> ⑫ ⑬ 068 198 001</p> <p></p> <p><b>D30435-00</b> ⑫ 068 198 012 L</p> <p></p> <p><b>B30584-00</b> ⑬ 037 198 011 C</p> <p><b>H08038-00</b> 068 103 383 FB 1,4 mm 3 </p> <p><b>H18038-10</b> 068 103 383 FC 1,5 mm 4 </p> <p><b>H28038-20</b> 068 103 383 FD 78,5 Ø 1,6 mm 5 </p> <p><b>T02673-00</b> 068 103 384 A (10x)</p>

⑳ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	16x	<b>X58997-01</b> 036 129 717 E	4x	<b>X82517-01</b> 03C 253 039 E
<b>X59930-01</b> 04E 103 483 H	<b>N93196-00</b> 04E 109 675 (8x) +04E 109 675 A (8x) <b>P76960-00</b> AS 8x 04E 109 675 A <b>P76961-00</b> ES 8x 04E 109 675	8x	<b>X58997-01</b> 036 129 717 E	4x	<b>X59925-01</b> 04E 253 039 D
<b>V31187-00</b> 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	8x	<b>X58344-01</b> 030 129 717 D	2x	<b>X03743-01</b> 030 253 039 A
<b>V31187-00</b> 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	8x	<b>X58344-01</b> 030 129 717 D	2x	<b>X03743-01</b> 030 253 039 A
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	8x	<b>X04875-01</b> 026 129 717 D	4x	<b>X03747-01</b> 026 129 589 A
<b>V31265-00</b> 056 198 025 6,5 mm	<b>X55899-01</b> 068 129 717 E		<b>X07854-01</b> 841 253 115 B		<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

AS lado de escape / Auslaßseite / exhaust side / côté échappement / lato scarico / сторона выпуска  
ES lado de admisión / Einlaßseite / intake side / côté admission / lato aspirazione / сторона впуска





VOLKSWAGEN						
Ltr.						
1,5 FB FF FH FK YJ ZB ZC	48-63 kW (65-86 PS) GOLF PASSAT SCIROCCO	05/73→	<b>S30584-00</b> ⑫ ⑬ 056198001A <b>D30584-00</b> ⑫ 056198012 D <b>B30584-00</b> ⑬ 037198011 C	<b>H04128-00</b> 049103383 M 78,5 Ø 1,75 mm 	<b>T04125-00</b> 049103384 B (10x) 	
1,5 GH JB	51 kW (70 PS) CADDY GOLF JETTA SCIROCCO	08/77-02/84	<b>S30587-00</b> ⑫ ⑬ <b>D30587-00</b> ⑫ 049198012 H <b>B30584-00</b> ⑬ 037198011 C	<b>H04129-00</b> 049103383 K 81 Ø 1,75 mm 	<b>T04125-00</b> 049103384 B (10x) 	
1,5 H K L M	29-40 kW (40-54 PS) KAEFER KARMANN 1500 181	04/61→	<b>A30576-00</b> ⑭ 111198007 <b>D30252-00</b> ⑱ 113198101 A			
1,6 ABN EW EWA EZ EZA HM HN PN RE RF	51-55 kW (70-75 PS) CADDY GOLF JETTA PASSAT SCIROCCO	01/83→	<b>S31192-00</b> ⑫ ⑬ <b>D31192-00</b> ⑫ 026198012 AB <b>B30584-00</b> ⑬ 037198011 C	<b>H04843-00</b> 026103383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049103384 B (10x) 	

⑫ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус впускного коллектора



<b>V30584-00</b> 026198025 A 8,5 mm Kork 	<b>N90300-00</b> 026109675 (8x) <b>P76531-00</b> 026109675 8x 	<b>X04875-01</b> 026129717 D 	<b>X03747-01</b> 4x 026129589 A <b>X07854-01</b> ⚠ 841253115 B 	<b>E30584-00</b> 044103609 D +N 905927 02 (20x) 	<b>P76087-01 K ←</b> 068103085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068103051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068103085 E 32x47x10 A SL WD FPM
<b>V30584-00</b> 026198025 A 8,5 mm Kork 	<b>N90300-00</b> 026109675 (8x) <b>P76531-00</b> 026109675 8x 	<b>X04875-01</b> 026129717 D 	<b>X03747-01</b> 4x 026129589 A <b>X07854-01</b> ⚠ 841253115 B 		<b>P76087-01 K ←</b> 068103085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068103051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068103085 E 32x47x10 A SL WD FPM
<b>V31265-00</b> ✗ 056198025 6,5 mm 					
<b>X00991-01</b> 2x 113101481 F Kork 		<b>X00995-01</b> 2x 113129717 A 	<b>X03808-01</b> 4x 111251261 C 		<b>P76303-01 K →</b> 113105245 F 70x90x10 A LD ACM
		<b>X03811-01</b> 2x 311129707 			
<b>V30584-00</b> 026198025 A 8,5 mm Kork 	<b>N90300-00</b> 026109675 (8x) <b>P76531-00</b> 026109675 8x 	<b>X04875-01</b> 026129717 D 	<b>X03747-01</b> 4x 026129589 A <b>X07854-01</b> ⚠ 841253115 B <b>X07867-01</b> ⚠ 533253115 D 	<b>E30584-00</b> 044103609 D +N 905927 02 (20x) 	<b>P76087-01 K ←</b> 068103085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068103051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068103085 E 32x47x10 A SL WD FPM
<b>V53509-00</b> ✗ 026198025 C 6,5 mm Gummi 		<b>X55170-01</b> 026129717 F 	<b>X07853-01</b> ⑩ 035121171 C 		
<b>1 Dichtlippe</b> 					

⑭ sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала  
⑱ para una culata de cilindro / für einen Zylinderkopf / for one cylinder head / pour une culasse / per una testata / для головки блока цилиндров





VOLKSWAGEN						
Ltr.						
1,6 ABU 55 kW (75 PS) GOLF VENTO	09/92-09/98			<b>S32205-00</b> <sup>12</sup> <sup>13</sup> <b>D32205-00</b> <sup>12</sup> 032198012B <b>B32205-00</b> <sup>13</sup> 030 198 011	<b>H50442-00</b> 032 103 383 H 77 Ø 	<b>T50505-00</b> 032 103 384 (10x) 
1,6 AD AE AF AH AJ AK B P T U	07/64-09/92	KAEFER KARMANN TRANSPORTER 1500		<b>A30576-00</b> <sup>14</sup> 111 198 007 <b>D30252-00</b> <sup>18</sup> 113 198 101 A		
1,6 ADK CY JK JP JR 068.A 068.D	04/82→	CADDY D GOLF D GOLF TD INDUSTRIEMOT. JETTA D JETTA TD PASSAT TD		<b>S30435-00</b> <sup>12</sup> <sup>13</sup> 068 198 001  <b>D30435-00</b> <sup>12</sup> 068 198 012 L  <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H02673-00</b> 068 103 383 FE 1,4 mm 1 <sup>1</sup> →07/85 <b>H12673-10</b> 068 103 383 FF 1,5 mm 2 <sup>1</sup> →07/85 <b>H22673-20</b> 068 103 383 FG 78 Ø 1,6 mm 3 <sup>1</sup> →07/85  <b>H02674-00</b> 068 103 383 EH 1,6 mm 1 <sup>1</sup> 08/85→ <b>H12674-10</b> 068 103 383 EJ 1,65 mm 2 <sup>1</sup> 08/85→ <b>H22674-20</b> 068 103 383 EK 78 Ø 1,7 mm 3 <sup>1</sup> 08/85→ 	<b>T02673-00</b> 068 103 384 A (10x) 

<sup>14</sup> sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала

<b>V31187-00</b>  <b>X07908-01</b> 030 103 483 G NBR  <b>X07909-01</b> 3x NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X57506-01</b> 032 129 717 C 	<b>X51584-01</b> 032 253 039 E 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X00991-01</b> 2x 113 101 481 F Kork 		<b>X00995-01</b> 2x 113 129 717 A  <b>X03811-01</b> 2x 311 129 707 	<b>X03808-01</b> 4x 111 251 261 C 		<b>P76303-01 K →</b> 113 105 245 F 70x90x10 A LD ACM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> 026 198 025 C 6,5 mm Gummi 1 Dichtlippe	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X04875-01</b> 026 129 717 D  <b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 4x 026 129 589 A  <b>X07854-01</b> 841 253 115 B  <b>X51157-01</b> 433 253 115 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

<sup>18</sup> para una culata de cilindro / für einen Zylinderkopf / for one cylinder head / pour une culasse / per una testata / для головки блока цилиндров



VOLKSWAGEN						
Ltr.			<b>1</b>			
1,6 ADP	74 kW (101 PS) PASSAT	10/96-11/00	<b>S32242-00</b> ⑫ ⑬ <b>D32242-00</b> ⑫ 050 198 012 B <b>B32242-00</b> ⑬ 050 198 011	<b>H50475-00</b> 050 103 383 82,5 Ø MLS 	<b>T50469-00</b> 050 103 384 (10x) 	
1,6 AEA	55 kW (75 PS) GOLF POLO VENTO	09/92-10/99	<b>D32713-00</b> ⑫ 032 198 012 A <b>B30579-00</b> ⑬ 052 198 011 A	<b>H50505-00</b> 030 103 383 AH 77,5 Ø MLS 	<b>T50505-00</b> 032 103 384 (10x) 	
1,6 AEE	55 kW (75 PS) CADDY GOLF POLO VENTO	09/92-09/01	<b>D32705-00</b> ⑫ 032 198 012 B <b>B32705-00</b> ⑬ 030 198 011 A → AEE 562 757 <b>B32949-00</b> ⑬ ⑮ → AEE 567 758→	<b>H50505-00</b> 030 103 383 AH 77,5 Ø MLS 	<b>T50505-00</b> 032 103 384 (10x) 	
1,6 AEH AKL	74 kW (100-101 PS) BORA GOLF POLO	12/95-05/05	<b>S32239-00</b> ⑫ ⑬ <b>D32239-00</b> ⑫ 06A 198 012 <b>B32239-00</b> ⑬ ⑮ 06A 198 011	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	
1,6 AEK AFT AKS	74 kW (100-101 PS) GOLF PASSAT POLO VENTO	07/94-06/02	<b>D32952-00</b> ⑫ 037 198 012 K <b>B32952-00</b> ⑬ 051 198 011 C	<b>H50475-00</b> 050 103 383 82,5 Ø MLS 	<b>T50469-00</b> 050 103 384 (10x) 	

⑫ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора  
 ⑮ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 037 129 717 C 8x 	<b>X51641-01</b> <b>X51156-01</b> 443 253 115 A 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57506-01</b> 032 129 717 C 8x 	<b>X51584-01</b> 032 253 039 E 	<b>X03370-01</b> 032 103 609 B  <b>70-31414-10</b> 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>M37167-00</b> 030 198 717 8x 	<b>X51584-01</b> 032 253 039 E 	<b>70-31414-10</b> 	<b>P77313-01 K</b> ← 036 103 085 H 32x42x6/7 A SL RD NBR <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AEE 562 757 <b>P77317-01 K</b> → 028 103 171 B PTFE → AEE 562 758→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57666-01</b> 4x 06A 133 398 F 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K</b> → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 037 129 717 C 8x  <b>X51712-01</b> ⑩ 037 129 717 D 	<b>X51638-01</b> 037 253 039 D  <b>X07867-01</b> 533 253 115 D 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

⑩ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.			<b>1</b>			
1,6 AFX BHJ	64-74 kW (87-101 PS)			<b>D37197-00</b> <sup>12</sup> <b>B37196-00</b> <sup>13 35</sup>	<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 
1,6 AHL ANA ARM	74 kW (101 PS) PASSAT	10/96-11/00		<b>D36630-00</b> <sup>12</sup> <b>B32936-00</b> <sup>13 35</sup>	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
1,6 AHS	55 kW (75 PS) POLO	10/94-10/99		<b>D32705-00</b> <sup>12</sup> 032 198 012 B <b>B32705-00</b> <sup>13</sup> 030 198 011 A → AHS 050 001 <b>B32949-00</b> <sup>13 35</sup> → AHS 050 000→	<b>H50505-00</b> 030 103 383 AH 77,5 Ø MLS 	<b>T50505-00</b> 032 103 384 (10x) 
1,6 AJV ATN AUS	77-88 kW (105-120 PS) BORA GOLF POLO GTI → 6N X 048 817, 6N X 104 315→	09/98-06/06		<b>D37021-00</b> <sup>12</sup> <b>B32957-00</b> <sup>13 35</sup> 036 198 011	<b>H80344-00</b> 036 103 383 AN 77 Ø MLS 	<b>T80344-00</b> 036 103 384 E (10x) 

<sup>12</sup> junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора  
<sup>35</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55430-01</b> 048 129 717 A  <b>X57668-01</b> 037 129 717 C  <b>X51712-01</b> <sup>10</sup> 037 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P77317-01 K</b> → 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 037 129 717 C  <b>X87424-01</b> 06B 129 717 A 4x 	<b>X03747-01</b> 026 129 589 A 4x  <b>X51169-01</b> 431 253 115 A 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K</b> → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>M37167-00</b> 030 198 717 	<b>X51584-01</b> 032 253 039 E 	<b>70-31414-10</b> 	<b>P77313-01 K</b> ← 036 103 085 H 32x42x6/7 A SL RD NBR <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AHS 050 000 <b>P77317-01 K</b> → 028 103 171 B PTFE → AHS 050 000→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87612-01</b> 036 129 717 G 	<b>X51579-01</b> 036 253 039 F 	<b>70-31414-10</b> 	<b>P77313-01 K</b> ← 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77350-01 K</b> → 030 103 171 K PTFE <b>P77329-01 N</b> 2x 036 103 085 A 27x42x8 A SL RD NBR

<sup>35</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN

VOLKSWAGEN						
Ltr.						
1,6 ALM	55 kW (75 PS)	POLO	11/95-09/01	<b>D32705-00</b> (12) 032 198 012 B <b>B32705-00</b> (13) 030 198 011 A →ALM 000 706 <b>B32949-00</b> (13) (35) →ALM 000 707→	<b>H50505-00</b> 030 103 383 AH 77,5 Ø MLS 	<b>T50505-00</b> 032 103 384 (10x) 
1,6 ALZ	75 kW (102 PS)	PASSAT	11/00-05/05	<b>D36631-00</b> (12) <b>B32936-00</b> (13) (35)	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
1,6 APF AUR AWH	74 kW (100-101 PS)	BORA GOLF NEW BEETLE POLO	12/95-05/05	<b>D36632-00</b> (12) <b>B32936-00</b> (13) (35)	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
1,6 ARC AVY	92 kW (125 PS)	LUPO GTI POLO GTI	10/99-07/05	<b>D36650-00</b> (12) <b>B32957-00</b> (13) (38) 036 198 011	<b>H80344-00</b> 036 103 383 AN 77 Ø MLS 	<b>T80344-00</b> 036 103 384 E (10x) 
1,6 AS CT CZ	34-37 kW (46-50 PS)	KAEFER TRANSPORTER	08/68→	<b>A30576-00</b> (14) 111 198 007 <b>S37028-00</b> (13) <b>D30252-00</b> (18) 113 198 101 A		

(12) sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала  
 (13) para una culata de cilindro / für einen Zylinderkopf / for one cylinder head / pour une culasse / per una testata / для головки блока цилиндров



<b>X53497-01</b> 030 103 483 K NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>M37167-00</b> 030 198 717 	<b>X51584-01</b> 032 253 039 E 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM →ALM 000 706 <b>P77317-01 K →</b> (35) 028 103 171 B PTFE →ALM 000 707→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X83001-01</b> 06B 103 483 L NBR 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675 8x	<b>X87424-01</b> 4x 06B 129 717 A 	<b>X03747-01</b> 4x 026 129 589 A 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K →</b> (35) 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53263-01</b> 051 103 483 A ACM 2 Dichtlippen 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X57666-01</b> 4x 06A 133 398 F 	<b>X52965-01</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K →</b> (35) 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X87612-01</b> 036 129 717 G 	<b>X51579-01</b> 036 253 039 F  <b>X81385-01</b> 155 253 115 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77350-01 K →</b> (35) 030 103 171 K PTFE <b>P77329-01 N ←</b> 036 103 085 A 27x42x8 A SL RD NBR <b>P77342-01 N →</b> 036 103 085 F 35x46x7 A SL RD FPM
<b>X00991-01</b> 2x 113 101 481 F Kork 		<b>X00995-01</b> 2x 113 129 717 A  <b>X03811-01</b> 2x 311 129 707 	<b>X03808-01</b> 4x 111 251 261 C 		<b>P76303-01 K →</b> 113 105 245 F 70x90x10 A LD ACM

(35) contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала  
 (38) sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
1,6	AVU AYD BFQ BFS CCSA CHGA CMXA	75 kW (102 PS) BORA GOLF GOLF BiFuel JETTA NEW BEETLE	06/00→	<b>D36633-00</b> ⑫ <b>B32936-00</b> ⑬ ⑳	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
1,6	AZD BCB	77 kW (105 PS) BORA GOLF	02/00-06/06	<b>D37022-00</b> ⑫ <b>B32957-00</b> ⑬ ⑳ 036 198 011	<b>H80344-00</b> 036 103 383 AN 77 Ø MLS 	<b>T80344-00</b> 036 103 384 E (10x) 
1,6	BAD	81 kW (110 PS) BORA FSI GOLF FSI	01/02-06/06	<b>D36705-00</b> ⑫ <b>B36705-00</b> ⑬ ⑳	<b>H80344-00</b> 036 103 383 AN 77 Ø MLS 	<b>T80344-00</b> 036 103 384 E (10x) 
1,6	BAG BLF BLP	85 kW (115 PS) GOLF FSI TOURAN FSI	02/03-07/08 ↔ →1K 4 600 000 ↔ →1T 4 270 000	<b>S36776-00</b> ⑫ ⑬ ⑳ <b>D36776-00</b> ⑫	<b>H80622-00</b> 03C 103 383 D 77,5 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 
1,6	BAG BLF BLP	85 kW (115 PS) GOLF FSI JETTA FSI PASSAT FSI TOURAN FSI	02/03-10/10 ↔ 1K 4 600 001→ ↔ 1T 4 270 001→	<b>S36776-00</b> ⑫ ⑬ ⑳ <b>D36776-00</b> ⑫	<b>H80622-00</b> 03C 103 383 D 77,5 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 
1,6	BAH BJA BLH BPA CCRA CFZA	74 kW (101 PS) FOX GOLF POLO VOYAGE	02/01→	<b>D37167-00</b> ⑫ <b>B37167-00</b> ⑬ ⑳	<b>H80786-00</b> 032 103 383 N 77,7 Ø MLS 	<b>T80786-00</b> WHT 001 865 (10x) 

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

⑳ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X83001-01</b> 06B 103 483 L NBR 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>X57666-01</b> 06A 133 398 F 8x 	4x <b>X52965-01</b> 06A 253 039 L <b>X07867-01</b> 533 253 115 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K →</b> 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X58997-01</b> 036 129 717 E 16x 	4x <b>X51579-01</b> 036 253 039 F 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77351-01 K →</b> 030 103 171 L PTFE <b>P77329-01 N</b> 2x 036 103 085 A 27x42x8 A SL RD NBR
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C 16x <b>X87494-01</b> ⑩ 036 129 717 K 	<b>X51579-01</b> 036 253 039 F 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77351-01 K →</b> 030 103 171 L PTFE <b>P77329-01 N ←</b> 036 103 085 A 27x42x8 A SL RD NBR <b>P77342-01 N →</b> 036 103 085 F 35x46x7 A SL RD FPM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C 16x <b>X89175-01</b> ⑩ 4x 03C 129 717 A 	<b>X81446-01</b> 03C 253 039 D <b>X52978-01</b> 1J0 253 115 S 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77350-01 K →</b> 030 103 171 K PTFE
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C 16x <b>X89175-01</b> ⑩ 4x 03C 129 717 A 	<b>X81446-01</b> 03C 253 039 D <b>X52978-01</b> 1J0 253 115 S 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77376-01 K →</b> 030 103 171 S PTFE
<b>70-31414-10</b> 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>M37167-00</b> 030 198 717 8x 	<b>X51580-01</b> 030 253 039 H 	<b>70-31414-10</b> 	<b>P77313-01 K ←</b> 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77313-01 N</b> 036 103 085 H 32x42x6/7 A SL RD NBR

⑳ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач





VOLKSWAGEN					
1,6 BCD		POLO	01/04→		
				<b>H80447-00</b> 06A 103 383 AE MLS	<b>T50474-00</b> 06A 103 384 C (10x)
1,6 BGV BSE BSF	75 kW (102 PS)	CADDY GOLF JETTA PASSAT TOURAN	07/03→		
				<b>D36633-00</b> <sup>12</sup> <b>B36706-00</b> <sup>13 35</sup>	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS
1,6 BJF BJY BWV UNF UPD	67-73 kW (91-99 PS)	GOL	06/02→		
				<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS	
1,6 BJH	75 kW (102 PS)	BORA GOLF	08/00-06/05		
				<b>H80447-00</b> 06A 103 383 AE MLS	<b>T50474-00</b> 06A 103 384 C (10x)
1,6 BMH CDE CDF CLRA	74-77 kW (101-105 PS)	JETTA	12/11→		
				<b>S80752-00</b> <sup>12 13 38</sup>	<b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS
1,6 BRY	74 kW (101 PS)	CADDY	03/05→		
				<b>H80447-00</b> 06A 103 383 AE MLS	<b>T50474-00</b> 06A 103 384 C (10x)

<sup>12</sup> junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора

<sup>35</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X83001-01</b> 06B 103 483 L NBR	<b>N92991-00</b> 036 109 675 (8x) <b>P76661-00</b> 046 109 675 A	<b>X57666-01</b> 06A 133 398 F	<b>X52965-01</b> 06A 253 039 L	<b>70-31414-10</b>	<b>P77183-01 K</b> →
	8x				06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83001-01</b> 06B 103 483 L NBR	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>X57666-01</b> 06A 133 398 F	<b>X52965-01</b> 06A 253 039 L	<b>70-31414-10</b>	<b>P76096-11 K</b> ←
	8x				038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77352-01 K</b> →
<b>X59501-01</b> 026 103 483 2	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55899-01</b> 068 129 717 E	<b>X03747-01</b> 026 129 589 A	<b>70-31414-10</b>	<b>P76087-01 K</b> ←
	8x				068 103 085 E 32x47x10 A SL WD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X83001-01</b> 06B 103 483 L NBR	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>X57666-01</b> 06A 133 398 F	<b>X51947-01</b> 037 253 039	<b>70-31414-10</b>	<b>P76096-11 K</b> ←
	8x				038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K</b> →
<b>70-31414-10</b>	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675		<b>X82517-01</b> 03C 253 039 E	<b>70-31414-10</b>	<b>P76096-11 K</b> ←
	16x				038 103 085 E 35x48x10 A SL RD PTFE ACM
<b>X83001-01</b> 06B 103 483 L NBR	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>X57666-01</b> 06A 133 398 F	<b>X51947-01</b> 037 253 039 <b>X52965-01</b> 06A 253 039 L	<b>70-31414-10</b>	<b>P76096-11 K</b> ←
	8x				038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K</b> →
					06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

<sup>38</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN							
1,6	BTS	77 kW (105 PS)	POLO	05/06-11/09	<b>S37014-00</b> <sup>(12)</sup> <sup>(13)</sup> <sup>(38)</sup>	<b>H80622-00</b> 03C 103 383 D 77,5 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 
1,6	BWH	74 kW (101 PS)				<b>H80447-00</b> 06A 103 383 AE MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
1,6	CAYA CAYB CAYC CAYD CAYE CLNA	55-77 kW (75-105 PS)	CADDY TDI GOLF TDI JETTA TDI PASSAT TDI POLO TDI TOURAN TDI	02/09→	<b>D38310-00</b> <sup>(12)</sup>  10/09→ <b>B38300-00</b> <sup>(13)</sup> <sup>(35)</sup>	<b>H40582-00</b> 03L 103 383 J 80,5 Ø 1,55 mm 1 MLS <b>H40582-10</b> 03L 103 383 K 80,5 Ø 1,63 mm 2 MLS <b>H40582-20</b> 03L 103 383 L 80,5 Ø 1,71 mm 3 MLS 	<b>T50034-00</b> WHT 002 131 (10x) 
1,6	CAYC	77 kW (105 PS)	BEETLE TDI BEETLE TSI TOURAN TDI	05/10→	<b>D38310-00</b> <sup>(12)</sup>  <b>B38300-00</b> <sup>(13)</sup> <sup>(35)</sup>	<b>H40582-00</b> 03L 103 383 J 80,5 Ø 1,55 mm 1 MLS <b>H40582-10</b> 03L 103 383 K 80,5 Ø 1,63 mm 2 MLS <b>H40582-20</b> 03L 103 383 L 80,5 Ø 1,71 mm 3 MLS 	<b>T50034-00</b> WHT 002 131 (10x) 

<sup>(35)</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X58997-01</b> 036 129 717 E 4x 	<b>X81446-01</b> 03C 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM
<b>X83001-01</b> 06B 103 483 L NBR 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675 8x	<b>X57666-01</b> 06A 133 398 F 4x 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>V59484-01</b> 03L 103 483 H +03L 103 070 A (4x) 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X59477-01</b> 03L 129 717 J 4x 	<b>X59496-01</b> 03L 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77689-01 K →</b> 03L 103 171 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM 10/09→ <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM 10/09→
<b>V59500-00</b> 03L 103 483 C +03L 103 070 (4x) 		<b>X59479-01</b> 03L 129 717 H 4x 			
<b>X59484-01</b> 03L 103 483 H 					
<b>X59500-01</b> 03L 103 483 C 					
<b>V59484-01</b> 03L 103 483 H +03L 103 070 A (4x) 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X59477-01</b> 03L 129 717 J 4x 	<b>X59496-01</b> 03L 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77689-01 K →</b> 03L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
<b>V59500-00</b> 03L 103 483 C +03L 103 070 (4x) 		<b>X59479-01</b> 03L 129 717 H 4x 			
<b>X59484-01</b> 03L 103 483 H 					
<b>X59500-01</b> 03L 103 483 C 					

<sup>(38)</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.						
1,6 CFNA CFNB CNKA <b>[NEW]</b>	60-77 kW (82-105 PS) POLO	05/10→	<b>S37014-00</b> <sup>12</sup> <sup>13</sup> <sup>38</sup>	<b>H80622-00</b> 03C 103 383 D 77,5 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 	
1,6 CLHA CLHB CRKB <b>[NEW]</b>	66-81 kW (90-110 PS) GOLF TDI	11/12→	<b>D38750-00</b> <sup>12</sup>  	<b>H40700-00</b> 04L 103 383 C 80,5 Ø 1,55 mm 1 MLS <b>H40700-10</b> 04L 103 383 D 80,5 Ø 1,63 mm 2 MLS <b>H40700-20</b> 04L 103 383 E 80,5 Ø 1,71 mm 3 MLS 	<b>T40709-00</b> WHT 005 673 (10x) 	
1,6 CLSA	77 kW (105 PS) POLO	05/10→	<b>S80752-00</b> <sup>12</sup> <sup>13</sup> <sup>38</sup>	<b>H80752-00</b> 03C 103 383 R 77,5 Ø MLS 	<b>T59457-00</b> WHT 000 675 (10x) 	
1,6 CMR	72 kW (98 PS)			<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	

<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X58997-01</b> 036 129 717 E 4x 	<b>X81446-01</b> 03C 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77479-01 K →</b> 036 103 171B PTFE
<b>V59933-00</b> 03L 103 483 S +04L 103 070 (4x)  <b>X59933-01</b> 03L 103 483 S 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X59929-01</b> 04L 129 717 B 	<b>X59927-01</b> 04L 253 039 B 	<b>70-31414-10</b> 	<b>P77831-01 K →</b> 04L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X58997-01</b> 036 129 717 E 4x 	<b>X82517-01</b> 03C 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77479-01 K →</b> 036 103 171B PTFE
<b>X59498-01</b> 051 103 483 D  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x		<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

<sup>38</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.						
1,6 CR	02/79-03/88	40 kW (54 PS) PASSAT D	<p><b>S30435-00</b> ⑫ ⑬ 068 198 001 </p> <p><b>D30435-00</b> ⑫ 068 198 012 L </p> <p><b>B30584-00</b> ⑬ 037 198 011 C</p>	<p><b>H02633-00</b> 068 103 383 ES 1,5 mm 1  → CR 176 338 <b>H12633-10</b> 068 103 383 ET 1,6 mm 2  → CR 176 338 <b>H22633-20</b> 068 103 383 FA 78 Ø 1,7 mm 3  → CR 176 338</p> <p><b>H02673-00</b> 068 103 383 FE 1,4 mm 1  → CR 176 339 <b>H12673-10</b> 068 103 383 FF 1,5 mm 2  → CR 176 339 <b>H22673-20</b> 068 103 383 FG 78 Ø 1,6 mm 3  → CR 176 339</p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p>	
1,6 CS	01/81-07/87	37 kW (50 PS) TRANSPORTER	<p><b>S30435-00</b> ⑫ ⑬ 068 198 001 </p> <p><b>D30435-00</b> ⑫ 068 198 012 L </p> <p><b>B30584-00</b> ⑬ 037 198 011 C</p>	<p><b>H02633-00</b> 068 103 383 ES 1,5 mm 1  → 000 338 <b>H12633-10</b> 068 103 383 ET 1,6 mm 2  → 000 338 <b>H22633-20</b> 068 103 383 FA 78 Ø 1,7 mm 3  → 000 338</p> <p><b>H03675-00</b> 068 103 383 FE 1,6 mm 1  → 000 339 <b>H13675-10</b> 068 103 383 FF 1,65 mm 2  → 000 339 <b>H23675-20</b> 068 103 383 FG 78 Ø 1,7 mm 3  → 000 339</p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p>	



<b>V30584-00</b> 026 198 025 A 8,5 mm Kork	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 	<b>X03747-01</b> 026 129 589 A <b>X07854-01</b> 841 253 115 B 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 	<b>X03747-01</b> 026 129 589 A <b>X07854-01</b> 841 253 115 B 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) → 000339 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN						
Ltr.						
1,6 DT DTA JU PP RL	51-55 kW (69-75 PS) PASSAT SANTANA	08/80→	<b>S31446-00</b> ⑫ ⑬ <b>D31446-00</b> ⑫ 050 198 012 A <b>B30584-00</b> ⑬ 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	
1,6 EG EM FN FP FR FS FT FV WP WV WY YH YK YN YP YS YU YY	48-81 kW (65-110 PS) CADDY GOLF GOLF GTI JETTA PASSAT SANTANA SCIROCCO	08/75→	<b>S30587-00</b> ⑫ ⑬ <b>D30587-00</b> ⑫ 049 198 012 H <b>B30584-00</b> ⑬ 037 198 011 C	<b>H04129-00</b> 049 103 383 K 81 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	
1,6 JX	51 kW (69-70 PS) TRANSPORTER	08/84-07/92	<b>S30435-00</b> ⑫ ⑬ 068 198 001  <b>D30435-00</b> ⑫ 068 198 012 L  <b>B30584-00</b> ⑬ 037 198 011 C	<b>H03675-00</b> 068 103 383 FE 1,6 mm 1 <b>H13675-10</b> 068 103 383 FF 1,65 mm 2 <b>H23675-20</b> 068 103 383 FG 78 Ø 1,7 mm 3 	<b>T02673-00</b> 068 103 384 A (10x) 	
1,6 ME 068.C	40 kW (54-55 PS) CADDY D GOLF D INDUSTRIEMOT. JETTA D	08/82→	<b>S30435-00</b> ⑫ ⑬ 068 198 001  <b>D30435-00</b> ⑫ 068 198 012 L  <b>B30584-00</b> ⑬ 037 198 011 C	<b>H02674-00</b> 068 103 383 EH 1,6 mm 1 <b>H12674-10</b> 068 103 383 EJ 1,65 mm 2 <b>H22674-20</b> 068 103 383 EK 78 Ø 1,7 mm 3 	<b>T02673-00</b> 068 103 384 A (10x) 	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X04875-01</b> 026 129 717 D  <b>X55170-01</b> 026 129 717 F  <b>X07853-01</b> ⑩ 035 121 171 C 	<b>X03747-01</b> 026 129 589 A 4x  <b>X07854-01</b> △ 841 253 115 B  <b>X51156-01</b> △ 443 253 115 A 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> ✗ 056 198 025 6,5 mm 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X04875-01</b> 026 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x  <b>X07854-01</b> △ 841 253 115 B 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 026 129 589 A 4x 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X04875-01</b> 026 129 717 D  <b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 026 129 589 A 4x  <b>X07854-01</b> △ 841 253 115 B  <b>X51157-01</b> △ 433 253 115 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM





VOLKSWAGEN											
Ltr.											
1,6 MF RA SB 1V	44-59 kW (60-80 PS) GOLF TD JETTA TD PASSAT TD	08/83-09/93	<b>S30435-00</b> 068 198 001  <b>D30435-00</b> 068 198 012 L  <b>B30584-00</b> 037 198 011 C	<b>H02674-00</b> 068 103 383 EH 1,6 mm 1 <b>H12674-10</b> 068 103 383 EJ 1,65 mm 2 <b>H22674-20</b> 068 103 383 EK 78 Ø 1,7 mm 3 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> 026 198 025 C 6,5 mm Gummi 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D  <b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 026 129 589 A 4x 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,6 068.5	INDUSTRIEMOT.		<b>D30435-00</b> 068 198 012 L  <b>B30584-00</b> 037 198 011 C	<b>H02633-00</b> 068 103 383 ES 1,5 mm 1 → 08999 <b>H12633-10</b> 068 103 383 ET 1,6 mm 2 → 08999 <b>H22633-20</b> 068 103 383 FA 78 Ø 1,7 mm 3 → 08999  <b>H02673-00</b> 068 103 383 FE 1,4 mm 1 09000 → → 26300 <b>H12673-10</b> 068 103 383 FF 1,5 mm 2 09000 → → 26300 <b>H22673-20</b> 068 103 383 FG 78 Ø 1,6 mm 3 09000 → → 26300  <b>H02674-00</b> 068 103 383 EH 1,6 mm 1 26301 → <b>H12674-10</b> 068 103 383 EJ 1,65 mm 2 26301 → <b>H22674-20</b> 068 103 383 EK 78 Ø 1,7 mm 3 26301 → 	<b>T02673-00</b> 068 103 384 A (10x) 09000 → 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> 056 198 025 6,5 mm 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X04116-01</b> 026 103 609 D 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

VOLKSWAGEN						
Ltr.						
1,6 1F	53-55 kW (72-75 PS) CADDY PASSAT POLO	02/88-09/97	<b>D36400-00</b> ⑫ 051 198 012 D <b>B32952-00</b> ⑬ 051 198 011 C	<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 	
1,6 124 126			<b>D30252-00</b> ⑱ 113 198 101 A			
1,7 AHB	42 kW (57 PS) CADDY SDI	07/96-09/00	<b>D32721-00</b> ⑫ 028 198 012 F  <b>B32231-00</b> ⑬ 028 198 011 D → AHB 005 000  <b>B37015-00</b> ⑬ ⑳ → AHB 005 001 → 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	
1,7 AHG	42 kW (57 PS) POLO SDI	04/97-10/99	<b>D32721-00</b> ⑫ 028 198 012 F  <b>B32231-00</b> ⑬ 028 198 011 D → AHG 010 000  <b>B37015-00</b> ⑬ ⑳ → AHG 010 001 → 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	

⑱ para una culata de cilindro / für einen Zylinderkopf / for one cylinder head / pour une culasse / per una testata / для головки блока цилиндров



<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X86528-01</b> 048 129 717 D 	<b>X51947-01</b> 037 253 039 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>X00991-01</b> 2x 113 101 481 F Kork 		<b>X03808-01</b> 4x 111 251 261 C 		
<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A  <b>X81385-01</b> X ⚠ 155 253 115 	<b>X54624-01</b> 044 103 609 D ACM  <b>70-31414-10</b> 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → AHB 005 000 <b>P77317-01 K →</b> ⚠ 028 103 171 B PTFE → AHB 005 001 → <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A  <b>X81385-01</b> X ⚠ 155 253 115 	<b>X54624-01</b> 044 103 609 D ACM  <b>70-31414-10</b> 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → AHG 010 000 <b>P77317-01 K →</b> ⚠ 028 103 171 B PTFE → AHG 010 001 → <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

⑳ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



VOLKSWAGEN						
Ltr.						
1,7 AKU	44 kW (60 PS) Lupo SDI POLO SDI	08/97-07/05	<b>D32721-00</b> 028 198 012 F  <b>B32231-00</b> 028 198 011 D → AKU 013 000  <b>B37015-00</b> → AKU 013 001→ 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	
1,7 AKW	42 kW (57 PS) POLO SDI	07/97-09/01	<b>D32721-00</b> 028 198 012 F 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	
1,7 CA CB CD CE V W Z	46-59 kW (62-80 PS) TRANSPORTER 411,412 412	07/68→	<b>S37029-00</b> 021 198 009 D 	<b>H80722-00</b> 021101343 90 Ø 0,7 mm 	4x	
1,7 KY	42 kW (57 PS) TRANSPORTER	08/85-07/92	<b>S30435-00</b> 068 198 001  <b>D30435-00</b> 068 198 012 L  <b>B30584-00</b> 037 198 011 C 	<b>H02393-00</b> 033 103 383 K 1,53 mm 1 <b>H12393-10</b> 033 103 383 L 1,57 mm 2 <b>H22393-20</b> 033 103 383 M 81 Ø 1,61 mm 3 	<b>T02673-00</b> 068 103 384 A (10x) 	

Ⓢ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x <b>X81385-01</b> 155 253 115 	<b>X54624-01</b> 044 103 609 D ACM  <b>70-31414-10</b> 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → AKU 013 000 <b>P77317-01 K →</b> 028 103 171 B PTFE → AKU 013 001→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x <b>X81385-01</b> 155 253 115 	<b>X54361-01</b> 037 115 220 B NBR  <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53150-01</b> 021 101 481 Kork 	2x	<b>X89183-01</b> 021 129 707 D 	4x <b>X81944-01</b> 021 256 251 A  <b>X81354-01</b> 025 251 261 	2x	<b>P76152-01 K ←</b> 021 105 247 A 42x62x10 A SL RD FPM <b>P76325-01 K →</b> 029 105 245 B 75x95x10/9,5 A LD FPM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> 026 198 025 C 6,5 mm Gummi 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x 	<b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 026 129 589 A 4x 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN														
1,7	WL YX	55 kW (75 PS)	ILTIS		03/79-12/88	<b>D30587-00</b> 049 198 012 H	<b>H04129-00</b> 049 103 383 K 81 Ø 1,75 mm	<b>T04132-00</b> 049 103 385 (10x)	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D	<b>X03747-01</b> 026 129 589 A	<b>X04116-01</b> 026 103 609 D	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,8	AAM	55 kW (75 PS)	GOLF PASSAT VENTO		08/90-06/02	<b>S31640-00</b> (12) (13) <b>D36400-00</b> (12) 051 198 012 D → AAM 408 198→ <b>D31640-00</b> (12) 051 198 012 B <b>B32952-00</b> (13) 051 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm → AAM 408 197	<b>T04125-00</b> 049 103 384 B (10x) → AAM 408 197	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork	<b>N90300-00</b> 026 109 675 (8x) → AAM 408 197 <b>N91190-00</b> 027 109 675 (8x) → AAM 408 198→ <b>P76531-00</b> 026 109 675 → AAM 408 197 <b>P76532-00</b> 027 109 675 → AAM 408 198→	<b>X04875-01</b> 026 129 717 D → AAM 408 197	<b>X03747-01</b> 4x 026 129 589 A <b>X51947-01</b> 037 253 039	<b>X54624-01</b> 044 103 609 D ACM	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,8	AAM	55 kW (75 PS)	GOLF PASSAT VENTO		08/90-06/02	<b>D36400-00</b> (12) 051 198 012 D → AAM 408 198→ <b>B32952-00</b> (13) 051 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm → AAM 408 197	<b>T04125-00</b> 049 103 384 B (10x) → AAM 408 197	<b>X53263-01</b> 051 103 483 A ACM	<b>N90300-00</b> 026 109 675 (8x) → AAM 408 197 <b>N91190-00</b> 027 109 675 (8x) → AAM 408 198→ <b>P76531-00</b> 026 109 675 → AAM 408 197 <b>P76532-00</b> 027 109 675 → AAM 408 198→	<b>X04875-01</b> 026 129 717 D → AAM 408 197	<b>X03747-01</b> 4x 026 129 589 A <b>X51947-01</b> 037 253 039	<b>X54624-01</b> 044 103 609 D ACM	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,8	ABS	66 kW (90 PS)	GOLF PASSAT VENTO		02/88-04/99	<b>S31640-00</b> (12) (13) <b>D36400-00</b> (12) 051 198 012 D → ABS 935 646→ <b>D31640-00</b> (12) 051 198 012 B <b>B32952-00</b> (13) 051 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm → ABS 935 645	<b>T04125-00</b> 049 103 384 B (10x) → ABS 935 645	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork	<b>N90300-00</b> 026 109 675 (8x) → ABS 935 645 <b>N91190-00</b> 027 109 675 (8x) → ABS 935 646→ <b>P76531-00</b> 026 109 675 → ABS 935 645 <b>P76532-00</b> 027 109 675 → ABS 935 646→	<b>X04875-01</b> 026 129 717 D → ABS 935 645	<b>X03747-01</b> 4x 026 129 589 A <b>X51947-01</b> 037 253 039	<b>X54624-01</b> 044 103 609 D ACM	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM





VOLKSWAGEN							
Ltr.							
1,8 ABS	66 kW (90 PS) GOLF	02/88-04/99	1H P 490 001, 1H PB 140 001, 1H PW 490 001→ 31 P 160 001→ 1H P 490 001, 1H PB 140 001, 1H PW 490 001→	<b>D36400-00</b> (12) 051 198 012 D → ABS 935 646→ <b>B32952-00</b> (13) 051 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm → ABS 935 645  <b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS → ABS 935 646→ 	<b>T04125-00</b> 049 103 384 B (10x) → ABS 935 645  <b>T50469-00</b> 050 103 384 (10x) → ABS 935 646→ 	
1,8 ACC	66 kW (90 PS) GOLF	11/91-08/97		<b>D36400-00</b> (12) 051 198 012 D <b>B32952-00</b> (13) 051 198 011 C	<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 	
1,8 ADD	66 kW (90 PS) POLO	01/97-09/01		<b>D37023-00</b> (12) <b>B32233-00</b> (13) 037 198 011 G <b>B37023-00</b> (13) (35)	<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 	
1,8 ADF	INDUSTRIEMOT.				<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm → ADF 001 080  <b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS → ADF 001 081→ 	<b>T04125-00</b> 049 103 384 B (10x) → ADF 001 080  <b>T50469-00</b> 050 103 384 (10x) → ADF 001 081→ 	

(35) contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N90300-00</b> 026 109 675 (8x) → ABS 935 645 <b>N91190-00</b> 027 109 675 (8x) → ABS 935 646→ <b>P76531-00</b> 026 109 675 → ABS 935 645 <b>P76532-00</b> 027 109 675 → ABS 935 646→	<b>X04875-01</b> 026 129 717 D → ABS 935 645  <b>X86528-01</b> 048 129 717 D → ABS 935 646→ 	<b>X03747-01</b> 026 129 589 A  <b>X51947-01</b> 037 253 039 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X86528-01</b> 048 129 717 D 	<b>X51947-01</b> 037 253 039 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55170-01</b> 026 129 717 F 	<b>X03747-01</b> 026 129 589 A  <b>X07867-01</b> 533 253 115 D 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P77317-01</b> K → 028 103 171 B PTFE <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N90300-00</b> 026 109 675 (8x) → ADF 005 795 <b>N91190-00</b> 027 109 675 (8x) → ADF 005 796→ <b>P76531-00</b> 026 109 675 → ADF 005 795 <b>P76532-00</b> 027 109 675 → ADF 005 796→	<b>X04875-01</b> 026 129 717 D 	<b>X03747-01</b> 026 129 589 A 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM





VOLKSWAGEN						
Ltr.						
1,8 ADR AEB AFY ATW	85-110 kW (115-150 PS) PASSAT PASSAT T	10/96→		<b>S32232-00</b> ⑫ ⑬ <b>D32232-00</b> ⑫ 058 198 012 +058 198 025 A <b>B32232-00</b> ⑬ 058 198 011 <b>B37030-00</b> ⑬ ⑳ 	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T10468-00</b> 058 103 385 B (10x) 
1,8 ADZ	66 kW (90 PS) GOLF PASSAT POLO VENTO	02/88-06/02		<b>D31640-00</b> ⑫ 051 198 012 B →ADZ 011 565 <b>D36400-00</b> ⑫ 051 198 012 D →ADZ 011 566→ <b>B32952-00</b> ⑬ 051 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm →ADZ 011 565  <b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS →ADZ 011 566→ 	<b>T04125-00</b> 049 103 384 B (10x) →ADZ 011 565  <b>T50469-00</b> 050 103 384 (10x) →ADZ 011 566→ 
1,8 AFE	72 kW (98 PS) SANTANA	01/95→		<b>B30584-00</b> ⑬ 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 
1,8 AFV	82 kW (111 PS)			<b>D37197-00</b> ⑫ <b>B37196-00</b> ⑬ ⑳	<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X57659-01</b> 058 129 717 B 	<b>X51632-01</b> 058 253 039 L 	<b>X54226-01</b> 058 103 609 Aluminium  <b>70-31414-10</b> 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P77317-01 K</b> → 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM 	<b>N90300-00</b> 026 109 675 (8x) →ADZ 011 565 <b>N91190-00</b> 027 109 675 (8x) →ADZ 011 566→ <b>P76531-00</b> 026 109 675 →ADZ 011 565 <b>P76532-00</b> 027 109 675 →ADZ 011 566→	<b>X04875-01</b> 026 129 717 D →ADZ 011 565  <b>X86528-01</b> 048 129 717 D →ADZ 011 566→  <b>X07853-01</b> ⑩ 035 121 171 C →ADZ 011 565 	<b>X51947-01</b> 037 253 039 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X55626-01</b> 048 129 717 A 	<b>X03747-01</b> 026 129 589 A 4x 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X55430-01</b> 048 129 717 A  <b>X57668-01</b> 037 129 717 C  <b>X51712-01</b> ⑩ 037 129 717 D 	<b>X51947-01</b> 037 253 039 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P77317-01 K</b> → 028 103 171 B PTFE

⑳ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



VOLKSWAGEN							
Ltr.							
1,8 AGN	92 kW (125 PS)	BORA GOLF	08/97-06/06	<b>D36707-00</b> <b>B32934-00</b> 06A 198 011 A <b>Z36190-00</b> 058 198 217	⑫ ⑬ ⑳ ⑧	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T80109-00</b> 06A 103 385 C (10x) →AGN 107 000  <b>T50468-00</b> 06A 103 385 A (10x) →AGN 107 001→ 
1,8 AGU AJH APH AQA ARX ARZ AUM AUQ AVC AWC AWD AWM AWP AWT AWU AWV AWW BAE BBU BJX BKF BNU	110-132 kW (150-180 PS)	BORA BORA T GOLF T NEW BEETLE T PASSAT T POLO GTI SHARAN T	08/97→	<b>D32934-00</b> <b>B32934-00</b> 06A 198 011 A <b>Z36190-00</b> 058 198 217	⑫ ⑬ ⑳ ⑧	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 
1,8 AN AP AT	50-63 kW (68-86 PS)	TRANSPORTER 411,412 412	07/73-07/75	<b>A31438-00</b> 029 198 009 A 	⑭	<b>H51289-00</b> 051101341A 93 Ø 	4x 
1,8 ANB APT APU ARG	92-110 kW (125-150 PS)	PASSAT PASSAT T	10/96-03/05	<b>D32232-00</b> 058 198 012 +058 198 025 A <b>B37030-00</b>  <b>Z36190-00</b> 058 198 217	⑫ ⑬ ⑳ ⑧	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T10468-00</b> 058 103 385 B (10x) 
1,8 ANN ANP	55-66 kW (75-90 PS)	GOLF	07/93-06/02	<b>D36400-00</b> 051 198 012 D <b>B37023-00</b>	⑫ ⑬ ⑳	<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 

⑫ junta para tensor cadena de distribución / Dichtung Steuerkettenspanner / gasket timing chain tensioner / joint tendeur de chaîne / guarnizione tendicatena di distribuzione / прокладка натяжителя цепи привода распределительного вала  
 ⑬ sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала



<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675	<b>X88304-01</b> 06A 133 398 D	4x	<b>X51632-01</b> 058 253 039 L 	<b>70-31414-10</b> 
<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675	<b>X57659-01</b> 058 129 717 B 	20x	<b>X51632-01</b> 058 253 039 L 	<b>70-31414-10</b> 
<b>X53150-01</b> 021 101 481 Kork 		<b>X55893-01</b> 021 129 707 E 	2x	<b>X51285-01</b> 039 256 251 	<b>P76152-01 K ←</b> 021 105 247 A 42x62x10 A SL RD FPM
<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675	<b>X57659-01</b> 058 129 717 B 	20x	<b>X51632-01</b> 058 253 039 L 	<b>X54226-01</b> 058 103 609 Aluminium 
<b>X53263-01</b> 051 103 483 A ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X86528-01</b> 048 129 717 D 	8x	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 
<b>X53263-01</b> 051 103 483 A ACM 		<b>X86528-01</b> 048 129 717 D 	8x	<b>X51638-01</b> 037 253 039 D 	<b>X54624-01</b> 044 103 609 D ACM 
					<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P77317-01 K →</b> 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
					<b>P76087-01 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
					<b>P76087-01 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

⑳ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала  
 ㉑ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
1.8 ANQ	92 kW (125 PS)			<b>D32934-00</b> ⑫ <b>B32934-00</b> ⑬ ⑳ 06A 198 011 A <b>Z36190-00</b> ⑧ 058 198 217	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 
1.8 AWL BPL	110 kW (150 PS) PASSAT T	11/00→		<b>D32934-00</b> ⑫ <b>B32934-00</b> ⑬ ⑳ 06A 198 011 A <b>Z36190-00</b> ⑧ 058 198 217	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 
1.8 BGC CED	110-120 kW (150-163 PS)				<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 
1.8 BHG BNY BSL UDH	67-73 kW (91-99 PS) PARATI	01/05→			<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	
1.8 BKT BKU	74 kW (101 PS)				<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
1.8 BSA	74 kW (101 PS)				<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 
1.8 BYJ	118 kW (160 PS)				<b>H80727-00</b> 06H 103 383 Q 82,5 Ø MLS 	<b>T80727-00</b> 06D 103 385 D (10x) 

⑫ junta para tensor cadena de distribución / Dichtung Steuerkettenspanner / gasket timing chain tensioner / joint tendeur de chaîne / guarnizione tendicatena di distribuzione / прокладка натяжителя цепи привода распределительного вала



<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x 	<b>X57659-01</b> 058 129 717 B 	<b>X51632-01</b> 058 253 039 L <b>X07867-01</b> 533 253 115 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01 N</b> 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x 	<b>X57659-01</b> 058 129 717 B 	<b>X51632-01</b> 058 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01 N</b> 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x 	<b>X57659-01</b> 058 129 717 B 	<b>X51632-01</b> 058 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> ⑳ 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X59501-01</b> 026 103 483 2 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x 	<b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 026 129 589 A 4x 	<b>70-31414-10</b> 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X59498-01</b> 051 103 483 D <b>2 Dichtlippen</b> 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x 		<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> ⑳ 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X59498-01</b> 051 103 483 D <b>2 Dichtlippen</b> 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x 	<b>X55430-01</b> 048 129 717 A 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77745-01 K →</b> ⑳ 030 103 171 Q PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x 	<b>X89272-01</b> 06J 129 717 	<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K ←</b> 06H 103 383 G 45x60x8 AB SL RD FPM

⑳ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.						
1,8 BZB	118 kW (160 PS) PASSAT TSI	05/07-10/11	<b>D40567-00</b> (12) <b>B38289-00</b> (13 35)	<b>H40567-00</b> 06H 103 383 AC 83 Ø MLS 	<b>T80727-00</b> 06D 103 385 D (10x) 	
1,8 CDA CDAB CGYA	112-118 kW (152-160 PS) CC TSI GOLF TSI PASSAT TSI SHARAN TSI	05/07→	<b>D40567-00</b> (12) <b>B38289-00</b> (13 35)	<b>H40567-00</b> 06H 103 383 AC 83 Ø MLS 	<b>T40708-00</b> WHT 005 305 (10x)  <b>T80727-00</b> 06D 103 385 D (10x) 	
1,8 CEA	118 kW (160 PS)		<b>D40567-00</b> (12) <b>B38289-00</b> (13 35)	<b>H40567-00</b> 06H 103 383 AC 83 Ø MLS 	<b>T80727-00</b> 06D 103 385 D (10x) 	
1,8 DS DX EV EX GU GX GZ HT HV JH JJ KT PB PF RD RG RH RM RP RV 1P 2H	62-82 kW (84-112 PS) CADDY GOLF GTI JETTA PASSAT SANTANA SCIROCCO SCIROCCO GTI	08/82→	<b>S31192-00</b> (12 13) <b>D31192-00</b> (12) 026 198 012 AB <b>B30584-00</b> (13) 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	
1,8 DZ	82 kW (112 PS) PASSAT	12/83-03/88	<b>S31448-00</b> (12 13) <b>D31448-00</b> (12) 026 198 012 AD <b>B30584-00</b> (13) 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	

(12) junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора






















<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	16x <b>X89272-01</b> 06J 129 717 	<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K ←</b> 06H 103 383 G 45x60x8 AB SL RD FPM <b>P77754-01 K →</b> 06H 103 171 F 85x132/152x15,7 PTFE
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	16x <b>X89272-01</b> 06J 129 717  <b>X89273-01</b> 06F 129 717 D 	<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K ←</b> 06H 103 383 G 45x60x8 AB SL RD FPM <b>P77754-01 K →</b> 06H 103 171 F 85x132/152x15,7 PTFE
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	16x <b>X89272-01</b> 06J 129 717  <b>X89273-01</b> 06F 129 717 D 	<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K ←</b> 06H 103 383 G 45x60x8 AB SL RD FPM <b>P77754-01 K →</b> 06H 103 171 F 85x132/152x15,7 PTFE
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	8x <b>X04875-01</b> 026 129 717 D  <b>X55170-01</b> 026 129 717 F  <b>X07853-01</b> (10) 035 121 171 C 	4x <b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> 841 253 115 B  <b>X07867-01</b> 533 253 115 D  <b>X51169-01</b> 431 253 115 A 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	8x <b>X04875-01</b> 026 129 717 D  <b>X55170-01</b> 026 129 717 F 	4x <b>X03747-01</b> 026 129 589 A  <b>X51169-01</b> 431 253 115 A 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

(35) contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала





VOLKSWAGEN															
1,8 JN	66 kW (90 PS)	PASSAT	01/83-03/88	<b>S31443-00</b> ⑫ ⑬ <b>D31443-00</b> ⑫ <b>B30584-00</b> ⑬ 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm	<b>T04125-00</b> 049 103 384 B (10x)								<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
1,8 KR PL	95-102 kW (129-140 PS)	CORRADO GOLF GTI JETTA PASSAT SCIROCCO	10/85-09/93	<b>S31196-00</b> ⑫ ⑬ <b>D31196-00</b> ⑫ <b>B30584-00</b> ⑬ 027 198 012 K 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm	<b>T04843-00</b> 027 103 385 C (10x)				<b>N91190-00</b> 2x <b>P76532-00</b> 16x 027 109 675 (8x) 027 109 675	<b>X07866-01</b> 037 129 717 F <b>X07865-01</b> ⑩ 027 129 717 D	<b>X07855-01</b> 4x 027 129 589 A <b>X07867-01</b> 533 253 115 D	<b>X54624-01</b> 044 103 609 D ACM	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
1,8 PD	49 kW (67 PS)	TRANSPORTER	12/90-07/92	<b>S31643-00</b> ⑫ ⑬ <b>D31643-00</b> ⑫ <b>B31643-00</b> ⑬ 044 198 012 044 198 011 A	<b>H50155-00</b> 044 103 383 D 82,7 Ø	<b>T04132-00</b> 049 103 385 (10x)				<b>N90300-00</b> 8x 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D <b>X55430-01</b> 048 129 717 A	<b>X03747-01</b> 4x 026 129 589 A	<b>X54624-01</b> 044 103 609 D ACM	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
1,8 PG	118 kW (160 PS)	CORRADO G60 GOLF G60 PASSAT G60	08/88-05/97	<b>D32717-00</b> ⑫ 037 198 012 D <b>B32717-00</b> ⑬ 037 198 011 D	<b>H50154-00</b> 037 103 383 L 82,5 Ø MLS	<b>T04125-00</b> 049 103 384 B (10x)				<b>N90300-00</b> 8x 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D <b>X58032-01</b>	<b>X03747-01</b> 4x 026 129 589 A <b>X51641-01</b> <b>X07867-01</b> 533 253 115 D	<b>X54624-01</b> 044 103 609 D ACM	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
1,8 026.2		INDUSTRIEMOT.			<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm	<b>T04125-00</b> 049 103 384 B (10x)				<b>N90300-00</b> 8x 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D	<b>X03747-01</b> 4x 026 129 589 A	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора





VOLKSWAGEN																		
Ltr.																		
1,8 049.6	INDUSTRIEMOT.	1		<b>D30587-00</b> ⑫ 049 198 012 H <b>B30584-00</b> ⑬ 037 198 011 C	<b>H04129-00</b> 049 103 383 K 81 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 8x 026 109 675 	<b>X04875-01</b> 026 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM						
1,9 AAZ	55 kW (75 PS)	GOLF TD PASSAT TD VENTO TD	03/91-04/99	<b>S31598-00</b> ⑫ ⑬ →AAZ 678 000  <b>D31598-00</b> ⑫ 028 198 012 B →AAZ 678 000  <b>D32719-00</b> ⑫ 028 198 012 E →AAZ 678 001→  <b>B31598-00</b> ⑬ 028 198 011 B 	<b>H02390-00</b> 028 103 383 BB 1,6 mm 1 →AAZ 462 614 <b>H12390-10</b> 028 103 383 BC 1,65 mm 2 →AAZ 462 614 <b>H22390-20</b> 028 103 383 BD 81 Ø 1,7 mm 3 →AAZ 462 614  <b>H02391-00</b> 028 103 383 BH 1,53 mm 1 MLS →AAZ 462 615→ <b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 MLS →AAZ 462 615→ <b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 MLS →AAZ 462 615→ 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V31598-00</b> 028 198 025  <b>X53152-01</b> 028 103 483 B ACM 	<b>N90300-00</b> 026 109 675 (8x) →AAZ 678 000 <b>N91190-00</b> 027 109 675 (8x) →AAZ 678 001→ <b>P76531-00</b> 8x 026 109 675 →AAZ 678 000 <b>P76532-00</b> 8x 027 109 675 →AAZ 678 001→	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A 	<b>X54361-01</b> 037 115 220 B NBR 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM						
1,9 ABL	50 kW (68 PS)	TRANSPORTER	10/92-04/03	<b>S31598-00</b> ⑫ ⑬  <b>D31598-00</b> ⑫ 028 198 012 B →ABL 076 000  <b>B31598-00</b> ⑬ 028 198 011 B 	<b>H02391-00</b> 028 103 383 BH 1,53 mm 1 MLS <b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 MLS <b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V31598-00</b> 028 198 025 	<b>N90300-00</b> 026 109 675 (8x) →ABL 076 000 <b>N91190-00</b> 027 109 675 (8x) →ABL 076 001→ <b>P76531-00</b> 8x 026 109 675 →ABL 076 000 <b>P76532-00</b> 027 109 675 →ABL 076 001→	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A 	<b>X54361-01</b> 037 115 220 B NBR →ABL 070 000  <b>X04116-01</b> 026 103 609 D →ABL 070 001→ →ABL 076 000 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM						



VOLKSWAGEN						
1,9 ADE		INDUSTRIEMOT.	1	<p><b>D32718-00</b> ⑫ 028 198 012 D → ADE 003 235 </p> <p><b>D32719-00</b> ⑫ 028 198 012 E → ADE 003 236→ </p> <p><b>B32231-00</b> ⑬ 028 198 011 D → ADE 004 200 </p> <p><b>B32239-00</b> ⑬ ⑳ 06A 198 011 → ADE 004 201→ </p>	<p><b>H02391-00</b> 028 103 383 BH 1,53 mm 1 </p> <p><b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 </p> <p><b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 </p> <p>MLS</p>	<p><b>T02673-00</b> 068 103 384 A (10x) </p>
1,9 ADG		INDUSTRIEMOT.		<p><b>D32719-00</b> ⑫ 028 198 012 E </p> <p><b>B32231-00</b> ⑬ 028 198 011 D → ADG 019 500 </p> <p><b>B32239-00</b> ⑬ ⑳ 06A 198 011 → ADG 019 501→ </p>	<p><b>H02391-00</b> 028 103 383 BH 1,53 mm 1 </p> <p><b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 </p> <p><b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 </p> <p>MLS</p>	<p><b>T02673-00</b> 068 103 384 A (10x) </p>
1,9 AEF	47 kW (64 PS)	CADDY D POLO D	10/94-09/01	<p><b>D32718-00</b> ⑫ 028 198 012 D → AEF 007 000 </p> <p><b>D32719-00</b> ⑫ 028 198 012 E → AEF 007 001→ </p> <p><b>B32231-00</b> ⑬ 028 198 011 D → AEF265 000 </p> <p><b>B32239-00</b> ⑬ ⑳ 06A 198 011 → AEF265 001→ </p>	<p><b>H02391-00</b> 028 103 383 BH 1,53 mm 1 </p> <p><b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 </p> <p><b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 </p> <p>MLS</p>	<p><b>T02673-00</b> 068 103 384 A (10x) </p>

⑳ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



<p><b>V31598-00</b> 028 198 025 </p>	<p><b>N90300-00</b> 026 109 675 (8x) → ADE 003 235 <b>N91190-00</b> 027 109 675 (8x) → ADE 003 236→ <b>P76531-00</b> 8x 026 109 675 → ADE 003 235 <b>P76532-00</b> 8x 027 109 675 → ADE 003 236→ </p>	<p><b>X55431-01</b> 028 129 717 D </p>	<p><b>X03747-01</b> 4x 026 129 589 A </p> <p><b>X51641-01</b> </p>	<p><b>X54361-01</b> ✗ 037 115 220 B NBR </p> <p><b>X54624-01</b> ✗ 044 103 609 D ACM </p>	<p><b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → ADE 004 200 <b>P77317-01 K</b> → </p> <p>028 103 171 B PTFE → ADE 004 201→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
<p><b>V31598-00</b> 028 198 025 </p>	<p><b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 8x 027 109 675 </p>	<p><b>X55431-01</b> 028 129 717 D </p>	<p><b>X03747-01</b> 4x 026 129 589 A </p> <p><b>X51641-01</b> </p>	<p><b>X54361-01</b> ✗ 037 115 220 B NBR </p> <p><b>X54624-01</b> ✗ 044 103 609 D ACM </p>	<p><b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → ADG 019 500 <b>P77317-01 K</b> → </p> <p>028 103 171 B PTFE → ADG 019 501→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
<p><b>V31598-00</b> 028 198 025 </p>	<p><b>N90300-00</b> 026 109 675 (8x) → AEF 007 0000 <b>N91190-00</b> 027 109 675 (8x) → AEF 007 001→ <b>P76531-00</b> 8x 026 109 675 → AEF007 0000 <b>P76532-00</b> 8x 027 109 675 → AEF 007 001→ </p>	<p><b>X55431-01</b> 028 129 717 D </p>	<p><b>X03747-01</b> 4x 026 129 589 A </p> <p><b>X51641-01</b> </p>	<p><b>X54361-01</b> ✗ 037 115 220 B NBR </p> <p><b>X54624-01</b> ✗ 044 103 609 D ACM </p>	<p><b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AEF265 000 <b>P77317-01 K</b> → </p> <p>028 103 171 B PTFE → AEF 265 001→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>



VOLKSWAGEN						
Ltr.						
1,9 AEY	47 kW (64 PS) CADDY SDI GOLF SDI POLO SDI VENTO SDI	07/95-01/04	<b>D32721-00</b> ⑫ 028 198 012 F  <b>B32231-00</b> ⑬ 028 198 011 D → AEY 050 000  <b>B37015-00</b> ⑬ ⑳ → AEY 050 001→ 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	
1,9 AFD	58 kW (79 PS)		<b>D32721-00</b> ⑫ 028 198 012 F  <b>B32231-00</b> ⑬ 028 198 011 D → AFD 000 999  <b>B37015-00</b> ⑬ ⑳ → AFD 001 000→ 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	
1,9 AFN	81 kW (110 PS) GOLF TDI PASSAT TDI POLO TDI SHARAN TDI VENTO TDI	03/96-06/02	<b>D32231-00</b> ⑫ 028 198 012 C → AFN 002 000  <b>D32721-00</b> ⑫ 028 198 012 F → AFN 002 001→  <b>B32231-00</b> ⑬ 028 198 011 D → AFN 576 000  <b>B37015-00</b> ⑬ ⑳ → AFN 576 001→ 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	

⑳ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → AEY 050 000 <b>P77317-01 K →</b> 028 103 171 B PTFE → AEY 050 001→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x 	<b>X54624-01</b> 044 103 609 D ACM  <b>70-31414-10</b> 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → AFD 000 999 <b>P77317-01 K →</b> 028 103 171 B PTFE → AFD 001 000→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N90300-00</b> 026 109 675 (8x) → AFN 002 000 <b>N91190-00</b> 027 109 675 (8x) → AFN 002 001→ <b>P76531-00</b> 026 109 675 → AFN 002 000 <b>P76532-00</b> 027 109 675 → AFN 002 001→ 8x 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x  <b>X52970-01</b> 1H0 253 115 A 	<b>X54361-01</b> 037 115 220 B NBR  <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → AFN 576 000 <b>P77317-01 K →</b> 028 103 171 B PTFE → AFN 576 001→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN						
Ltr.						
1,9 AGD	47 kW (64 PS)	POLO SDI	07/96-09/01	<b>D32721-00</b> <sup>(12)</sup> 028 198 012 F  <b>B32231-00</b> <sup>(13)</sup> 028 198 011 D → AGD 015 000  <b>B37015-00</b> <sup>(13) (35)</sup> → AGD 015 001→ 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 
1,9 AGP	50 kW (68 PS)	BORA SDI GOLF SDI POLO SDI	08/97-06/06	<b>S32241-00</b> <sup>(12) (13)</sup>  <b>D32241-00</b> <sup>(12)</sup> 038 198 012   <b>B32241-00</b> <sup>(13) (38)</sup> 038 198 011 	<b>H06033-00</b> 038 103 383 G 1,45 mm 1 MLS → AGP 028 000 <b>H16033-10</b> 038 103 383 F 1,53 mm 2 MLS → AGP 028 000 <b>H26033-20</b> 038 103 383 E 80,5 Ø 1,61 mm 3 MLS → AGP 028 000  <b>H03518-00</b> 038 103 383 AL 1,47 mm 1 MLS → AGP 028 001→ <b>H13518-10</b> 038 103 383 AM 1,57 mm 2 MLS → AGP 028 001→ <b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 MLS → AGP 028 001→ 	<b>T02673-00</b> 068 103 384 A (10x) 

<sup>(35)</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x <b>X81385-01</b> 155 253 115 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → AGD 015 000 <b>P77317-01 K →</b> 028 103 171 B PTFE → AGD 015 001→ <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x <b>X51706-01</b> 3A0 253 115  <b>X52970-01</b> <sup>(38)</sup> 1H0 253 115 A 	<b>70-31414-10</b> 	<b>P76096-01 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

<sup>(38)</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач





VOLKSWAGEN						
Ltr.						
1,9 AGR	66 kW (90 PS) BORA TDI GOLF TDI POLO TDI	09/96-05/06	<b>S32241-00</b> <sup>(12)</sup> <sup>(13)</sup>  <b>D32241-00</b> <sup>(12)</sup> 038 198 012  <b>B32241-00</b> <sup>(13)</sup> <sup>(38)</sup> 038 198 011 	<b>H06033-00</b> 038 103 383 G 1,45 mm 1 MLS → AGR 151 000 <b>H16033-10</b> 038 103 383 F 1,53 mm 2 MLS → AGR 151 000 <b>H26033-20</b> 038 103 383 E 80,5 Ø 1,61 mm 3 MLS → AGR 151 000  <b>H03518-00</b> 038 103 383 AL 1,47 mm 1 MLS → AGR 151 001→ <b>H13518-10</b> 038 103 383 AM 1,57 mm 2 MLS → AGR 151 001→ <b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 MLS → AGR 151 001→ 	<b>T02673-00</b> 068 103 384 A (10x) 	

<sup>(38)</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач

<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A <b>X51706-01</b> 3A0 253 115  <b>X52970-01</b> 1H0 253 115 A 	4x <b>70-31414-10</b> 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77183-01 K</b> → 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	



VOLKSWAGEN						
Ltr.						
1,9 AHF	81 kW (110 PS) BORA TDI GOLF TDI	08/97-05/04	<b>S32241-00</b> 038 198 012  <b>D32241-00</b> 038 198 012  <b>B32241-00</b> 038 198 011 	<b>H06033-00</b> 038 103 383 G 1,45 mm 1 MLS → AHF 140 000 <b>H16033-10</b> 038 103 383 F 1,53 mm 2 MLS → AHF 140 000 <b>H26033-20</b> 038 103 383 E 80,5 Ø 1,61 mm 3 MLS → AHF 140 000  <b>H03518-00</b> 038 103 383 AL 1,47 mm 1 MLS → AHF 140 001→ <b>H13518-10</b> 038 103 383 AM 1,57 mm 2 MLS → AHF 140 001→ <b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 MLS → AHF 140 001→ 	<b>T02673-00</b> 068 103 384 A (10x) 	
1,9 AHH ASX AVG	47-81 kW (64-110 PS) GOLF TDI PASSAT TDI POLO SDI SHARAN TDI	09/96-06/02	<b>D32721-00</b> 028 198 012 F  <b>B37015-00</b> 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	

③⑤ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A  <b>X51706-01</b> 3A0 253 115  <b>X52970-01</b> 1H0 253 115 A 	4x <b>70-31414-10</b> 	<b>P76096-01 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 	4x <b>X03747-01</b> 026 129 589 A 	<b>X54624-01</b> 044 103 609 D ACM  <b>70-31414-10</b> 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P77317-01 K →</b> 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

③⑥ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN

VOLKSWAGEN						
1.9 AHU	66-67 kW (90-91 PS)	CADDY TDI GOLF TDI PASSAT TDI POLO TDI SHARAN TDI VENTO TDI	09/93-03/10	<b>S32721-00</b> (12) (13)  <b>D32721-00</b> (12)  <b>B32231-00</b> (13)  028 198 011 D → AHU 390 000  <b>B37015-00</b> (13) (35) → AHU 390 001 → 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 
1.9 AJM ANU ASZ ATD ATJ AUY AVB AVF AWX AXB AXC AXR BEW BLT BPZ BSW BTB BVK	63-110 kW (85-150 PS)	BORA TDI GOLF TDI MULTIVAN TDI NEW BEETLE TDI PASSAT TDI POLO TDI SHARAN TDI TRANSPORTER	09/95 →	<b>D32937-00</b> (12)  <b>B32937-00</b> (13) (35) 	<b>H09538-00</b> 038 103 383 DE 80,5 Ø 1,45 mm 1 MLS <b>H19538-10</b> 038 103 383 DF 80,5 Ø 1,53 mm 2 MLS <b>H29538-20</b> 038 103 383 DG 80,5 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 
1.9 ALE	66 kW (90 PS)	CADDY TDI GOLF TDI POLO TDI VENTO TDI	09/93-01/04	<b>D32721-00</b> (12)  028 198 012 F <b>B32231-00</b> (13) 028 198 011 D → ALE 576 000  <b>B37015-00</b> (13) (35) → ALE 576 001 → 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 

(35) contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → AHU 390 000 <b>P77317-01 K →</b> 028 103 171 B PTFE → AHU 390 001 → <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53715-01</b> 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A  <b>X51638-01</b> 037 253 039 D  <b>X51706-01</b> 3A0 253 115  <b>X52970-01</b> X 1H0 253 115 A 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A  <b>X52970-01</b> X 1H0 253 115 A 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K ←</b> 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM → ALE 576 000 <b>P77317-01 K →</b> 028 103 171 B PTFE → ALE 576 001 → <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN					
Ltr.					
1,9 ALH	66 kW (90 PS) BORA TDI CADDY TDI GOLF TDI NEW BEETLE TDI POLO TDI	09/96-05/06			
			<p><b>S32241-00</b> ⑫ ⑬ 038 198 012</p> <p></p> <p><b>D32241-00</b> ⑫ 038 198 012</p> <p></p> <p><b>B32241-00</b> ⑬ ⑳ 038 198 011</p> <p></p>	<p><b>H06033-00</b> 038 103 383 G 1,45 mm 1 </p> <p>→ALH 085 000</p> <p><b>H16033-10</b> 038 103 383 F 1,53 mm 2 </p> <p>→ALH 085 000</p> <p><b>H26033-20</b> 038 103 383 E 80,5 ∅ 1,61 mm 3 </p> <p>→ALH 085 000</p> <p></p> <p><b>H03518-00</b> 038 103 383 AL 1,47 mm 1 </p> <p>MLS</p> <p>→ALH 085 001→</p> <p><b>H13518-10</b> 038 103 383 AM 1,57 mm 2 </p> <p>MLS</p> <p>→ALH 085 001→</p> <p><b>H23518-20</b> 038 103 383 AN 80,5 ∅ 1,67 mm 3 </p> <p>MLS</p> <p>→ALH 085 001→</p> <p></p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p> <p></p>
1,9 ANC	44 kW (60 PS)		<p><b>D32241-00</b> ⑫ 038 198 012</p> <p></p> <p></p> <p><b>B32959-00</b> ⑬ ⑳</p>	<p><b>H03518-00</b> 038 103 383 AL 1,47 mm 1 </p> <p>MLS</p> <p><b>H13518-10</b> 038 103 383 AM 1,57 mm 2 </p> <p>MLS</p> <p><b>H23518-20</b> 038 103 383 AN 80,5 ∅ 1,67 mm 3 </p> <p>MLS</p> <p></p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p> <p></p>

⑳ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



	<p><b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675</p>	<p><b>X55431-01</b> 028 129 717 D 8x</p> <p></p>	<p><b>X03747-01</b> 026 129 589 A 4x</p> <p></p> <p><b>X51706-01</b> 3A0 253 115</p> <p></p> <p><b>X52970-01</b> 1H0 253 115 A</p> <p></p>	<p><b>70-31414-10</b> 4x</p> <p></p>	<p><b>P76096-01 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
	<p><b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675</p>	<p><b>X55431-01</b> 028 129 717 D 8x</p> <p></p>	<p><b>X03747-01</b> 026 129 589 A 4x</p> <p></p>	<p><b>70-31414-10</b> 4x</p> <p></p>	<p><b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>



VOLKSWAGEN



VOLKSWAGEN						
Ltr.						
1,9 AQM AYQ	47-50 kW (64-68 PS) BORA SDI CADDY SDI GOLF SDI POLO SDI	11/95-06/06	 <b>D37016-00</b> 038 198 011  <b>B32241-00</b> 038 198 011 	 <b>H03518-00</b> 038 103 383 AL 1,47 mm MLS <b>H13518-10</b> 038 103 383 AM 1,57 mm MLS <b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm MLS	 <b>T02673-00</b> 068 103 384 A (10x)	
1,9 ARD AVM BEQ BEU BJC BXT	30-63 kW (41-86 PS) BORA TDI GOLF TDI		 <b>D32241-00</b> 038 198 012  <b>B32937-00</b>	 <b>H03518-00</b> 038 103 383 AL 1,47 mm MLS <b>H13518-10</b> 038 103 383 AM 1,57 mm MLS <b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm MLS	 <b>T02673-00</b> 068 103 384 A (10x)	
1,9 ARL	110 kW (150 PS) BORA TDI GOLF TDI	02/00-06/05	 <b>D32937-00</b>  <b>B32937-00</b>	 <b>H09538-00</b> 038 103 383 DE 80,5 Ø 1,45 mm MLS <b>H19538-10</b> 038 103 383 DF 80,5 Ø 1,53 mm MLS <b>H29538-20</b> 038 103 383 DG 80,5 Ø 1,61 mm MLS	 <b>T09538-00</b> 038 103 384 C (10x)	
1,9 ASV	81 kW (110 PS) BORA TDI GOLF TDI	08/97-05/04	 <b>S32241-00</b>  <b>D32241-00</b> 038 198 012  <b>B32241-00</b> 038 198 011	 <b>H03518-00</b> 038 103 383 AL 1,47 mm MLS <b>H13518-10</b> 038 103 383 AM 1,57 mm MLS <b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm MLS	 <b>T02673-00</b> 068 103 384 A (10x)	

35 contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x	<b>X51638-01</b> 037 253 039 D <b>X81385-01</b> 155 253 115	<b>70-31414-10</b>	<b>P76096-01 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x	<b>X51638-01</b> 037 253 039 D	<b>70-31414-10</b>	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53715-01</b> 038 103 483 D ACM	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x	<b>X03747-01</b> 026 129 589 A 4x <b>X51706-01</b> 3A0 253 115	<b>70-31414-10</b>	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x	<b>X51638-01</b> 037 253 039 D <b>X51706-01</b> 3A0 253 115 <b>X52970-01</b> 1H0 253 115 A	<b>70-31414-10</b>	<b>P76096-01 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

38 sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
1,9 ASY	47 kW (64 PS)	POLO SDI	10/01→	<b>D32937-00</b> <sup>(12)</sup>  <b>B32937-00</b> <sup>(13) (35)</sup>	<b>H03518-00</b> 038 103 383 AL 1,47 mm 1 <b>MLS</b> <b>H13518-10</b> 038 103 383 AM 1,57 mm 2 <b>MLS</b> <b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 <b>MLS</b> 	<b>T02673-00</b> 068 103 384 A (10x) 
1,9 AVQ BJB BKC BRU BXE BXF	66-77 kW (90-105 PS)	CADDY TDI GOLF TDI JETTA TDI PASSAT TDI TOURAN TDI	02/03→	<b>D32937-00</b> <sup>(12)</sup>  <b>B36708-00</b> <sup>(13) (35)</sup>	<b>H09538-00</b> 038 103 383 DE 80,5 Ø 1,45 mm 1 <b>MLS</b> <b>H19538-10</b> 038 103 383 DF 80,5 Ø 1,53 mm 2 <b>MLS</b> <b>H29538-20</b> 038 103 383 DG 80,5 Ø 1,61 mm 3 <b>MLS</b> 	<b>T03518-00</b> 038 103 384 (10x) 
1,9 BGG	47 kW (64 PS)	PARATI D	08/02→	<b>D32719-00</b> <sup>(12)</sup> 028 198 012 E  <b>B37015-00</b> <sup>(13) (35)</sup> 	<b>H02391-00</b> 028 103 383 BH 1,53 mm 1 <b>MLS</b> <b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 <b>MLS</b> <b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 <b>MLS</b> 	<b>T02673-00</b> 068 103 384 A (10x) 
1,9 BGL BGM CDXA CDXB	29-55 kW (39-75 PS)			<b>D32241-00</b> <sup>(12)</sup> 038 198 012   <b>B32959-00</b> <sup>(13) (38)</sup>	<b>H03518-00</b> 038 103 383 AL 1,47 mm 1 <b>MLS</b> <b>H13518-10</b> 038 103 383 AM 1,57 mm 2 <b>MLS</b> <b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 <b>MLS</b> 	<b>T02673-00</b> 068 103 384 A (10x) 

<sup>(35)</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53715-01</b> 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A  <b>X81385-01</b> 155 253 115 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53715-01</b> 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 	<b>X51638-01</b> 037 253 039 D  <b>X51706-01</b> 3A0 253 115 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>V31598-00</b> 028 198 025  <b>X53152-01</b> 028 103 483 B ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 	<b>X51947-01</b> 037 253 039 	<b>X54361-01</b> 037 115 220 B NBR 	<b>P77181-01 K ←</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77317-01 K →</b> 028 103 171 B PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> L 2x 026 129 589 A  <b>X81409-01</b> R 2x 034 129 589 B 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

<sup>(38)</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN							
1,9	BLS BMT BSU BXJ	55-77 kW (75-105 PS)	CADDY TDI GOLF TDI JETTA TDI PASSAT TDI POLO TDI TOURAN TDI	10/01→	<b>D37051-00</b> <sup>12</sup>  <b>B36708-00</b> <sup>13 35</sup>	<b>H09538-00</b> 038 103 383 DE 80,5 Ø 1,45 mm 1 MLS <b>H19538-10</b> 038 103 383 DF 80,5 Ø 1,53 mm 2 MLS <b>H29538-20</b> 038 103 383 DG 80,5 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 
1,9	BRM	74 kW (101 PS)			<b>D37051-00</b> <sup>12</sup>  <b>B36708-00</b> <sup>13 35</sup>	<b>H09538-00</b> 038 103 383 DE 80,5 Ø 1,45 mm 1 MLS <b>H19538-10</b> 038 103 383 DF 80,5 Ø 1,53 mm 2 MLS <b>H29538-20</b> 038 103 383 DG 80,5 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 
1,9	BRR BRS	62-75 kW (84-102 PS)	MULTIVAN TDI TRANSPORTER	01/06-11/09	<b>D37058-00</b> <sup>12</sup>  <b>B36708-00</b> <sup>13 35</sup>	<b>H09538-00</b> 038 103 383 DE 80,5 Ø 1,45 mm 1 MLS <b>H19538-10</b> 038 103 383 DF 80,5 Ø 1,53 mm 2 MLS <b>H29538-20</b> 038 103 383 DG 80,5 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 
1,9	DF DG DH GW SP	44-68 kW (60-92 PS)	TRANSPORTER	08/82→	<b>S31503-00</b> <sup>13</sup> 025 198 009 B <b>D31503-00</b> 2x 025 198 012 A <b>B31503-00</b> <sup>13</sup>	<b>H50048-00</b> 4x 025 101 343 B 95 Ø 	

<sup>35</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53715-01</b> <sup>X</sup> 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x 	<b>X81833-01</b> 03G 253 039 A 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K</b> → 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83120-01</b> 03G 103 483 D NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x 	<b>X81833-01</b> 03G 253 039 A 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K</b> → 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83127-01</b> 03G 103 483 F NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K</b> → 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X00991-01</b> 2x 113 101 481 F Kork 		<b>X55316-01</b> 2x 025 129 717 E  <b>X55877-01</b> 2x 025 129 717 C 	<b>X51158-01</b> 4x N 901 316 02 		<b>P76253-01 K</b> ← 025 105 247 A 48x68x10 A SL RD FPM <b>P76325-01 K</b> → 029 105 245 B 75x95x10/9,5 A LD FPM



VOLKSWAGEN												
Ltr.												
1,9 WN	85 kW (115 PS)	PASSAT SANTANA	01/81-07/83									
				<b>S31200-00</b> ⑫ ⑬ <b>D31200-00</b> ⑫ 035 198 012 L <b>B30567-00</b> ⑬ 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> ✗ 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X02658-01</b> 035 129 717 M 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM 2x
1,9 028.B		INDUSTRIEMOT.		<b>D31598-00</b> ⑫ 028 198 012 B  <b>B32231-00</b> ⑬ 028 198 011 D 	<b>H02391-00</b> 028 103 383 BH 1,53 mm 1 MLS <b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 MLS <b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 MLS 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V31598-00</b> 028 198 025  <b>X53152-01</b> 028 103 483 B ACM 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,9 1X	44-45 kW (60-61 PS)	TRANSPORTER	07/90-12/95	<b>S31598-00</b> ⑫ ⑬  <b>D31598-00</b> ⑫ 028 198 012 B  <b>B31598-00</b> ⑬ 028 198 011 B 	<b>H02390-00</b> 028 103 383 BB 1,6 mm 1 → 1X 104 630 <b>H12390-10</b> 028 103 383 BC 1,65 mm 2 → 1X 104 630 <b>H22390-20</b> 028 103 383 BD 81 Ø 1,7 mm 3 → 1X 104 630  <b>H02391-00</b> 028 103 383 BH 1,53 mm 1 MLS 1X 104 631 → <b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 MLS 1X 104 631 → <b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 1X 104 631 → 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V31598-00</b> 028 198 025  <b>X53152-01</b> 028 103 483 B ACM 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x 	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 026 129 589 A 4x 	<b>X54361-01</b> 037 115 220 B NBR 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM

⑫ ⑬ L R  
 ← → K N (A) START STOP



VOLKSWAGEN												
1,9 1Y	47-50 kW (64-68 PS)	CADDY D GOLF D PASSAT D POLO D VENTO D	05/89-01/04	<b>D31598-00</b> ⑫ 028 198 012 B → 1Y 580 000  <b>D32719-00</b> ⑫ 028 198 012 E → 1Y 580 001→  <b>B31598-00</b> ⑬ 028 198 011 B 	<b>H02390-00</b> 028 103 383 BB 1,6 mm 1 → 1Y315599 <b>H12390-10</b> 028 103 383 BC 1,65 mm 2 → 1Y315599 <b>H22390-20</b> 028 103 383 BD 81 Ø 1,7 mm 3 → 1Y315599  <b>H02391-00</b> 028 103 383 BH 1,53 mm 1 MLS → 1Y315600→ <b>H12391-10</b> 028 103 383 BJ 1,57 mm 2 MLS → 1Y315600→ <b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3 MLS → 1Y315600→ 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V31598-00</b> 028 198 025  <b>X53152-01</b> 028 103 483 B ACM 	<b>N90300-00</b> 026 109 675 (8x) → 1Y 580 000 <b>N91190-00</b> 027 109 675 (8x) → 1Y 580 001→ <b>P76531-00</b> 8x 026 109 675 <b>P76532-00</b> 8x 027 109 675 → 1Y 580 001→	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A  <b>X81385-01</b> 155 253 115 	<b>X54361-01</b> 037 115 220 B NBR 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,9 1Z	66 kW (90 PS)	CADDY TDI GOLF TDI PASSAT TDI SHARAN TDI VENTO TDI	09/93-03/10	<b>D32231-00</b> ⑫ 028 198 012 C → 1Z 770 000  <b>D32721-00</b> ⑫ 028 198 012 F → 1Z 770 001→  <b>B32231-00</b> ⑬ 028 198 011 D 	<b>H02392-00</b> 028 103 383 BL 1,45 mm 1 MLS <b>H12392-10</b> 028 103 383 BM 1,53 mm 2 MLS <b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 MLS	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) 	<b>N90300-00</b> 026 109 675 (8x) → 1Z 770 000 <b>N91190-00</b> 027 109 675 (8x) → 1Z 770 001→ <b>P76531-00</b> 8x 026 109 675 → 1Z 770 000 <b>P76532-00</b> 8x 027 109 675 → 1Z 770 001→	<b>X55431-01</b> 028 129 717 D 	<b>X03747-01</b> 4x 026 129 589 A  <b>X81385-01</b> 155 253 115 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
2,0 AAC	62 kW (84 PS)	TRANSPORTER VENTO	07/90-04/03	<b>S32723-00</b> ⑫ ⑬ <b>D31643-00</b> ⑫ 044 198 012 <b>B32723-00</b> ⑬ 044 198 011	<b>H50155-00</b> 044 103 383 D 82,7 Ø 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> 026 198 025 C 6,5 mm Gummi 1 Dichtlippe	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 8x 026 109 675	<b>X04875-01</b> 026 129 717 D  <b>X55430-01</b> 048 129 717 A 	<b>X03747-01</b> 4x 026 129 589 A 	<b>X04116-01</b> 026 103 609 D 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN						
2,0 ABF	110 kW (150 PS)	GOLF GTI PASSAT SHARAN	08/92-02/00	<b>D32722-00</b> ⑫ 037 198 012 F → ABF 031 251 <b>D32724-00</b> ⑫ 037 198 012 J → ABF 031 252→ <b>B32233-00</b> ⑬ 037 198 011 G	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm → ABF 031 251  <b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS → ABF 031 252→ 	<b>T04843-00</b> 027 103 385 C (10x) → ABF 031 251  <b>T50151-00</b> 053 103 385 (10x) → ABF 031 252→ 
2,0 ADC	85 kW (116 PS)			<b>D37031-00</b> ⑫ 037 198 012 N <b>B32233-00</b> ⑬ 037 198 011 G	<b>H80287-00</b> 037 103 383 N 83,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 
2,0 ADY AEP AGG AKR	79-85 kW (107-116 PS)	CORRADO GOLF PASSAT SHARAN VENTO	02/90-03/10	<b>D32725-00</b> ⑫ 037 198 012 L <b>B32233-00</b> ⑬ 037 198 011 G	<b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 
2,0 AEG	85 kW (115 PS)	NEW BEETLE	01/98→	<b>D36646-00</b> ⑫ <b>B32937-00</b> ⑬ ⑮	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 

⑫ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>V31196-00</b> 027 198 025 → ABF 031 251  <b>V32233-00</b> 051 198 025 → ABF 031 252→ 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	2x 16x	<b>X07866-01</b> 037 129 717 F <b>X51711-01</b> ⑩ 037 129 717 E 	<b>X07855-01</b> 027 129 589 A 4x <b>X07867-01</b> 533 253 115 D 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM 2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	8x	<b>X57668-01</b> 037 129 717 C <b>X51712-01</b> ⑩ 037 129 717 D 	<b>X51638-01</b> 037 253 039 D <b>X07867-01</b> 533 253 115 D 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P77317-01 K</b> → 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM 2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	8x	<b>X55170-01</b> 026 129 717 F 	<b>X03747-01</b> 026 129 589 A 4x <b>X51638-01</b> 037 253 039 D <b>X07867-01</b> 533 253 115 D 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P77317-01 K</b> → 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM 2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	8x	<b>X75011-01</b> 06A 129 717 D 4x <b>X52681-01</b> ⑩ 06A 129 717 	<b>X52965-01</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K</b> → 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

⑮ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



VOLKSWAGEN						
Ltr.						
2,0 AEG PR-ML8 85 kW (115-116 PS)	GOLF JETTA NEW BEETLE	01/98→	<b>D36712-00</b> <b>B32937-00</b>	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS	<b>T50474-00</b> 06A 103 384 C (10x)	
2,0 ALT 96 kW (130 PS)	PASSAT	11/01-05/05	<b>D36711-00</b> <b>B36711-00</b>	<b>H50827-00</b> 06B 103 383 R 83,5 Ø MLS	<b>T50827-00</b> 06B 103 385 (10x)	
2,0 APK AQY AZH 85 kW (115 PS)	BORA GOLF NEW BEETLE	01/98→	<b>D36646-00</b> <b>B32937-00</b>	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS	<b>T50474-00</b> 06A 103 384 C (10x)	
2,0 ATM AXA 85 kW (115 PS)	MULTIVAN SHARAN SHARAN LPG TRANSPORTER	09/95→	<b>D36712-00</b> <b>B32937-00</b>	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS	<b>T50474-00</b> 06A 103 384 C (10x)	
2,0 ATU AWF AWG 85 kW (115 PS)	GOLF	06/98-06/02	<b>D37032-00</b> <b>B37023-00</b>	<b>H80287-00</b> 037 103 383 N 83,5 Ø 1,65 mm MLS	<b>T50469-00</b> 050 103 384 (10x)	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора  
 ⑬ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53809-01</b> 06A 103 483 C NBR	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 037 129 717 C <b>X75011-01</b> 06A 129 717 D <b>X52681-01</b> 06A 129 717 <b>X88392-01</b> 06A 129 717 F	<b>X52965-01</b> 06A 253 039 L	<b>70-31414-10</b>	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83031-01</b> 06B 103 483 H NBR	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675	<b>X88305-01</b> 058 129 717 C <b>X81686-01</b> 06B 253 039 E	<b>70-31414-10</b>	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K →</b> 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM	
<b>X53263-01</b> 051 103 483 A ACM	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X52681-01</b> 06A 129 717 <b>X52965-01</b> 06A 253 039 L	<b>70-31414-10</b>	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM	
<b>X53809-01</b> 06A 103 483 C NBR	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 037 129 717 C <b>X88392-01</b> 06A 129 717 F <b>X51712-01</b> 037 129 717 D	<b>X52965-01</b> 06A 253 039 L <b>X07867-01</b> 533 253 115 D	<b>70-31414-10</b>	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53263-01</b> 051 103 483 A ACM	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 037 129 717 C <b>X51638-01</b> 037 253 039 D <b>X07867-01</b> 533 253 115 D	<b>X54624-01</b> 044 103 609 D ACM	<b>70-31414-10</b>	<b>P77181-01 K ←</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77317-01 K →</b> 028 103 171 B PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

⑬ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.						
2,0 AVH AZG BBW BEV	85 kW (115 PS) BORA GOLF NEW BEETLE	01/98→	<b>D36712-00</b> ⑫ <b>B32937-00</b> ⑬ ⑳	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	
2,0 AXW	110 kW (150 PS) GOLF FSI TOURAN FSI	10/03-11/08	<b>D36713-00</b> ⑫ <b>B36711-00</b> ⑬ ⑳	<b>H80451-00</b> 06D 103 383 L 84 Ø MLS 	<b>T80450-00</b> 06D 103 385 (10x) 	
2,0 AXX BPY BWA BYD CDLA CDLC CDLF CDLG CRZA	147-199 kW (200-270 PS) EOS TFSI GOLF GTI GOLF R GOLF TFSI GOLF TSI JETTA TFSI PASSAT TFSI SCIROCCO	10/04→	<b>D37050-00</b> ⑫ <b>B36707-00</b> ⑬ ⑳	<b>H80449-00</b> 06F 103 383 G 83,5 Ø MLS 	<b>T80727-00</b> 06D 103 385 D (10x) 	
2,0 AZJ BDC BEH BGD	85 kW (115-116 PS) BORA GOLF GOLF Bi-Fuel NEW BEETLE	01/98→	<b>B32937-00</b> ⑬ ⑳	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	
2,0 AZM BFF BNL	85 kW (115-116 PS) PASSAT	11/00→	<b>D37017-00</b> ⑫ <b>B32937-00</b> ⑬ ⑳	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	

⑫ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора  
 ⑬ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53809-01</b> 06A 103 483 C NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 037 129 717 C <b>X52681-01</b> ⑩ 06A 129 717 <b>X88392-01</b> ⑩ 06A 129 717 F 	<b>X52965-01</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01 K ←</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83032-01</b> 06D 103 483 D 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X88306-01</b> 06D 129 717 D 	<b>X81686-01</b> 06B 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K →</b> 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01 N</b> 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83119-01</b> 06F 103 483 D NBR 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X89273-01</b> 06F 129 717 D 	<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53809-01</b> 06A 103 483 C NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57666-01</b> 4x 06A 133 398 F  <b>X88303-01</b> ⑩ 4x 06A 133 227 B 	<b>X52965-01</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X87424-01</b> 4x 06B 129 717 A 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

⑩ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач





VOLKSWAGEN						
Ltr.						
2,0 AZV BKD BKP BMA BVE BWV	88-103 kW (120-140 PS) GOLF TDI JETTA TDI PASSAT TDI TOURAN TDI	02/03→		<b>D36710-00</b> (12)  <b>B36708-00</b> (13 35)	<b>H08124-00</b> 03G 103 383 1,55 mm 1 MLS <b>H18124-10</b> 03G 103 383 A 1,63 mm 2 MLS <b>H28124-20</b> 03G 103 383 B 82 Ø 1,7 mm 3 MLS 	<b>T08124-00</b> 03G 103 384 (10x) 
2,0 BDJ BDK BST	51-55 kW (70-75 PS) CADDY SDI GOLF SDI	01/04-08/10		<b>D32937-00</b> (12)  <b>B36708-00</b> (13 35)	<b>H08007-00</b> 038 103 383 CH 1,41 mm 1 MLS <b>H18007-10</b> 038 103 383 CJ 1,51 mm 2 MLS <b>H28007-20</b> 038 103 383 CK 82 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 
2,0 BEF	43 kW (58 PS)			<b>B36707-00</b> (13 35)	<b>H80753-00</b> 06G 103 383 A MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
2,0 BGW BHW	100 kW (136 PS) PASSAT TDI	12/03-05/05		<b>D32937-00</b> (12)  <b>B32937-00</b> (13 35)	<b>H08008-00</b> 038 103 383 CP 1,45 mm 1 MLS <b>H18008-10</b> 038 103 383 CQ 1,53 mm 2 MLS <b>H28008-20</b> 038 103 383 CR 82 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 

35 contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X83030-01</b> 03G 103 483 NBR 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X87466-01</b> 03G 129 717 B  <b>X89274-01</b> 03G 129 717 C 	<b>X81685-01</b> 03G 253 039 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53715-01</b> 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X55431-01</b> 028 129 717 D 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X75011-01</b> 4x 06A 129 717 D 	<b>X51947-01</b> 037 253 039 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53715-01</b> 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X55431-01</b> 028 129 717 D 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM



VOLKSWAGEN

VOLKSWAGEN						
Ltr.						
2,0 BJJ	85 kW (115 PS)	TOURAN FSI	10/04-05/10	<b>D36712-00</b> <b>B32937-00</b> ⑫ ⑬ ⑳	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
2,0 BLR BLX BLY BVX BVY BVZ	110 kW (150 PS)	EOS FSI GOLF FSI JETTA FSI PASSAT FSI TOURAN FSI	10/03-11/10	<b>D37018-00</b> <b>B36711-00</b> ⑫ ⑬ ⑳	<b>H80451-00</b> 06D 103 383 L 84 Ø MLS 	<b>T80450-00</b> 06D 103 385 (10x) 
2,0 BMM BMP	103 kW (140 PS)	CADDY TDI EOS TDI JETTA TDI PASSAT TDI TOURAN TDI	08/04→	<b>D37051-00</b>  <b>B36708-00</b> ⑫ ⑬ ⑳	<b>H08008-00</b> 038 103 383 CP 1,45 mm MLS 1 <b>H18008-10</b> 038 103 383 CQ 1,53 mm MLS 2 <b>H28008-20</b> 038 103 383 CR 82 Ø 1,61 mm MLS 3 	<b>T03518-00</b> 038 103 384 (10x) 
2,0 BMN BMR BUZ	120-125 kW (163-170 PS)	GOLF TDI JETTA TDI PASSAT TDI TOURAN TDI	08/05→	<b>D37052-00</b>  <b>B36708-00</b> ⑫ ⑬ ⑳	<b>H08124-00</b> 03G 103 383 1,55 mm MLS 1 <b>H18124-10</b> 03G 103 383 A 1,63 mm MLS 2 <b>H28124-20</b> 03G 103 383 B 82 Ø 1,7 mm MLS 3 	<b>T08124-00</b> 03G 103 384 (10x) 

⑳ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X53809-01</b> 06A 103 483 C NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X75011-01</b> 06A 129 717 D 4x 	<b>X52965-01</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83112-01</b> 06D 103 483 E NBR 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X88306-01</b> 06D 129 717 D 	<b>X81686-01</b> 06B 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01 K →</b> 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53715-01</b> ✗ 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X55431-01</b> 028 129 717 D 	<b>X81833-01</b> 03G 253 039 A 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83120-01</b> 03G 103 483 D NBR 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X87466-01</b> 03G 129 717 B 	<b>X81981-01</b> 03G 253 039 C 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X83121-01</b> 03G 103 483C NBR 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X89274-01</b> 03G 129 717 C 			<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

⑳ sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.						
2,0 BRT BVH	100-103 kW (136-140 PS)	SHARAN TDI	11/05-03/10	<b>D37058-00</b> <sup>(12)</sup>  <b>B36708-00</b> <sup>(13) (35)</sup>	<b>H08008-00</b> 038 103 383 CP 1,45 mm 1 MLS <b>H18008-10</b> 038 103 383 CQ 1,53 mm 2 MLS <b>H28008-20</b> 038 103 383 CR 82 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 
2,0 BSX CBSA CFEA <b>[NEW]</b>	37-85 kW (50-116 PS)	CADDY TOURAN	02/06→	<b>D37092-00</b> <sup>(12)</sup> <b>B32937-00</b> <sup>(13) (35)</sup>	<b>H80753-00</b> 06G 103 383 A MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
2,0 BTL	80-85 kW (109-116 PS)				<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 
2,0 CAAA CAAB CAAC CAAD CAAE CCHA CCHB <b>[NEW]</b>	62-103 kW (84-140 PS)	MULTIVAN TDI TRANSPORTER TDI	09/09→	<b>D38308-00</b> <sup>(12)</sup>  <b>B38299-00</b> <sup>(13) (35)</sup>	<b>H40583-00</b> 03L 103 383 AM 82 Ø 1,55 mm 1 MLS <b>H40583-10</b> 03L 103 383 AN 82 Ø 1,63 mm 2 MLS <b>H40583-20</b> 03L 103 383 AP 82 Ø 1,71 mm 3 MLS 	<b>T50034-00</b> WHT 002 131 (10x) 
2,0 CAWA CAWB CGM CJKA CJKB <b>[NEW]</b>	110-150 kW (150-204 PS)	EOS TFSI GOLF GTI GOLF TFSI JETTA TFSI MULTIVAN TSI PASSAT TFSI PASSAT TSI SCIROCCO TSI TIGUAN TFSI TRANSPORTER TSI	10/04→	<b>D40567-00</b> <sup>(12)</sup> <b>B38289-00</b> <sup>(13) (35)</sup>	<b>H40567-00</b> 06H 103 383 AC 83 Ø MLS 	<b>T80727-00</b> 06D 103 385 D (10x) 

<sup>(12)</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X83127-01</b> 03G 103 483 F NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X55431-01</b> 028 129 717 D 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X53809-01</b> 06A 103 483 C NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X75011-01</b> 06A 129 717 D 4x 	<b>X52965-01</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>X59498-01</b> 051 103 483 D 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x		<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>V59500-00</b> 03L 103 483 C +03L 103 070 (4x) 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X59474-01</b> 03L 129 717 E 	<b>X59496-01</b> 03L 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77689-01 K →</b> 03L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X89273-01</b> 06F 129 717 D 	<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K ←</b> 06H 103 383 G 45x60x8 AB SL RD FPM <b>P77754-01 K →</b> 06H 103 171 F 85x132/152x15,7 PTFE



VOLKSWAGEN							
Ltr.							
2,0	CBAA CBAB CBAC CBBA CBBB CBDA CBDB CBDC CBEA CJAA	81-125 kW (110-170 PS)	BEETLE TDI EOS TDI GOLF TDI JETTA TDI PASSAT TDI SCIROCCO TDI TIGUAN TDI	01/05→	<b>D38107-00</b> <sup>(12)</sup>  <b>B38109-00</b> <sup>(13) (35)</sup>	<b>H01461-00</b> 03L 103 383 82 Ø 1,55 mm 1 MLS <b>H11461-10</b> 03L 103 383 A 82 Ø 1,63 mm 2 MLS <b>H21461-20</b> 03L 103 383 B 82 Ø 1,71 mm 3 MLS 	<b>T50034-00</b> WHT 002 131 (10x) 
2,0	CBFA CCTA CCTB CCZA CCZB CCZC CCZD CFPA	118-155 kW (160-211 PS)	AMAROK TSI BEETLE TSI CC TSI EOS TFSI EOS TSI GOLF GOLF GTI GOLF TFSI GOLF TSI JETTA TFSI JETTA TSI PASSAT FSI PASSAT TFSI PASSAT TSI SCIROCCO TSI SHARAN TSI TIGUAN TFSI TIGUAN TSI TRANSPORTER TSI	10/04→	<b>D40567-00</b> <sup>(12)</sup> <b>B38289-00</b> <sup>(13) (35)</sup>	<b>H40567-00</b> 06H 103 383 AC 83 Ø MLS 	<b>T40708-00</b> WHT 005 305 (10x)  <b>T80727-00</b> 06D 103 385 D (10x) 
2,0	CBHA CBKA	47-74 kW (64-101 PS)			<b>D37051-00</b> <sup>(12)</sup>  <b>B36708-00</b> <sup>(13) (35)</sup>	<b>H08008-00</b> 038 103 383 CP 1,45 mm 1 MLS <b>H18008-10</b> 038 103 383 CQ 1,53 mm 2 MLS <b>H28008-20</b> 038 103 383 CR 82 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 

<b>X83360-01</b> 03L 103 483 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X89884-01</b> 03L 129 717 	<b>X81685-01</b> 03G 253 039 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77689-01 K →</b> 03L 103 171 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X89273-01</b> 06F 129 717 D 	<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K ←</b> 06H 103 383 G 45x60x8 AB SL RD FPM <b>P77754-01 K →</b> 06H 103 171 F 85x132/152x15,7 PTFE
<b>X83120-01</b> 03G 103 483 D NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 8x	<b>X55431-01</b> 028 129 717 D 	<b>X81833-01</b> 03G 253 039 A 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM

<sup>(35)</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



VOLKSWAGEN												
2,0 CBJB	55 kW (75 PS)		1	<b>D32937-00</b> <sup>12</sup>  <b>B36708-00</b> <sup>13 35</sup>	<b>H08008-00</b> 038 103 383 CP 1,45 mm MLS <b>H18008-10</b> 038 103 383 CQ 1,53 mm MLS <b>H28008-20</b> 038 103 383 CR 82 Ø 1,61 mm MLS	<b>T03518-00</b> 038 103 384 (10x) 	<b>X53715-01</b> 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K →</b> 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 CDBA CDCA CKTB CKTC CKUB CKUC CNEA CNFA CNFB CSHA	80-132 kW (109-180 PS)	AMAROK BiTDI AMAROK TDI CRAFTER TDI	09/10→	<b>D38311-00</b> <sup>12</sup>  <b>B38299-00</b> <sup>13 35</sup>	<b>H40583-00</b> 03L 103 383 AM 82 Ø 1,55 mm MLS <b>H40583-10</b> 03L 103 383 AN 82 Ø 1,63 mm MLS <b>H40583-20</b> 03L 103 383 AP 82 Ø 1,71 mm MLS	<b>T50034-00</b> WHT 002 131 (10x) 	<b>V59500-00</b> 03L 103 483 C +03L 103 070 (4x) 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X59470-01</b> 03L 129 717 D 16x 	<b>X82518-01</b> 03L 253 039 G 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77689-01 K →</b> 03L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
2,0 CEN CGZ	88 kW (120 PS)				<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	<b>X53809-01</b> 06A 103 483 C NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X75011-01</b> 06A 129 717 D 4x 	<b>X52965-01</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K →</b> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 CFCA	132 kW (180 PS)	MULTIVAN BiTDI MULTIVAN TDI TRANSPORTER BiTDI	09/09→	<b>D38307-00</b> <sup>12</sup>  <b>B38299-00</b> <sup>13 35</sup>	<b>H40583-00</b> 03L 103 383 AM 82 Ø 1,55 mm MLS <b>H40583-10</b> 03L 103 383 AN 82 Ø 1,63 mm MLS <b>H40583-20</b> 03L 103 383 AP 82 Ø 1,71 mm MLS	<b>T50034-00</b> WHT 002 131 (10x) 	<b>V59500-00</b> 03L 103 483 C +03L 103 070 (4x) 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X59474-01</b> 03L 129 717 E 16x 	<b>X82521-01</b> 03C 253 039 F 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77689-01 K →</b> 03L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM

35 contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала





VOLKSWAGEN						
Ltr.						
2,0 CFFA CFFB CFFD CFFE CFHB CFHC CFHE CFHF CFJA CLCA CLCB CLJA	62-125 kW (85-170 PS)  BEETLE TDI CADDY TDI CC TDI EOS TDI GOLF TDI JETTA TDI PASSAT TDI SCIROCCO TDI SHARAN TDI TIGUAN TDI TOURAN TDI	01/05→	<b>D38308-00</b> <sup>12</sup>  <b>B38299-00</b> <sup>13 35</sup>	<b>H40584-00</b> 03L 103 383 BM 82 Ø 1,55 mm 1 MLS <b>H40584-10</b> 03L 103 383 BN 82 Ø 1,63 mm 2 MLS <b>H40584-20</b> 03L 103 383 BP 82 Ø 1,71 mm 3 MLS 	<b>T50034-00</b> WHT 002 131 (10x) 	
2,0 CFGB CFGC CLLA	125-130 kW (170-177 PS)  CC TDI GOLF TDI PASSAT TDI SCIROCCO TDI SHARAN TDI TIGUAN TDI	09/07→	<b>D38731-00</b> <sup>12</sup>  <b>B38299-01</b> <sup>13 38</sup>	<b>H40584-00</b> 03L 103 383 BM 82 Ø 1,55 mm 1 MLS <b>H40584-10</b> 03L 103 383 BN 82 Ø 1,63 mm 2 MLS <b>H40584-20</b> 03L 103 383 BP 82 Ø 1,71 mm 3 MLS 	<b>T50034-00</b> WHT 002 131 (10x) 	
2,0 CH	55 kW (75 PS) LT	04/75-09/83	<b>D31645-00</b> <sup>12</sup> 047 198 012 <b>B37007-00</b> <sup>13</sup> 060 198 011 B	<b>H50164-00</b> 046 103 383 J 88,5 Ø 1,55 mm 	<b>T02673-00</b> 068 103 384 A (10x) 0008796→ 	
2,0 CJ GE	51 kW (69-70 PS) TRANSPORTER	08/75-07/79	<b>A31438-00</b> <sup>14</sup> 029 198 009 A 	<b>H51289-00</b> 4x 051101341A 93 Ø 		
2,0 CPLA CPPA	155 kW (210-211 PS) BEETLE TSI JETTA TSI	12/12→		<b>H40708-00</b> 06K 103 383 E 83 Ø MLS 	<b>T40708-00</b> WHT 005 305 (10x) 	

<sup>14</sup> sin retén cigüeñal / ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / senza paraolio albero motore / без уплотнительного кольца коленчатого вала  
<sup>35</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>V59500-00</b> 03L 103 483 C +03L 103 070 (4x) 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x 	<b>X59474-01</b> 03L 129 717 E 	<b>X59496-01</b> 03L 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77689-01 K →</b> 03L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
<b>V59500-01</b> 03L 103 483 C 					
<b>V59500-00</b> 03L 103 483 C +03L 103 070 (4x) 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x 	<b>X59474-01</b> 03L 129 717 E 	<b>X59891-01</b> 04L 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77689-01 K →</b> 03L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
<b>V59500-01</b> 03L 103 483 C 					
<b>V31645-00</b> 060 198 025 A 	<b>N92632-00</b> 046 109 675 A (8x) <b>P76661-00</b> 046 109 675 A 8x 	<b>X56304-01</b> 060 129 717 A 	<b>X51297-01</b> 048 129 589  <b>X52208-01</b> 4x 048 129 589 A  <b>X51169-01</b> 431 253 115 A 	<b>E37007-00</b> 060 198 041 A 	<b>P77438-01 K ←</b> 048 115 147 35x54x10 A SL RD FPM <b>P77439-01 K →</b> 059 103 051 D 96x117x10,5/12 A SL LD NBR <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53150-01</b> 2x 021 101 481 Kork 		<b>X55893-01</b> 4x 021 129 707 E 	<b>X51285-01</b> 4x 039 256 251  <b>X81354-01</b> 025 251 261 		<b>P76152-01 K ←</b> 021 105 247 A 42x62x10 A SL RD FPM
	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x 	<b>X59914-01</b> 06K 129 717 A 	<b>X59924-01</b> 06L 253 039 	<b>70-31414-10</b> 	<b>P77842-01 K ←</b> 06L 103 085 B 45x60x8 A SL RD PTFE ACM <b>P77846-01 K →</b> 06K 103 171 A PTFE

<sup>38</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



VOLKSWAGEN						
Ltr.						
2,0 CRBC CRLB <b>[NEW]</b>	110 kW (150 PS)	GOLF TDI	11/12→	<b>D38750-00</b> <sup>(12)</sup>  	<b>H40701-00</b> 04L 103 383 AC 82 Ø 1,55 mm 1 MLS <b>H40701-10</b> 04L 103 383 AD 82 Ø 1,63 mm 2 MLS <b>H40701-20</b> 04L 103 383 AE 82 Ø 1,71 mm 3 	<b>T40709-00</b> WHT 005 673 (10x) 
2,0 CRVA <b>[NEW]</b>	81 kW (110 PS)	GOLF TDI	11/12→	<b>D38750-01</b> <sup>(12)</sup>  	<b>H40701-00</b> 04L 103 383 AC 82 Ø 1,55 mm 1 MLS <b>H40701-10</b> 04L 103 383 AD 82 Ø 1,63 mm 2 MLS <b>H40701-20</b> 04L 103 383 AE 82 Ø 1,71 mm 3 	<b>T40709-00</b> WHT 005 673 (10x) 
2,0 CU CV	51 kW (69-70 PS)	TRANSPORTER	05/79-04/86	<b>S37033-00</b> <sup>(13)</sup> 071 198 009 A	<b>H80723-00</b> 4x 039 101 343 B 94 Ø 0,7 mm 	
2,0 HP JS	85 kW (115-116 PS)	PASSAT SANTANA	08/83-03/88	<b>S30567-00</b> <sup>(12) (13)</sup> <b>D30567-00</b> <sup>(12)</sup> 035 198 012 N <b>B30567-00</b> <sup>(13)</sup> 034 198 011 C	<b>H02641-00</b> 034 103 383 AA 82,7 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 



<b>V59933-00</b> 03L 103 483 S +04L 103 070 (4x)  <b>X59933-01</b> 03L 103 483 S 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X59929-01</b> 04L 129 717 B 	<b>X59927-01</b> 04L 253 039 B 	<b>70-31414-10</b> 	<b>P77831-01 K</b> → 04L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
<b>V59933-00</b> 03L 103 483 S +04L 103 070 (4x)  <b>X59933-01</b> 03L 103 483 S 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X59929-01</b> 04L 129 717 B 	<b>X59891-01</b> 04L 253 039 D 	<b>70-31414-10</b> 	<b>P77831-01 K</b> → 04L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM
<b>X53150-01</b> 2x 021 101 481 Kork 		<b>X55893-01</b> 4x 021 129 707 E 	<b>X81357-01</b> L 2x 029 256 251 A  <b>X81358-01</b> R 2x 029 256 252 A  <b>X81354-01</b> 2x 025 251 261 	<b>P76152-01 K</b> ← 021 105 247 A 42x62x10 A SL RD FPM <b>P76325-01 K</b> → 029 105 245 B 75x95x10/9,5 A LD FPM	
<b>V30567-00</b> 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 035 129 717 M 	<b>X03747-01</b> 5x 026 129 589 A  <b>X51169-01</b> 431 253 115 A 	<b>X02643-01</b> 054 103 609 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN

VOLKSWAGEN							
Ltr.							
2,0 UQG <b>[NEW]</b>	82-90 kW (112-122 PS)			<b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS 	<b>T04132-00</b> 049 103 385 (10x) 		
2,0 2E	85 kW (115-116 PS)	GOLF PASSAT VENTO	→ 1H P 490 000, 1H PB140 000 → 31 P 160 000 → 1H P 490 000, 1H PB140 000	02/90-04/99	<b>S31641-00</b> ⑫ ⑬ 037198011E+ <b>D31641-00</b> ⑫ 037 198 012 B <b>B30584-00</b> ⑬ 037 198 011 C	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 
2,0 2E	85 kW (115-116 PS)	CORRADO GOLF PASSAT VENTO	1H P 490 001, 1H PB140 001 → 31 P 160 001 → 1H P 490 001, 1H PB140 001 →	02/90-04/99	<b>D36352-00</b> ⑫ 037198012G <b>B30584-00</b> ⑬ 037 198 011 C	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 
2,0 9A	100 kW (136 PS)	CORRADO PASSAT		08/88-12/95	<b>S31642-00</b> ⑫ ⑬ → 9A 131 460 <b>D31642-00</b> ⑫ 051 198 012 A → 9A 131 460 <b>D37035-00</b> ⑫ 9A 131 461 → <b>B30584-00</b> ⑬ 037 198 011 C	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm → 9A 131 460  <b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS 9A 131 461 → 	<b>T04843-00</b> 027 103 385 C (10x) → 9A 131 460  <b>T50151-00</b> 053 103 385 (10x) 9A 131 461 → 
2,1 DJ MV SR SS	64-82 kW (87-112 PS)	TRANSPORTER		08/85-07/92	<b>S31503-00</b> ⑬ 025 198 009 B <b>D31503-00</b> 2x 025 198 012 A <b>B31503-00</b> ⑬	<b>H50048-00</b> 4x 025 101 343 B 95 Ø 	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<b>X59501-01</b> 026 103 483 2 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55899-01</b> 068 129 717 E 8x 	<b>X03747-01</b> 026 129 589 A 4x 	<b>70-31414-10</b> 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P77317-01 K</b> → 028 103 171 B PTFE <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53064-01</b> 037 103 483 C NBR 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X55430-01</b> 048 129 717 A 8x 	<b>X03747-01</b> 026 129 589 A 4x  <b>X07867-01</b> 533 253 115 D 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53263-01</b> 051 103 483 A ACM 2 Dichtlippen	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X55430-01</b> 048 129 717 A 8x 	<b>X03747-01</b> 026 129 589 A 4x  <b>X07867-01</b> 533 253 115 D 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>V31196-00</b> 027 198 025 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X07866-01</b> 037 129 717 F 2x  <b>X07865-01</b> ⑩ 027 129 717 D 16x 	<b>X07855-01</b> 027 129 589 A 4x  <b>X07867-01</b> 533 253 115 D 	<b>X04116-01</b> 026 103 609 D 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
<b>X00991-01</b> 2x 113 101 481 F Kork 		<b>X55877-01</b> 2x 025 129 717 C 	<b>X51158-01</b> 4x N 901 316 02 		<b>P76253-01 K</b> ← 025 105 247 A 48x68x10 A SL RD FPM <b>P76325-01 K</b> → 029 105 245 B 75x95x10/9,5 A LD FPM



VOLKSWAGEN						
Ltr.						
2,1 WE	85 kW (115 PS)	PASSAT SANTANA	01/81-12/83	<b>S31200-00</b> <b>D31200-00</b> 035 198 012 L <b>B30567-00</b> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm	<b>T02641-00</b> 049 103 384 B (12x)
2,2 HY	100 kW (136 PS)	PASSAT	01/85-03/88	<b>S30567-00</b> <b>D30567-00</b> 035 198 012 N <b>B30567-00</b> 034 198 011 C	<b>H02641-00</b> 034 103 383 AA 82,7 Ø 1,75 mm	<b>T02641-00</b> 049 103 384 B (12x)
2,2 JT KV KX	85-100 kW (115-136 PS)	PASSAT	01/85-03/88	<b>S30567-00</b> <b>D30567-00</b> 035 198 012 N <b>B30567-00</b> 034 198 011 C	<b>H02641-00</b> 034 103 383 AA 82,7 Ø 1,75 mm	<b>T02641-00</b> 049 103 384 B (12x)
2,2 4Y	69 kW (94 PS)	TARO	06/89-07/94	<b>S37036-00</b> J04 111 730 44 <b>D37036-00</b> J04 112 730 43	<b>H40028-00</b> J11 115 730 30 93 Ø 1,6 mm <b>H40028-10</b> 93 Ø 2 mm	<b>T50670-00</b> J90 105 120 56 (10x)
2,3 AGL	105 kW (143 PS)	LT	05/96-07/06	<b>D36044-00</b> <b>B31936-00</b> 00A 198 011	<b>H80500-00</b> 00A 103 383 92 Ø 1,75 mm	<b>T50309-00</b> 00A 103 385 (10x)
2,3 AGZ	110 kW (150 PS)	BORA V5 GOLF V5 PASSAT V5	10/96-06/06	<b>B36716-00</b>	<b>H80095-00</b> 071103383 84 Ø MLS	<b>T80095-00</b> 021 103 384 G (9x) +021 103 384 K (6x) +021 103 384 L (3x)

⑦ junta para múltiple de admisión/de escape / Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



<b>V30567-00</b> ✗ 034 198 025 Kork <b>V31634-00</b> 034 198 025 D NBR	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X02658-01</b> 035 129 717 M	<b>X03747-01</b> 026 129 589 A	5x	<b>X02643-01</b> 054 103 609	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>V30567-00</b> ✗ 034 198 025 Kork <b>V31634-00</b> 034 198 025 D NBR	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X02658-01</b> 035 129 717 M	<b>X03747-01</b> 026 129 589 A	5x	<b>X02643-01</b> 054 103 609	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM
<b>V30567-00</b> ✗ 034 198 025 Kork <b>V31634-00</b> 034 198 025 D NBR	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X02658-01</b> 035 129 717 M	<b>X03747-01</b> 026 129 589 A	5x	<b>X02643-01</b> 054 103 609	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
<b>X83115-01</b> J11 213 710 20 NBR	<b>N92321-00</b> J90 913 021 10 (8x)	<b>X81945-01</b> ⑦ J17 172 730 10			<b>X54906-01</b> <b>70-31414-10</b>	
<b>V31937-00</b> 00A 103 483 +00A 103 484 (4x) NBR	<b>N92567-00</b> 00A 198 675 (16x) <b>P76792-00</b> 00A 109 675	<b>X56560-01</b> 00A 133 227	<b>X51359-01</b> 00A 253 039	16x	<b>X54089-01</b> 00A 103 609 A	<b>P76235-11</b> K ← 00A 103 085 A 45x67x8 A SL RD FPM <b>P76377-01</b> K → 00A 103 085 93x114x13 A SL LD FPM
	<b>N90710-01</b> 026 109 675 (10x) <b>P76532-00</b> 027 109 675	<b>X89179-01</b> 071 133 237 A	<b>X07867-01</b> 533 253 115 D	2x	<b>70-31414-10</b>	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01</b> K → 021 103 051 C 85x105x11 A SL LD PTFE ACM
		<b>X89180-01</b> 071 133 237		3x		
		<b>X89181-01</b> 071 133 237 D		5x		





VOLKSWAGEN														
2,3	AQN AZX	125 kW (170 PS)	BORA V5  GOLF V5  NEW BEETLE V5 PASSAT V5	→1J 5D001 000, 1J 5U001 500, 1J 5W050 000 →1J 5D001 000, 1J 5U001 500, 1J 5W050 000 →9C 3 626 062 →3B 5 050 000, 3B 5E100 000	10/00→	<b>D37019-00</b> ⑫ <b>B37019-00</b> ⑬	<b>H80444-00</b> 066 103 383 G 82 Ø MLS 	<b>T80444-00</b> 022 103 384 C (12x) +022 103 384 D (6x) 	<b>X83113-01</b> 066 103 483 F NBR 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X89178-01</b> 066 133 237 	<b>X81436-01</b> 066 253 039 A 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
2,3	AQN AZX	125 kW (170 PS)	BORA V5  GOLF V5  NEW BEETLE V5 PASSAT V5	→1J 5D001 001, 1J 5U001 501, 1J 5W050 001→ →1J 5D001 001, 1J 5U001 501, 1J 5W050 001→ →9C 3 626 063→ →3B 5 050 001, 3B 5E100 001→	10/00→	<b>D37019-00</b> ⑫ <b>B37019-00</b> ⑬	<b>H80444-00</b> 066 103 383 G 82 Ø MLS 	<b>T80444-00</b> 022 103 384 C (12x) +022 103 384 D (6x) 	<b>X83113-01</b> 066 103 483 F NBR 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X89178-01</b> 066 133 237 	<b>X81436-01</b> 066 253 039 A 	<b>70-31414-10</b> 	<b>P77820-01 K</b> ← 022 103 151 D <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
2,4	AAB	57 kW (78 PS)	TRANSPORTER	→70 R 160 000	07/90-09/98	<b>D31637-00</b> ⑫ 074 198 012  <b>B31637-00</b> ⑬ 074 198 011 A	<b>H02394-00</b> 074 103 383 C 1,53 mm 1 →AAB 110 000 <b>H12394-10</b> 074 103 383 D 1,57 mm 2 →AAB 110 000 <b>H22394-20</b> 074 103 383 E 81 Ø 1,61 mm 3 →AAB 110 000  <b>H00997-00</b> 074 103 383 M 1,53 mm 1 MLS →AAB 110 001→ <b>H10997-10</b> 074 103 383 N 1,57 mm 2 MLS →AAB 110 001→ <b>H20997-20</b> 074 103 383 P 81 Ø 1,61 mm 3 MLS →AAB 110 001→ 	<b>T07896-00</b> 068 103 384 A (12x) 	<b>V31637-00</b> 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X54131-01</b> 074 103 609 F 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM





VOLKSWAGEN

Ltr. 2,4 AAB 57 kW (78 PS) TRANSPORTER 70 R 160 001 → 07/90-09/98

<p><b>D32840-00</b> 074 198 012 A </p> <p><b>B31637-00</b> 074 198 011 A </p>	<p><b>H02394-00</b> 074 103 383 C 1,53 mm 1  → AAB 110 000</p> <p><b>H12394-10</b> 074 103 383 D 1,57 mm 2  → AAB 110 000</p> <p><b>H22394-20</b> 074 103 383 E 81 ∅ 1,61 mm 3  → AAB 110 000</p> <p><b>H00997-00</b> 074 103 383 M 1,53 mm 1  MLS → AAB 110 001 →</p> <p><b>H10997-10</b> 074 103 383 N 1,57 mm 2  MLS → AAB 110 001 →</p> <p><b>H20997-20</b> 074 103 383 P 81 ∅ 1,61 mm 3  MLS → AAB 110 001 →</p>	<p><b>T07896-00</b> 068 103 384 A (14x)</p>

2,4 ACL 70 kW (95 PS) LT TD 06/92-06/96

	<p><b>H00569-00</b> 072 103 383 CT 1,4 mm → ACL 014 031</p> <p><b>H10569-10</b> 072 103 383 DA 1,5 mm 2  → ACL 014 031</p> <p><b>H20569-20</b> 072 103 383 DB 78 ∅ 1,6 mm 3  → ACL 014 031</p> <p><b>H05685-00</b> 075 103 383 D 1,53 mm 1  MLS → ACL 014 032 →</p> <p><b>H15685-10</b> 075 103 383 E 1,57 mm 2  MLS → ACL 014 032 →</p> <p><b>H25685-20</b> 075 103 383 F 78 ∅ 1,61 mm 3  MLS → ACL 014 032 →</p>	<p><b>T08968-00</b> 068 103 384 A (14x)</p>



	<p><b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675</p>	<p><b>X56210-01</b> 074 129 717</p>	<p><b>X03747-01</b> 026 129 589 A</p>	<p><b>X54131-01</b> 074 103 609 F</p>	<p><b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM</p>
	<p><b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675</p>	<p><b>X08969-01</b> 072 129 717 A</p>	<p><b>X03747-01</b> 026 129 589 A</p>	<p><b>X54130-01</b> 075 103 609 C</p>	<p><b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM</p>





















VOLKSWAGEN												
Ltr.												
2,4 ACT	51 kW (69-70 PS)	LT D	08/89-06/96		<b>H00569-00</b> 072 103 383 CT 1,4 mm →ACT 011 319 <b>H10569-10</b> 072 103 383 DA 1,5 mm 2 →ACT 011 319 <b>H20569-20</b> 072 103 383 DB 78 Ø 1,6 mm 3 →ACT 011 319  <b>H05685-00</b> 075 103 383 D 1,53 mm 1 MLS →ACT 011 320→ <b>H15685-10</b> 075 103 383 E 1,57 mm 2 MLS →ACT 011 320→ <b>H25685-20</b> 075 103 383 F 78 Ø 1,61 mm 3 MLS →ACT 011 320→ 	<b>T08968-00</b> 068 103 384 A (14x) 	<b>X53843-01</b> 075 103 483 F NBR 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 12x 	<b>X08969-01</b> 072 129 717 A 	<b>X03747-01</b> 026 129 589 A 6x 	<b>X54130-01</b> 075 103 609 C 	<b>P76096-01 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
2,4 AJA	55 kW (75 PS)	TRANSPORTER	08/97-04/03	<b>D36651-00</b> ⑫  <b>B32840-00</b> 074 198 011 B →AJA 028 554 <b>B36651-00</b> ⑬ ⑮ →AJA 028 555→ →AJA 050 000 <b>B36656-00</b> ⑬ ⑮ →AJA 050 001→	<b>H00997-00</b> 074 103 383 M 1,53 mm 1 MLS <b>H10997-10</b> 074 103 383 N 1,57 mm 2 MLS <b>H20997-20</b> 074 103 383 P 81 Ø 1,61 mm 3 MLS 	<b>T07896-00</b> 068 103 384 A (12x) 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X54131-01</b> 074 103 609 F →AJA 050 000  <b>X54722-01</b> 074 103 609 H Stahl →AJA 050 001→ 	<b>P76096-01 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM →AJA 028 554 <b>P77317-01 K →</b> 028 103 171 B PTFE →AJA 028 555→ <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM	
2,4 CP	55 kW (75 PS)	LT D	→28 J 014 000 12/78-07/92	<b>D30282-00</b> ⑫ 076 198 015 B  <b>B31458-00</b> ⑬ 075 198 011 B	<b>H18968-10</b> 072 103 383 DH 1,5 mm 2 <b>H28968-20</b> 072 103 383 DJ 78,5 Ø 1,6 mm 3 	<b>T08968-00</b> 068 103 384 A (14x) 	<b>V31458-00</b> 072 198 025 A 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 12x 	<b>X08969-01</b> 072 129 717 A 	<b>X03747-01</b> 026 129 589 A 6x 	<b>X54130-01</b> 075 103 609 C 	<b>P76096-01 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM























⑮ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала
















VOLKSWAGEN

VOLKSWAGEN							
2,4 CP	55 kW (75 PS)	LT D	→ 28 J 014 001 →	12/78-07/92	 <b>S31458-00</b> (12) (13)  <b>D31458-00</b> (12)  <b>B31458-00</b> (13)	<b>H00569-00</b> 072 103 383 CT 1,4 mm <b>H10569-10</b> 072 103 383 DA 1,5 mm 2 M <b>H20569-20</b> 072 103 383 DB 78 Ø 1,6 mm 3 M 	<b>T08968-00</b> 068 103 384 A (14x) 
2,4 DL HS 1E	62-69 kW (82-94 PS)	LT		12/82 →	<b>S31646-00</b> (12) (13) <b>D31646-00</b> (12) <b>B31458-00</b> (13)	<b>H50165-00</b> 073 103 383 C 78,5 Ø 1,9 mm 	<b>T08968-00</b> 068 103 384 A (14x) 
2,4 DV DW 1G	55-75 kW (75-102 PS)	LT D LT TD	→ 28 J 014 000 → 28 J 014 000	08/78-09/93	<b>D30282-00</b> (12)  <b>B31458-00</b> (13)	<b>H18968-10</b> 072 103 383 DH 1,5 mm 2 M <b>H28968-20</b> 072 103 383 DJ 78,5 Ø 1,6 mm 3 M 	<b>T08968-00</b> 068 103 384 A (14x) 
2,4 DV DW 1G	55-75 kW (75-102 PS)	LT D LT TD	→ 28 J 014 001 → → 28 J 014 001 →	08/78-09/93	<b>S31458-00</b> (12) (13)  <b>D31458-00</b> (12)  <b>B31458-00</b> (13)	<b>H00569-00</b> 072 103 383 CT 1,4 mm <b>H10569-10</b> 072 103 383 DA 1,5 mm 2 M <b>H20569-20</b> 072 103 383 DB 78 Ø 1,6 mm 3 M 	<b>T08968-00</b> 068 103 384 A (14x) 
2,4 1S	51 kW (69-70 PS)	LT D		08/89-06/96	<b>S31458-00</b> (12) (13)  <b>D31458-00</b> (12)  <b>B31458-00</b> (13)	<b>H00569-00</b> 072 103 383 CT 1,4 mm <b>H10569-10</b> 072 103 383 DA 1,5 mm 2 M <b>H20569-20</b> 072 103 383 DB 78 Ø 1,6 mm 3 M 	<b>T08968-00</b> 068 103 384 A (14x) 


























<b>V31458-00</b> 072 198 025 A 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 12x	<b>X08969-01</b> 072 129 717 A 	<b>X03747-01</b> 026 129 589 A 6x 	<b>X54130-01</b> 075 103 609 C 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
<b>V31646-00</b> 073 198 025 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 12x	<b>X51298-01</b> 073 129 717 A 	<b>X03747-01</b> 026 129 589 A 6x 	<b>X54130-01</b> 075 103 609 C 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
<b>V31458-00</b> 072 198 025 A 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 12x	<b>X08969-01</b> 072 129 717 A 	<b>X03747-01</b> 026 129 589 A 6x  <b>X81946-01</b> 075 253 115 	<b>X54130-01</b> 075 103 609 C 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
<b>V31458-00</b> 072 198 025 A 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 12x	<b>X08969-01</b> 072 129 717 A 	<b>X03747-01</b> 026 129 589 A 6x  <b>X81946-01</b> 075 253 115 	<b>X54130-01</b> 075 103 609 C 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
<b>V31458-00</b> 072 198 025 A 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 12x	<b>X08969-01</b> 072 129 717 A 	<b>X03747-01</b> 026 129 589 A 6x 	<b>X54130-01</b> 075 103 609 C 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN			
Ltr. 			
2,4 22R 84 kW (114 PS) TARO	06/89-03/97	<b>S80951-00</b> (12) (13) J04 111 353 60 <b>D80951-00</b> (12) J04 112 353 30	<b>H80951-00</b> J11 115 350 60 94,5 Ø 
2,5 AAF ACU AEN	11/90-04/03	<b>S31644-00</b> (12) (13) <b>D31644-00</b> (12) 023 198 012 <b>B31637-00</b> (13) 074 198 011 A	<b>H50163-00</b> 023 103 383 B 82,5 Ø 1,8 mm 
2,5 ACV	09/95-04/03	<b>D36651-00</b> (12)   <b>B32840-00</b> 074 198 011 B → ACV 115 395 <b>B36651-00</b> (13) (35) → ACV 115 396→ → ACV 185 000 <b>B36656-00</b> (13) (35) → ACV 185 001→	<b>H02396-00</b> 074 103 383 AJ 1,53 mm 1  MLS <b>H12396-10</b> 074 103 383 AH 1,57 mm 2  MLS <b>H22396-20</b> 074 103 383 AG 82 Ø 1,61 mm 3  MLS 
2,5 AET	07/96-04/03	<b>D36660-00</b> <b>B32840-00</b> 074 198 011 B → AET 017 277 <b>B36651-00</b> (13) (35) → AET 017 278→ → AET 025 000 <b>B36656-00</b> (13) (35) → AET 025 001→	<b>H50163-00</b> 023 103 383 B 82,5 Ø 1,8 mm 

(12) junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



					
<b>V37937-00</b> 	<b>P76554-00</b> J90 913 021 10 8x	<b>X89715-01</b> J17 177 350 50 <b>X89828-01</b> (10) J17 176 350 20 	<b>X82237-01</b> J17 173 351 20 	<b>X54907-01</b> 	<b>P76338-11 K</b> → 80x100x10 A SL LD FPM
<b>V31637-00</b> 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X55159-01</b> 034 129 717 F 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X54131-01</b> 074 103 609 F 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM 2x
<b>X59781-01</b> X 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X54131-01</b> 074 103 609 F → ACV 185 000 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77317-01 K</b> →  028 103 171 B PTFE → ACV 115 396→ <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM 2x
	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X55159-01</b> 034 129 717 F 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X54131-01</b> 074 103 609 F → AET 025 000 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AET 017 277 <b>P77317-01 K</b> →  028 103 171 B PTFE → AET 025 001→ <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77182-01 N</b> 028 103 086 32x47x10 A SL LD PTFE

(35) contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



VOLKSWAGEN						
Ltr.						
2,5 AEU	81 kW (110 PS) TRANSPORTER	11/90-04/03	<b>D36660-00</b> 074 198 011 B → AEU 002 001 <b>B32840-00</b> (13) (35) → AEU 002 002→ → AEU 003 000 <b>B36651-00</b> (13) (35) → AEU 003 001→ <b>B36656-00</b> (13) (35) → AEU 003 001→	<b>H50163-00</b> 023 103 383 B 82,5 Ø 1,8 mm 	<b>T07896-00</b> 068 103 384 A (12x) 	
2,5 AFB AKN	110 kW (150 PS) PASSAT V6 TDI	07/98-05/05	<b>D32940-00</b> (12)  <b>B32940-00</b> (13) 	<b>H03136-00</b> 2x 059 103 383 BQ 1,1 mm 1 MLS <b>H13136-10</b> 2x 059 103 383 BR 1,15 mm 2 MLS <b>H23136-20</b> 2x 059 103 383 BS 79 Ø 1,2 mm 3 MLS 	<b>T03136-00</b> 059 103 384 (16x) 	
2,5 AGX	55 kW (75 PS) LT SDI	07/96-07/06	<b>D36651-00</b> (12)   <b>B32840-00</b> 074 198 011 B → AGX 009 000 <b>B36651-00</b> (13) (35) → AGX 009 001→ → AGX 016 876 <b>B36656-00</b> (13) (35) → AGX 016 877→	<b>H02396-00</b> 074 103 383 AJ 1,53 mm 1 MLS <b>H12396-10</b> 074 103 383 AH 1,57 mm 2 MLS <b>H22396-20</b> 074 103 383 AG 82 Ø 1,61 mm 3 MLS 	<b>T07896-00</b> 068 103 384 A (12x) 	

11 junta carter / Dichtung Ölsumpf / oil pan gasket / joint de carter d'huile / guarnizione coppa dell'olio / прокладка поддона картер



	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X55159-01</b> 034 129 717 F 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X54131-01</b> 074 103 609 F → AEU 003 000  <b>X54722-01</b> 074 103 609 H Stahl → AEU 003 001→ 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AEU 002 001 <b>P77317-01 K</b> → 028 103 171 B PTFE → AEU 002 002→ <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77182-01 N</b> 028 103 086 32x47x10 A SL LD PTFE
<b>V32940-00</b> 2x 059 198 025 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	<b>X58943-01</b> 2x 059 129 717 G 	<b>X52307-01</b> 6x 059 253 039 B  <b>X52930-01</b>	<b>X54465-01</b> 059 103 609 J  <b>70-31414-10</b>  <b>X54464-01</b> (11) 059 103 610 B 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77440-01 K</b> → 070 103 051 A 85x105x12 A SL LD PTFE <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
<b>X59781-01</b>	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 5x 026 129 589 A 	<b>X54131-01</b> 074 103 609 F → AGX 016 876  <b>X54722-01</b> 074 103 609 H Stahl → AGX 016 877→ 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM → AGX 009 000 <b>P77317-01 K</b> → 028 103 171 B PTFE → AGX 009 001→ <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM

35 contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала





VOLKSWAGEN						
Ltr.						
2,5	AHD	75 kW (102 PS) LT TDI	05/96-08/99	<b>D36651-00</b> <sup>(12)</sup>  <b>B32840-00</b> 074 198 011 B → AHD 036 065 <b>B36651-00</b> <sup>(13) (35)</sup> → AHD 036 066→ → AHD 063 000 <b>B36656-00</b> <sup>(13) (35)</sup> → AHD 063 001→	<b>H02396-00</b> 074 103 383 AJ 1,53 mm 1 MLS <b>H12396-10</b> 074 103 383 AH 1,57 mm 2 MLS <b>H22396-20</b> 074 103 383 AG 82 Ø 1,61 mm 3 MLS 	<b>T07896-00</b> 068 103 384 A (12x) 
2,5	AHY	111 kW (151 PS) TRANSPORTER	05/98-04/03	<b>D36656-00</b> <sup>(12)</sup>  <b>B36651-00</b> <sup>(13) (35)</sup> → AHY 005 000 <b>B36656-00</b> <sup>(13) (35)</sup> → AHY 005 001→	<b>H02396-00</b> 074 103 383 AJ 1,53 mm 1 MLS <b>H12396-10</b> 074 103 383 AH 1,57 mm 2 MLS <b>H22396-20</b> 074 103 383 AG 82 Ø 1,61 mm 3 MLS 	<b>T07896-00</b> 068 103 384 A (12x) 
2,5	AJT	65 kW (88 PS) TRANSPORTER	05/98-04/03	<b>D36656-00</b> <sup>(12)</sup>  <b>B36651-00</b> <sup>(13) (35)</sup> → AJT 016 000 <b>B36656-00</b> <sup>(13) (35)</sup> → AJT 016 001→	<b>H02396-00</b> 074 103 383 AJ 1,53 mm 1 MLS <b>H12396-10</b> 074 103 383 AH 1,57 mm 2 MLS <b>H22396-20</b> 074 103 383 AG 82 Ø 1,61 mm 3 MLS 	<b>T07896-00</b> 068 103 384 A (12x) 
2,5	ANF ANG ANH BBR BCT BCU BTW	40-111 kW (54-151 PS) Marine-Motor		<b>D36656-00</b> <sup>(12)</sup>  <b>B36656-00</b> <sup>(13) (35)</sup>	<b>H02396-00</b> 074 103 383 AJ 1,53 mm 1 MLS <b>H12396-10</b> 074 103 383 AH 1,57 mm 2 MLS <b>H22396-20</b> 074 103 383 AG 82 Ø 1,61 mm 3 MLS 	<b>T07896-00</b> 068 103 384 A (12x) 

<sup>(35)</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X59781-01</b> <sup>(X)</sup> 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A 	5x <b>X54131-01</b> 074 103 609 F → AHD 063 000 	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM → AHD 036 065 <b>P77317-01</b> K → 028 103 171 B PTFE → AHD 036 066→ <b>P76087-01</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM
<b>X59781-01</b> <sup>(X)</sup> 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A 	5x <b>X54131-01</b> 074 103 609 F → AHY 005 000 	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77317-01</b> K → 028 103 171 B PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77182-01</b> N 028 103 086 32x47x10 A SL LD PTFE
<b>X59781-01</b> <sup>(X)</sup> 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A 	5x <b>X54131-01</b> 074 103 609 F → AJT 016 000 	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77317-01</b> K → 028 103 171 B PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77182-01</b> N 028 103 086 32x47x10 A SL LD PTFE
	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A 	5x <b>X54722-01</b> 074 103 609 H Stahl 	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77317-01</b> K → 028 103 171 B PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77182-01</b> N 028 103 086 32x47x10 A SL LD PTFE



VOLKSWAGEN							
Ltr.							
2,5	ANJ APA AUF AVR AXG AXL AYC AYY BBE BBF	61-111 kW (83-151 PS)	LT TDI TRANSPORTER	09/95-07/06	<b>D36656-00</b> <sup>(12)</sup>  <b>B36656-00</b> <sup>(13) (35)</sup> 	<b>H02396-00</b> 074 103 383 AJ 1,53 mm 1 MLS <b>H12396-10</b> 074 103 383 AH 1,57 mm 2 MLS <b>H22396-20</b> 074 103 383 AG 82 Ø 1,61 mm 3 MLS 	<b>T07896-00</b> 068 103 384 A (12x) 
2,5	APL AVT	85 kW (115 PS)	TRANSPORTER	07/96-04/03	<b>D36660-00</b> <sup>(13) (35)</sup> <b>B36656-00</b> <sup>(13) (35)</sup>	<b>H50163-00</b> 023 103 383 B 82,5 Ø 1,8 mm 	<b>T07896-00</b> 068 103 384 A (12x) 
2,5	AXD AXE BAC BLJ BLK	96-128 kW (130-174 PS)	MULTIVAN TDI TOUAREG R5 TRANSPORTER	01/03→	<b>D37059-00</b> <sup>(12)</sup>  <b>B37059-00</b> <sup>(13)</sup>	<b>H01895-00</b> 070 103 383 M 1,27 mm 1 MLS <b>H11895-10</b> 070 103 383 N 1,35 mm 2 MLS <b>H21895-20</b> 070 103 383 P 83 Ø 1,43 mm 3 MLS 	<b>T08127-00</b> 070 103 384 (12x) 
2,5	BAU BDG BDH	120-132 kW (163-180 PS)	PASSAT V6 TDI	01/03-05/05	<b>D32940-00</b> <sup>(12)</sup>  <b>B32940-00</b> <sup>(13)</sup> 	<b>H03136-00</b> 2x 059 103 383 BQ 1,1 mm 1 MLS <b>H13136-10</b> 2x 059 103 383 BR 1,15 mm 2 MLS <b>H23136-20</b> 2x 059 103 383 BS 79 Ø 1,2 mm 3 MLS 	<b>T80448-00</b> 057 103 384 A (16x) 

<sup>(35)</sup> contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



<b>X59781-01</b> <sup>X</sup> 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A	5x <b>X54722-01</b> 074 103 609 H Stahl 	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77317-01</b> K → 028 103 171 B PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77182-01</b> N 028 103 086 32x47x10 A SL LD PTFE
	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X55159-01</b> 034 129 717 F 	<b>X03747-01</b> 026 129 589 A	5x <b>X54722-01</b> 074 103 609 H Stahl 	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77317-01</b> K → 028 103 171 B PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77182-01</b> N 028 103 086 32x47x10 A SL LD PTFE
<b>70-31414-10</b> 	<b>N93137-00</b> 027 109 675 (10x) <b>P76532-00</b> 027 109 675	<b>X89297-01</b> 070 129 717 A  <b>X89298-01</b> 070 129 717  <b>X89299-01</b> 2x 070 129 717 B 	<b>X81444-01</b> 070 253 039 C 	<b>70-31414-10</b> 	<b>P77440-01</b> K ← 070 103 051 A 85x105x12 A SL LD PTFE
<b>V32940-00</b> 2x 059 198 025 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	<b>X58943-01</b> 2x 059 129 717 G 	<b>X52307-01</b> 6x 059 253 039 B  <b>X52930-01</b>	<b>70-31414-10</b> 	<b>P76096-01</b> K ← 054 115 147 B 35x48x10 A SL RD FPM <b>P77440-01</b> K → 070 103 051 A 85x105x12 A SL LD PTFE <b>P76087-01</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM



VOLKSWAGEN						
Ltr.						
2,5 BGP BPR BPS BTK	110 kW (150 PS) JETTA NEW BEETLE	07/05→	<b>D37093-00</b> <sup>(12)</sup>	<b>H80754-00</b> 07K 103 383 F MLS 	<b>T80754-00</b> 06D 103 385 D (12x) 	
2,5 BGQ CBTA CBUA CCCA	110-125 kW (150-170 PS) BEETLE JETTA FSI	07/08→	<b>D37093-00</b> <sup>(12)</sup>	<b>H80754-00</b> 07K 103 383 F MLS 	<b>T80754-00</b> 06D 103 385 D (12x) 	
2,5 BJJ BJK BJL BJM	65-120 kW (88-163 PS) BUS 30-35 KASTEN 30-50 PRITSCHKE 30-50	04/06→	<b>D37060-00</b> <sup>(12)</sup>  <b>B37060-00</b> <sup>(13) (38)</sup>	<b>H01896-00</b> 076 103 383 C 1,53 mm MLS 1 <b>H11896-10</b> 076 103 383 D 1,57 mm MLS 2 <b>H21896-20</b> 076 103 383 E 81,5 Ø 1,61 mm MLS 3 	<b>T07896-00</b> 068 103 384 A (12x) 	
2,5 BNZ BPC BPD BPE	96-128 kW (130-174 PS) MULTIVAN TDI TOUAREG R5 TRANSPORTER	01/03→	<b>D37061-00</b> <sup>(12)</sup>  <b>B37059-00</b> <sup>(13)</sup>	<b>H01895-00</b> 070 103 383 M 1,27 mm MLS 1 <b>H11895-10</b> 070 103 383 N 1,35 mm MLS 2 <b>H21895-20</b> 070 103 383 P 83 Ø 1,43 mm MLS 3 	<b>T08127-00</b> 070 103 384 (12x) 	
2,5 CEBA CEBB CECA CECB	65-120 kW (88-163 PS) BUS 30-35 KASTEN 30-50 PRITSCHKE 30-50	04/06→	<b>D37060-00</b> <sup>(12)</sup>  <b>B37060-00</b> <sup>(13) (38)</sup>	<b>H01896-00</b> 076 103 383 C 1,53 mm MLS 1 <b>H11896-10</b> 076 103 383 D 1,57 mm MLS 2 <b>H21896-20</b> 076 103 383 E 81,5 Ø 1,61 mm MLS 3 	<b>T07896-00</b> 068 103 384 A (12x) 	

<sup>(38)</sup> sin retén en el lado de la transmisión / ohne Wedi Getriebes. / without shaft seal at gearbox end / sans bague d'étanchéité côté boîte de vitesse / senza paraolio per albero trasmissione lato cambio / без уплотнения вала со стороны коробки передач



<b>X83140-01</b> 07K 103 483 NBR 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X89311-01</b> 07K 129 717 A 5x 	<b>X81830-01</b> 07K 253 039 C 	<b>70-31414-10</b> 	<b>P77817-01 K</b> ← 07K 103 151 B PTFE <b>P77440-01 K</b> → 070 103 051 A 85x105x12 A SL LD PTFE
<b>X83140-01</b> 07K 103 483 NBR 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X89311-01</b> 07K 129 717 A 5x 	<b>X81830-01</b> 07K 253 039 C 	<b>70-31414-10</b> 	<b>P77440-01 K</b> → 070 103 051 A 85x105x12 A SL LD PTFE
<b>X59781-01</b> X 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X56210-01</b> 074 129 717 	<b>X81985-01</b> 074 253 039 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
<b>70-31414-10</b> 	<b>N93137-00</b> 027 109 675 (10x) <b>P76532-00</b> 027 109 675 10x	<b>X88926-01</b> 070 129 717 D  <b>X88931-01</b> 070 129 717 E  <b>X88932-01</b> 070 129 717 C 2x 	<b>X81444-01</b> 070 253 039 C 	<b>70-31414-10</b> 	<b>P77440-01 K</b> ← 070 103 051 A 85x105x12 A SL LD PTFE
<b>X59781-01</b> X 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X56210-01</b> 074 129 717 	<b>X81985-01</b> 074 253 039 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77821-01 K</b> → 076 103 171 B PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM



VOLKSWAGEN						
2,7 CG	48 kW (65 PS)	LT D	11/75-01/80	<b>D30900-00</b> ⑫ 061198012 <b>B30900-00</b> ⑬ 061198011	<b>H02898-00</b> 61103383 97,5 Ø 	
2,8 AAA	120-128 kW (163-174 PS)	GOLF V6 PASSAT V6 SHARAN V6 VENTO V6	06/91-04/00	<b>D32726-00</b> ⑫ 021 198 012 A → AAA 146 000 <b>D36996-00</b> ⑫ → AAA 146 001 → <b>B32726-00</b> ⑬ 021 198 011 → AAA 146 000 <b>B36996-00</b> ⑬ 021 198 011 A → AAA 146 001 →	<b>H50150-00</b> 021 103 383 H 83 Ø 	<b>T50150-00</b> 021 103 384 D (10x) +021 103 384 E (7x) +021 103 384 F (3x) 
2,8 ACK AGE ALG AMX APR ATX	132-142 kW (180-193 PS)	PASSAT V6	→ 3B W 500 000 08/96-05/05	<b>D36714-00</b> 2x 078 198 012 B <b>B32943-00</b> 079198011A <b>Z36190-00</b> ⑧ 2x 058 198 217	<b>H80491-00</b> 2x 078 103 383 L 83,5 Ø MLS 	<b>T50999-00</b> 2x 078 103 385 K (16x) 
2,8 ACK AGE ALG AMX APR AQD ATQ ATX	132-142 kW (180-193 PS)	PASSAT V6	→ 3B X 000 001 → 08/96-05/05	<b>D36715-00</b> 2x 078 198 012 F +068 103 085 E (2x) <b>B32943-00</b> 079198011A <b>Z36190-00</b> ⑧ 2x 058 198 217	<b>H80491-00</b> 2x 078 103 383 L 83,5 Ø MLS 	<b>T50999-00</b> 2x 078 103 385 K (16x) 
2,8 AES	103 kW (140 PS)	TRANSPORTER	11/95-05/00	<b>B36996-00</b> ⑬ 021 198 011 A → AES 009 433	<b>H50150-00</b> 021 103 383 H 83 Ø → AES 009 433 <b>H80100-00</b> 021 103 383 N 83,5 Ø MLS → AES 009 434 → 	<b>T50150-00</b> 021 103 384 D (10x) +021 103 384 E (7x) +021 103 384 F (3x) → AES 009 433 <b>T50478-00</b> 021 103 384 G (10x) +021 103 384 K (7x) +021 103 384 L (3x) → AES 009 434 → 

⑧ junta para tensor cadena de distribución / Dichtung Steuerkettenspanner / gasket timing chain tensioner / joint tendeur de chaîne / guarnizione tendicatena di distribuzione / прокладка натяжителя цепи привода распределительного вала



<b>X02602-01</b> 61103483 Kork 	<b>N90880-00</b> 	<b>X02601-01</b> 4x 36866201 	<b>X02600-01</b> 4x 3686442 <b>X02599-01</b> ⑩ 049204 		<b>P76402-01 K</b> → 073034 101,6x120x12 A LD FPM 	
<b>X53502-01</b> 021 103 483 B NBR → AAA 146 000 <b>X83104-01</b> 021 103 483 D NBR → AAA 146 001 → 	<b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 12x 	<b>X58346-01</b> 021 133 227 J <b>X58345-01</b> ⑩ 021 133 227 H 	<b>X51973-01</b> 021 253 039 E Zyl. 1 - 3 <b>X51974-01</b> 021 253 050 B Zyl. 4 - 6 <b>X81690-01</b> ⑩ 2x 357 253 115 D 	<b>X54363-01</b> 021 103 609 → AAA 146 000 <b>X54676-01</b> 021 103 609 B ACM → AAA 146 001 → 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM 	
<b>V53716-00</b> 2x 078 198 025 	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675 30x 	<b>X58942-01</b> 2x 078 129 717 J 	<b>X52306-01</b> 2x 078 253 039 C 	<b>X54463-01</b> 078 103 610 E <b>70-31414-10</b> 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76087-01 N</b> 4x 068 103 085 E 32x47x10 A SL WD FPM 	
<b>V53716-00</b> 2x 078 198 025 	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675 30x 	<b>X58942-01</b> 2x 078 129 717 J 	<b>X52308-01</b> 2x 078 253 039 G 	<b>X54463-01</b> 078 103 610 E <b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P76087-01 N</b> 4x 068 103 085 E 32x47x10 A SL WD FPM 	
<b>B36996-00</b> ⑬ 021 198 011 A → AES 009 433	<b>H50150-00</b> 021 103 383 H 83 Ø → AES 009 433 <b>H80100-00</b> 021 103 383 N 83,5 Ø MLS → AES 009 434 → 	<b>T50150-00</b> 021 103 384 D (10x) +021 103 384 E (7x) +021 103 384 F (3x) → AES 009 433 <b>T50478-00</b> 021 103 384 G (10x) +021 103 384 K (7x) +021 103 384 L (3x) → AES 009 434 → 	<b>X89184-01</b> 021 133 227 K <b>X58345-01</b> ⑩ 021 133 227 H 	<b>X51973-01</b> 021 253 039 E Zyl. 1 - 3 <b>X51974-01</b> 021 253 050 B Zyl. 4 - 6 	<b>X54676-01</b> 021 103 609 B ACM → AES 009 433 <b>70-31414-10</b> → AES 009 434 → 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM 

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус впускного коллектора





VOLKSWAGEN						
2,8 AFP	130 kW (177 PS)	GOLF JETTA V6	11/98→	<b>D37094-00</b> <b>B36716-00</b> ⑫ ⑬	<b>H80100-00</b> 021 103 383 N 83,5 Ø MLS 	<b>T50478-00</b> 021 103 384 G (10x) +021 103 384 K (7x) +021 103 384 L (3x) 
2,8 AGK ATA	92-96 kW (125-130 PS)	LT TDI	06/97-07/06	<b>D36661-00</b> <b>B36661-00</b> ⑫ ⑬	<b>H80472-00</b> 062 103 383 A 96 Ø 	<b>T80472-00</b> 062 103 384 (10x) 
2,8 AMV AXK AYL BDE BDF	147-150 kW (200-204 PS)	BORA V6  GOLF V6  SHARAN V6 TRANSPORTER	03/99→	<b>D36998-00</b> <b>B36716-00</b> ⑫ ⑬	<b>H80099-00</b> 022 103 383 F 82,5 Ø MLS 	<b>T80099-00</b> 022 103 384 C (12x) +022 103 384 D (6x) 
2,8 AMY	128 kW (174 PS)	SHARAN V6	09/95-04/00	<b>D36997-00</b> <b>B36997-00</b> ⑫ ⑬	<b>H80100-00</b> 021 103 383 N 83,5 Ø MLS 	<b>T50478-00</b> 021 103 384 G (10x) +021 103 384 K (7x) +021 103 384 L (3x) 
2,8 AQD ATQ	142 kW (193 PS)	PASSAT V6	08/96-05/05	<b>D36714-00</b> 078 198 012 B <b>B32943-00</b> 079198011A <b>Z36190-00</b> 058 198 217 ⑧	<b>H80491-00</b> 078 103 383 L 83,5 Ø MLS 	<b>T50999-00</b> 078 103 385 K (16x) 

⑫ junta para tensor cadena de distribución / Dichtung Steuerkettenspanner / gasket timing chain tensioner / joint tendeur de chaîne / guarnizione tendicatena di distribuzione / прокладка натяжителя цепи привода распределительного вала



<b>X83104-01</b> 021 103 483 D NBR 	<b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 12x	<b>X89179-01</b> 071 133 237 A 3x 	<b>X51973-01</b> 021 253 039 E Zyl. 1 - 3 	<b>X89180-01</b> 071 133 237 3x 	<b>X51974-01</b> 021 253 050 B Zyl. 4 - 6 
<b>X83011-01</b> 062 103 483 NBR 	<b>N93117-00</b> 062 109 675 (12x) <b>P76775-00</b> 062 109 675 12x	<b>X87650-01</b> 062 129 717 	<b>X81505-01</b> 062 129 589 4x 	<b>X81506-01</b> 	<b>X54721-01</b> 062 103 609 
<b>X83108-01</b> 022 103 483 E NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 24x	<b>X88307-01</b> 022 133 237 A 	<b>X81437-01</b> 022 253 039 B Zyl. 1 - 3 	<b>X81689-01</b> 022 253 050 B Zyl. 4 - 6 	<b>70-31414-10</b> 
<b>X83104-01</b> 021 103 483 D NBR 	<b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 12x	<b>X58346-01</b> 021 133 227 J 	<b>X51973-01</b> 021 253 039 E Zyl. 1 - 3 	<b>X58345-01</b> 021 133 227 H ⑩ 	<b>X51974-01</b> 021 253 050 B Zyl. 4 - 6 
<b>V53716-00</b> 078 198 025 2x 	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675 30x	<b>X58942-01</b> 078 129 717 J 2x 	<b>X52306-01</b> 078 253 039 C 2x 	<b>X81690-01</b> 357 253 115 D 2x 	<b>X54463-01</b> 078 103 610 E 
				<b>X54463-01</b> 078 103 610 E 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM
				<b>70-31414-10</b> 	<b>P77445-01 K ←</b> 062 115 147 64x80x9 B SL RD FPM <b>P77446-01 K →</b> 062 103 051 91x111x10 AB SL LD FPM
				<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K →</b> 068 103 051 P 85x105x9 A SL LD FPM
				<b>70-31414-10</b> 	<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM 4x

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус впускного коллектора





VOLKSWAGEN						
Ltr.						
2,8 AQP AUE	150 kW (204 PS) BORA V6 GOLF V6	03/99-06/06	<b>D37024-00</b> ⑫ <b>B36716-00</b> ⑬	<b>H80099-00</b> 022 103 383 F 82,5 Ø MLS 	<b>T80099-00</b> 022 103 384 C (12x) +022 103 384 D (6x) 	
2,8 AUH BCQ	116 kW (158 PS) LT TDI	05/01-07/06	<b>D40556-01</b> ⑫ <b>B36661-00</b> ⑬	<b>H40556-00</b> 062 103 383 B 96 Ø MLS 	<b>T80472-00</b> 062 103 384 (10x) 	
2,8 AYL BDE	150 kW (204 PS) BORA V6 GOLF V6 SHARAN V6	03/99-03/10	<b>D36998-00</b> ⑫ <b>B36716-00</b> ⑬	<b>H80099-00</b> 022 103 383 F 82,5 Ø MLS 	<b>T80099-00</b> 022 103 384 C (12x) +022 103 384 D (6x) 	↔ 1J 5D001 001, 1J 5U001 501, 1J 5W050 001→ ↔ 1J 5D001 001, 1J 5U001 501, 1J 5W050 001→ ↔ 7M 5 021 001→
2,8 BBG	140 kW (190 PS) PASSAT V6	09/99-11/00	<b>D36715-00</b> 078 198 012 F +068 103 085 E (2x) <b>Z36190-00</b> ⑧ 058 198 217	<b>H80491-00</b> 078 103 383 L 83,5 Ø MLS 	<b>T50999-00</b> 078 103 385 K (16x) 	2x
2,9 ABV	135-140 kW (184-190 PS) CORRADO V6 GOLF V6 PASSAT V6	08/91-04/99	<b>D32726-00</b> ⑫ 021 198 012 A ↔ ABV 023 000 <b>D36996-00</b> ⑫ ↔ ABV 023 001→ <b>B32726-00</b> ⑬ 021 198 011 ↔ ABV 023 000 <b>B36996-00</b> ⑬ 021 198 011 A ↔ ABV 023 001→	<b>H50150-00</b> 021 103 383 H 83 Ø 	<b>T50150-00</b> 021 103 384 D (10x) +021 103 384 E (7x) +021 103 384 F (3x) 	

⑧ junta para tensor cadena de distribución / Dichtung Steuerkettenspanner / gasket timing chain tensioner / joint tendeur de chaîne / guarnizione tendicateni di distribuzione / прокладка натяжителя цепи привода распределительного вала



<b>X83033-01</b> 022 103 483 D NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	<b>X88307-01</b> 022 133 237 A 	<b>X81437-01</b> 022 253 039 B Zyl. 1 - 3 <b>X81689-01</b> 022 253 050 B Zyl. 4 - 6 <b>X81690-01</b> 357 253 115 D 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
<b>X83011-01</b> 062 103 483 NBR 	<b>N93117-00</b> 062 109 675 (12x) <b>P76775-00</b> 062 109 675	<b>X87650-01</b> 062 129 717 	<b>X81505-01</b> 062 129 589 <b>X81506-01</b> 	<b>X54721-01</b> 062 103 609 	<b>P77445-01 K</b> ← 062 115 147 64x80x9 B SL RD FPM <b>P77446-01 K</b> → 062 103 051 91x111x10 AB SL LD FPM
<b>X83108-01</b> 022 103 483 E NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	<b>X88307-01</b> 022 133 237 A 	<b>X81437-01</b> 022 253 039 B Zyl. 1 - 3 <b>X81689-01</b> 022 253 050 B Zyl. 4 - 6 <b>X81690-01</b> 357 253 115 D 	<b>70-31414-10</b> 	<b>P77820-01 K</b> ← 022 103 151 D <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
<b>V53716-00</b> 078 198 025	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675	<b>X58942-01</b> 078 129 717 J	<b>X52308-01</b> 078 253 039 G 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X53502-01</b> 021 103 483 B NBR ↔ ABV 023 000 	<b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675	<b>X58346-01</b> 021 133 227 J <b>X58345-01</b> ⑩ 021 133 227 H 	<b>X51973-01</b> 021 253 039 E Zyl. 1 - 3 <b>X51974-01</b> 021 253 050 B Zyl. 4 - 6 	<b>X54363-01</b> 021 103 609 ↔ ABV 023 000 	<b>P76096-01 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM
<b>X83104-01</b> 021 103 483 D NBR ↔ ABV 023 001→ 				<b>X54676-01</b> 021 103 609 B ACM ↔ ABV 023 001→ 	

⑩ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус впускного коллектора



VOLKSWAGEN

Ltr. 3,0 BKS  
 165 kW (224-225 PS)  
 PHAETON V6 TDI  
 TOUAREG TDI

09/04→

<b>D37054-00</b> ⑫ Zyl. 1 - 3 	<b>H01841-00</b> 059 103 383 CM 1,1 mm 1	<b>T80448-00</b> 057 103 384 A (16x) 
<b>D37055-00</b> ⑫ Zyl. 4 - 6 	<b>H11841-10</b> 059 103 383 CN 1,15 mm 2	
<b>B37054-00</b> ⑬	<b>H21841-20</b> 059 103 383 CP 1,2 mm 3	
	<b>H01842-00</b> 059 103 383 CQ 1,1 mm 1	
	<b>H11842-10</b> 059 103 383 CR 1,15 mm 2	
	<b>H21842-20</b> 059 103 383 CS 1,2 mm 3	

<b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 24x 036 109 675	<b>X89125-01</b> 2x 059 129 717 J 	<b>X81941-01</b> 2x 059 253 039 D 	<b>70-31414-10</b> 	<b>P77441-01 K ←</b> 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K →</b> 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
<b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR 					



VOLKSWAGEN















Ltr. 













**1**

3,0 BUN 155 kW (211 PS) TOUAREG TDI

04/06-05/10

		
<p><b>D37054-00</b> ⑫ Zyl. 1 - 3 </p> <p><b>D37055-00</b> ⑫ Zyl. 4 - 6 </p> <p><b>B37054-00</b> ⑬</p>	<p><b>H01841-00</b> 059 103 383 CM 1,1 mm 1 </p> <p>Zyl. 1 - 3</p> <p><b>H11841-10</b> 059 103 383 CN 1,15 mm 2 </p> <p>Zyl. 1 - 3</p> <p><b>H21841-20</b> 059 103 383 CP 1,2 mm 3 </p> <p>Zyl. 1 - 3</p>	<p><b>T80448-00</b> 057 103 384 A (16x)</p> 
<p><b>H01842-00</b> 059 103 383 CQ 1,1 mm 1 </p> <p>Zyl. 4 - 6</p> <p><b>H11842-10</b> 059 103 383 CR 1,15 mm 2 </p> <p>Zyl. 4 - 6</p> <p><b>H21842-20</b> 059 103 383 CS 1,2 mm 3 </p> <p>Zyl. 4 - 6</p>		
 		

					
<p><b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR</p> 	<p><b>N92830-00</b> 036 109 675 (24x) <b>N92993-00</b> 2x 036 109 675 (12x) <b>P76662-00</b> 24x 036 109 675</p>	<p><b>X89125-01</b> 2x 059 129 717 J</p> 	<p><b>X81941-01</b> 2x 059 253 039 D</p> 	<p><b>P77441-01 K ←</b> 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K →</b> 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>	
<p><b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR</p> 					



VOLKSWAGEN											
Ltr.											
3,0 CARA CASA CASB CASC CASD CATA CEXA	150-176 kW (204-240 PS) PHAETON TDI TOUAREG TDI	11/04→									
			<p><b>D37055-01</b> ⑫ Zyl. 4 - 6</p> <p></p> <p><b>D38060-00</b> ⑫ Zyl. 1-3</p> <p></p> <p><b>B38110-00</b> ⑬</p>	<p><b>H01404-00</b> 059 103 383 EP 84 Ø 1,1 mm 1 □ MLS Zyl. 4-6</p> <p><b>H11404-10</b> 059 103 383 EQ 84 Ø 1,15 mm 2 □ MLS Zyl. 4-6</p> <p><b>H21404-20</b> 059 103 383 ER 84 Ø 1,2 mm 3 □ MLS Zyl. 4-6</p> <p></p> <p><b>H01406-00</b> 059 103 383 ES 84 Ø 1,1 mm 1 □ MLS Zyl. 1-3</p> <p><b>H11406-10</b> 059 103 383 ET 84 Ø 1,15 mm 2 □ MLS Zyl. 1-3</p> <p><b>H21406-20</b> 059 103 383 FA 84 Ø 1,2 mm 3 □ MLS Zyl. 1-3</p> <p></p>	<p><b>T80448-00</b> 057 103 384 A (16x)</p> <p></p>	<p><b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR</p> <p></p> <p><b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR</p> <p></p>	<p><b>N92993-00</b> 2x 036 109 675 (12x) <b>P76662-00</b> 24x 036 109 675</p>	<p><b>X89125-01</b> 2x 059 129 717 J</p> <p></p>	<p><b>X81941-01</b> 2x 059 253 039 D</p> <p></p>	<p><b>70-31414-10</b></p> <p></p>	<p><b>P77441-01 K ←</b> 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K →</b> 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
			⑫ ⑬	L R	← → K N (A)	START STOP					

VOLKSWAGEN							
Ltr.	3,0 CEZA	195 kW (265 PS)		1	<p><b>D37055-00</b> ⑫ Zyl. 4 - 6</p> <p><b>D38060-00</b> ⑫ Zyl. 1-3</p> <p><b>B38110-00</b> ⑬</p>	<p><b>H01841-00</b> 059 103 383 CM 1,1 mm 1</p> <p><b>H11841-10</b> 059 103 383 CN 1,15 mm 2</p> <p><b>H21841-20</b> 059 103 383 CP 1,2 mm 3</p> <p><b>H01842-00</b> 059 103 383 CQ 1,1 mm 1</p> <p><b>H11842-10</b> 059 103 383 CR 1,15 mm 2</p> <p><b>H21842-20</b> 059 103 383 CS 1,2 mm 3</p>	<p><b>T80448-00</b> 2x 057 103 384 A (16x)</p>
3,0 CGEA CGFA CJTA	213-245 kW (290-333 PS)	TOUAREG TSI	04/10→	<p><b>D38069-00</b> ⑫ Zyl. 1-3</p> <p><b>D38070-00</b> ⑫ Zyl. 4-6</p> <p><b>B38111-00</b> ⑬ ⑮</p>	<p><b>H40461-00</b> 06E 103 148 AD 85,2 ∅ MLS Zyl. 1-3</p> <p><b>H40462-00</b> 06E 103 149 AD 85,2 ∅ MLS Zyl. 4-6</p>	<p><b>T80728-00</b> 2x 06E 103 385 (8x)</p>	

⑫ junta, carcasa de colector de admisión / Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



<p><b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR</p> <p><b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR</p>	<p><b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 24x 036 109 675</p>	<p><b>X89125-01</b> 2x 059 129 717 J</p>	<p><b>X81941-01</b> 2x 059 253 039 D</p>	<p><b>70-31414-10</b></p>	<p><b>P77441-01 K ←</b> 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K →</b> 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
<p><b>X83361-01</b> 06E 103 484 N Zyl. 1-3</p> <p><b>X83362-01</b> 06E 103 483 P Zyl. 4-6</p>	<p><b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 24x 036 109 675</p>	<p><b>X59476-01</b> 6x 079 129 717 D</p> <p><b>X89852-01</b> ⑩ 6x 079 129 717 B</p>	<p><b>X81442-01</b> 2x 06E 253 039 C</p>	<p><b>70-31414-10</b></p>	<p><b>P77452-01 K ←</b>  06E 103 153 E PTFE <b>P77362-01 K →</b> 079 103 051 F 85x105x8,8 A SL LD PTFE ACM</p>

⑮ contiene retén integrado / enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала





VOLKSWAGEN														
Ltr.														
3,0 CJGD CJMA CNRB CRCA <b>[NEW]</b>	150-180 kW (204-245 PS) TOUAREG TDI	01/10→	<b>D38407-00</b> ⑫  <b>B38736-00</b> ⑬	<b>H40585-00</b> 059 103 383 JL 84 Ø 1,58 mm 1 □ MLS Zyl. 1-3 <b>H40585-10</b> 059 103 383 JM 84 Ø 1,63 mm 2 □ MLS Zyl. 1-3 <b>H40585-20</b> 059 103 383 JN 84 Ø 1,68 mm 3 □ MLS Zyl. 1-3  <b>H40586-00</b> 059 103 383 JP 84 Ø 1,58 mm 1 □ MLS Zyl. 4-6 <b>H40586-10</b> 059 103 383 JQ 84 Ø 1,63 mm 2 □ MLS Zyl. 4-6 <b>H40586-20</b> 059 103 383 JR 84 Ø 1,68 mm 3 □ MLS Zyl. 4-6 	<b>T40585-00</b> WHT 005 262 (8x) 	2x	<b>X83407-01</b> 059 103 484 Zyl. 1-3  <b>X83408-01</b> 059 103 483 T Zyl. 4-6 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 24x	<b>X59478-01</b> 059 129 717 N  <b>X59481-01</b> 059 129 718 A 	6x 6x	<b>X82514-01</b> 059 253 039 N 	2x	<b>70-31414-10</b> 	<b>P77765-01 K ←</b> 057 103 051 55x70x8 A SL RD FPM <b>P77766-01 K →</b> 059 103 051 H 85x105x8 A SL LD FPM
3,0 CNGA <b>[NEW]</b>	184 kW (250 PS)		<b>D37064-01</b> ⑫	<b>H80734-00</b> 03H 103 383 H 85 Ø MLS 	<b>T80734-00</b> WHT 000 497 A (13x) +WHT 000 789 A (7x) 		<b>X83128-01</b> 03H 103 483 C NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 24x	<b>X89886-01</b> 03H 133 237 D 		<b>X82352-01</b> 03H 253 039 H Zyl. 1-3  <b>X82353-01</b> 03H 253 050 D Zyl. 4-6 	<b>70-31414-10</b> 	<b>P77822-01 K ←</b> 03H 03 151 B <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM	




VOLKSWAGEN										
3,2	AXJ	165 kW (224 PS)	NEW BEETLE RSI	04/00-05/01						
					<b>H80453-00</b> 022 103 383 M 85 Ø MLS 					
3,2	AXZ	184 kW (250 PS)	PASSAT V6 FSI ↔ 3C 6 075 001, 3C 6E 088 001→	11/05-11/10						
					<b>D37064-00</b> ⑫	<b>H80734-00</b> 03H 103 383 H 85 Ø MLS 	<b>T80734-00</b> WHT 000 497 A (13x) +WHT 000 789 A (7x) 			<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM
3,2	AYT AZZ BAA BDL BFH BJS BKJ BKK BKL BML BMV BMX BRJ BRK CFLA	162-177 kW (220-241 PS)	GOLF R32 ↔ 1J 5D001 001, 1J 5U001 501, 1J 5W050 001→ GOLF V6 ↔ 1J 5D001 001, 1J 5U001 501, 1J 5W050 001→ MULTIVAN V6 ↔ 7H 5 070 001→ PHAETON V6 ↔ 3D 5 004 001→ TOUAREG ↔ 7L 5 055 001→ TRANSPORTER ↔ 7H 5 070 001→	04/02→						
					<b>D37008-00</b> ⑫	<b>H80453-00</b> 022 103 383 M 85 Ø MLS 	<b>T80453-00</b> 022 103 384 L (13x) +022 103 384 M (7x) 			<b>P77820-01 K ←</b> 022 103 151 D <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM
3,2	AYT BDL BFH BJS BKK BKL BML BRK CFLA	170-177 kW (231-241 PS)	GOLF R32 ↔ → 1J 5D001 000, 1J 5U001 000, 1J 5W050 000 GOLF V6 ↔ → 1J 5D001 000, 1J 5U001 000, 1J 5W050 000 MULTIVAN V6 ↔ → 7H 5 070 000 PHAETON V6 ↔ → 3D 5 004 000 TRANSPORTER ↔ → 7H 5 070 000	04/02→						
					<b>D37008-00</b> ⑫	<b>H80453-00</b> 022 103 383 M 85 Ø MLS 	<b>T80453-00</b> 022 103 384 L (13x) +022 103 384 M (7x) 			<b>P76096-11 K ←</b> 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM



VOLKSWAGEN

VOLKSWAGEN														
3,2	AZZ BAA BKJ BMV BMX BRJ	162-177 kW (220-241 PS)	TOUAREG	→7L 5 055 000	10/02-11/06	<b>D37008-00</b> <sup>12</sup>	<b>H80453-00</b> 022 103 383 M 85 Ø MLS 	<b>T80453-00</b> 022 103 384 L (13x) +022 103 384 M (7x) 	<b>X83108-01</b> 022 103 483 E NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 24x 	<b>X89128-01</b> 022 133 237 C 	<b>X81441-01</b> 022 253 050 C Zyl. 4 - 6  <b>X81963-01</b> 022 253 039 E Zyl. 1 - 3 	<b>70-31414-10</b> 	<b>P77447-01 K ←</b> 022 103 085 35x48x10 A RD PTFE ACM <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM
3,2	BUB CBRA	184 kW (250 PS)	EOS V6 GOLF V6		11/05-05/09	<b>D37008-00</b> <sup>12</sup>	<b>H80453-00</b> 022 103 383 M 85 Ø MLS 	<b>T80453-00</b> 022 103 384 L (13x) +022 103 384 M (7x) 	<b>X83108-01</b> 022 103 483 E NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 24x 	<b>X89128-01</b> 022 133 237 C 	<b>X81441-01</b> 022 253 050 C Zyl. 4 - 6  <b>X81963-01</b> 022 253 039 E Zyl. 1 - 3 	<b>70-31414-10</b> 	<b>P77820-01 K ←</b> 022 103 151 D <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM
3,6	BHK BHL BLV	206 kW (280 PS)	PASSAT FSI TOUAREG FSI	↔7L 6 030 001→ ↔7L 6 030 001→	10/05→	<b>D37064-00</b> <sup>12</sup> 	<b>H80734-00</b> 03H 103 383 H 85 Ø MLS 	<b>T80734-00</b> WHT 000 497 A (13x) +WHT 000 789 A (7x) 	<b>X83128-01</b> 03H 103 483 C NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 24x 	<b>X89300-01</b> 03H 133 237 B 	<b>X81832-01</b> 03H 253 039 E Zyl. 1 - 3  <b>X81834-01</b> 03H 253 050 B Zyl. 4 - 6 	<b>70-31414-10</b> 	<b>P77820-01 K ←</b> 022 103 151 D <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM
3,6	BWS CDVA CDVB CGRA CHNA CMTA CMVA CNNA  <b>[NEW]</b>	183-220 kW (249-300 PS)	CC FSI EOS PASSAT FSI PASSAT R36 PHAETON TOUAREG FSI		04/07→	<b>D37064-01</b> <sup>12</sup>	<b>H80734-00</b> 03H 103 383 H 85 Ø MLS 	<b>T80734-00</b> WHT 000 497 A (13x) +WHT 000 789 A (7x) 	<b>X83128-01</b> 03H 103 483 C NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 24x 	<b>X89886-01</b> 03H 133 237 D 	<b>X82352-01</b> 03H 253 039 H Zyl. 1-3  <b>X82353-01</b> 03H 253 050 D Zyl. 4-6 	<b>70-31414-10</b> 	<b>P77822-01 K ←</b> 03H 03 151 B <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM



VOLKSWAGEN

VOLKSWAGEN												
Ltr.												
4,0 BDN BDP	202 kW (275 PS) PASSAT W8	09/01-09/04			<b>H80445-00</b> 07D 103 148 J MLS Zyl. 1 - 4 	<b>T80721-00</b> 2x 07D 103 384 A (10x) +07D 103 385 A (5x) 	<b>X83344-01</b> 07D 103 483 C Zyl. 5-8 	<b>N92002-00</b> 2x 036 109 675 (15x) <b>P76662-00</b> 30x 036 109 675	<b>X81942-01</b> 2x 07D 253 039 A 	<b>X54809-01</b> 2x 07D 103 609 H 	<b>P77442-01 K ←</b> 06C 103 085 42x55x7 AB SL RD PTFE ACM <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM	
4,2 AXQ BGH BGJ	228-246 kW (310-335 PS) PHAETON V8 TOUAREG V8	12/02→	<b>D32944-00</b> <sup>12</sup> 077198012E	<b>H80001-00</b> 077 103 383 BS 86 Ø MLS Zyl. 5 - 8 	<b>T80002-00</b> 2x 077 103 385 D (10x) 	<b>X83345-01</b> 07D 103 484 C Zyl. 1-4 	<b>N90298-00</b> 2x 036 109 675 (20x) <b>P76662-00</b> 40x 036 109 675	<b>X58947-01</b> 2x 077 129 717 Q 	<b>X52312-01</b> 2x 077 253 039 C 	<b>70-31414-10</b> 	<b>P76443-01 K ←</b> 55x68x8 A SL RD FPM <b>P76087-01 N</b> 4x 068 103 085 E 32x47x10 A SL WD FPM	
4,2 BAR CGNA	257-265 kW (350-360 PS) TOUAREG FSI	06/06→		<b>H80764-00</b> 079 103 383 AQ MLS Zyl. 1 - 4 			<b>N92990-00</b> 2x 036 109 675 (16x) <b>P76662-00</b> 32x 036 109 675			<b>70-31414-10</b> 	<b>P77444-01 K ←</b> 079 103 051 G 55x72x8 A SL RD FPM <b>P77362-01 K →</b> 079 103 051 F 85x105x8,8 A SL LD PTFE ACM	



VOLKSWAGEN

Ltr. 4,2 CKDA 250 kW (340 PS) TOUAREG TDI 01/10→

	<p><b>H40580-00</b> 057 103 383 HF 84 Ø 1,1 mm 1 </p> <p>MLS Zyl. 1-4</p> <p><b>H40580-10</b> 057 103 383 HG 84 Ø 1,15 mm 2 </p> <p>MLS Zyl. 1-4</p> <p><b>H40580-20</b> 057 103 383 HH 84 Ø 1,2 mm 3 </p> <p>MLS Zyl. 1-4</p>	<p><b>T80610-00</b> 2x 057 103 384 A (10x)</p>
	<p><b>H40581-00</b> 057 103 383 HJ 84 Ø 1,1 mm 1 </p> <p>MLS Zyl. 5-8</p> <p><b>H40581-10</b> 057 103 383 HK 84 Ø 1,15 mm 2 </p> <p>MLS Zyl. 5-8</p> <p><b>H40581-20</b> 057 103 383 HL 84 Ø 1,2 mm 3 </p> <p>MLS Zyl. 5-8</p>	


















<p><b>X59505-01</b> 057 103 484 Zyl. 1-4</p> <p><b>X59506-01</b> 057 103 483 J Zyl. 5-8</p>	<p><b>N92990-00</b> 2x 036 109 675 (16x)</p> <p><b>P76662-00</b> 32x 036 109 675</p>	<p><b>X59471-01</b> 0 2x 057 129 717 H</p> <p><b>X59472-01</b> U 2x 057 129 717 G</p>	<p><b>X59646-01</b> 2x 057 253 039 K</p> <p><b>X59647-01</b> 2x 057 253 039 K</p>	<p><b>70-31414-10</b></p>	<p><b>P77765-01 K ←</b> 057 103 051 55x70x8 A SL RD FPM</p> <p><b>P77766-01 K →</b> 059 103 051 H 85x105x8 A SL LD FPM</p> <p><b>P77182-01 N</b> 028 103 086 32x47x10 A SL LD PTFE</p>







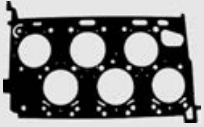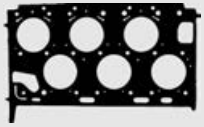






0 arriba / oben / top / haut / superiore / сверху

U debajo / unten / bottom / bas / inferiore / снизу





VOLKSWAGEN						
Ltr. 						
5,0 AJS AYH BLE BWF CBWA	230-257 kW (313-350 PS) PHAETON V10 TDI TOUAREG TDI	10/02→		<p><b>H01856-00</b> 07Z 103 148 1  MLS Zyl. 1 - 5</p> <p><b>H11856-10</b> 07Z 103 148 A 2  MLS Zyl. 1 - 5</p> <p><b>H21856-20</b> 07Z 103 148 B 3  MLS Zyl. 1 - 5</p>  <p><b>H01857-00</b> 07Z 103 149 1  MLS Zyl. 6 - 10</p> <p><b>H11857-10</b> 07Z 103 149 A 2  MLS Zyl. 6 - 10</p> <p><b>H21857-20</b> 07Z 103 149 B 3  MLS Zyl. 6 - 10</p> 		
6,0 CFRA	331 kW (450 PS) TOUAREG W12	08/04-05/10		<p><b>H80732-00</b> 07C 103 148 R MLS Zyl. 1 - 6</p>  <p><b>H80733-00</b> 07C 103 149 N MLS Zyl. 7 - 12</p> 	<p><b>T80732-00</b> 2x 07D 103 384 A (14x) +07D 103 385 A (7x)</p> 	

					
	<p><b>N92111-00</b> 027 109 675 (20x) <b>P76532-00</b> 027 109 675</p> <p>20x</p>	<p><b>X89186-01</b> 2x 07Z 129 717 A</p> 	<p><b>X81949-01</b> 2x 07Z 253 039 D</p> 	<p><b>70-31414-10</b></p> 	<p><b>P77448-01 K ←</b> 07Z 103 051 93x114x10 AB SL LD PTFE <b>P77449-01 K →</b> 07Z 103 085 A 63x76x8,8 AB SL RD PTFE</p>
<p><b>X83346-01</b> 07C 103 484 C Zyl. 7-12</p>  <p><b>X83347-01</b> 07C 103 483 C Zyl. 1-6</p> 	<p><b>N92830-00</b> 2x 036 109 675 (24x) <b>P76662-00</b> 036 109 675</p> <p>48x</p>		<p><b>X81983-01</b> 4x 07C 253 039 D</p> 	<p><b>70-31414-10</b></p> 	<p><b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM</p>

